

12.3.138
16-23-06

Prepared for:
Longview Fibre Company
Longview, Washington



Phase I Environmental Site Assessment of Longview Fibre Seattle Facility, Seattle, Washington

ENSR Corporation
October 23, 2006
Document No.: 04320006.0001


ENSR | AECOM




LFC000001

Prepared for:
Longview Fibre Company
Longview, Washington

Phase I Environmental Site Assessment of Longview Fibre Seattle Facility, Seattle, Washington

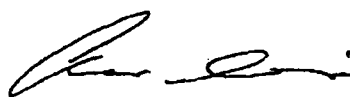

Prepared By Don Clabaugh, PE for

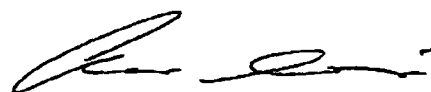

Reviewed By Aaron B. Gesin

ENSR Corporation
October 23, 2006
Document No.: 04320-006-0001

ENSR | AECOM

LFC000002

Contents

1.0 Introduction.....	1-1
1.1 Purpose	1-1
1.2 Scope-of-Work and Additional Services.....	1-1
1.3 Study Limitations	1-1
1.4 Site Specific Limitations	1-2
1.4.1 Data Failure/Data Gaps.....	1-2
1.5 Environmental Professional statement.....	1-2
2.0 Site Description	2-1
2.1 Location	2-1
2.2 Site and Vicinity Characteristics.....	2-1
2.3 Current use of the Subject Property	2-1
2.4 Description of Structures.....	2-2
2.5 Utilities	2-2
2.6 Current Use of Adjoining Properties	2-3
3.0 User Provided Information.....	3-1
3.1 Title Records/Environmental Liens/Specialized Knowledge/Value Reduction Issues.....	3-1
3.2 Reason for Performing the Phase I ESA.....	3-1
4.0 Records Information	4-1
4.1 Standard Environmental Records Sources	4-1
4.2 Additional Environmental Records Sources.....	4-3
4.3 Physical Setting Information	4-5
4.4 Historical Use Information on the Subject Property and Adjacent Sites	4-5
4.5 Previous Environmental Reports	4-7
5.0 Site Reconnaissance	5-1
5.1 Methodology	5-1
5.2 Water	5-1
5.2.1 Potable Water	5-1
5.2.2 Wastewater.....	5-1
5.2.3 Stormwater.....	5-1
5.3 Hazardous Materials Use/Storage.....	5-1
5.3.1 Container Storage Areas.....	5-2

5.3.2	Above Ground Storage Tanks.....	5-2
5.3.3	Underground Storage Tanks.....	5-2
5.4	Hazardous/Solid Waste.....	5-2
5.5	Polychlorinated Biphenyls (PCBs).....	5-3
5.6	Surface Staining/Stressed Vegetation/Debris	5-3
6.0	Interviews	6-1
6.1	Interview with Current Subject Property Owner	6-1
6.2	Interview with Past Owners, Operators, and Occupants	6-1
6.3	Interviews with Government Agencies	6-1
7.0	Findings and Opinions	7-1
8.0	Conclusions	8-1
9.0	References and Contacts	9-1

List of Figures

Figure 1 – Site Location Map

Figure 2 – Site Plan

List of Appendices

Appendix A - Photo Log

Appendix B - EDR Radius Map Report and Environmental Lien Search Report

Appendix C – Historical Research Documentation

Appendix D – Qualifications of the Environmental Professional(s)

1.0 Introduction

1.1 Purpose

ENSR Corporation (ENSR) was retained by Longview Fibre Company to perform a Phase I Environmental Site Assessment (ESA) at their Seattle, Washington facility, hereinafter referred to as the Subject Property. The purpose of the ESA was to identify the presence of Recognized Environmental Conditions (REC) as defined by ASTM Standard E-1527-05 (Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process) that may be associated with the Subject Property.

ENSR representative, Don Clabaugh, PE, visited the Subject Property on September 21, 2006, to conduct a site reconnaissance. Mr. Clabaugh met with the following facility employees:

- Mr. Mike Anderson, Production General Supervisor, and Environmental and Maintenance Supervisor, and
- Mr. Danny Buckholz, long-time maintenance worker.

Mr. Anderson escorted ENSR throughout the site visit and provided oral and written information regarding current and historical facility operations.

1.2 Scope-of-Work and Additional Services

This ESA has been performed in accordance with ENSR's proposal dated August 17, 2006, which is incorporated by reference. No additional services were performed.

1.3 Study Limitations

This report describes the results of ENSR's assessment to identify the potential presence of environmental liabilities materially affecting the subject site. To accomplish this, ENSR utilized publicly available, practically reviewable, and reasonably ascertainable information, as defined by ASTM E1527-05, which meets the requirements of Chapter 40 Code of Federal Regulations (CFR) Part 312 and is intended to constitute *all appropriate inquiry* for purposes of the landowner liability protections (LLPs).

In the conduct of this due diligence investigation, ENSR attempted to independently assess the presence of potential environmental problems within the limits of the established scope of work as described in our proposal. As with any due diligence evaluation, there is a degree of dependence upon oral information provided by facility or site representatives that is not readily verifiable through visual observations or supported by any available written documentation. ENSR shall not be held responsible for conditions or consequences arising from relevant facts that were concealed, withheld, misrepresented, or not fully disclosed by facility or site representatives at the time this assessment was performed.

This report was prepared by, and all field data and notes were gathered by, ENSR in accordance with the agreed upon scope of work and generally accepted engineering and scientific practice in effect at the time of ENSR's assessment of the Subject Property. The statements, conclusions, and opinions contained in this report are intended to give only approximations of the environmental conditions at the Subject Property.

This report is prepared pursuant to an agreement between the client and ENSR and is for the exclusive use of the client. No other party is entitled to rely on the conclusions, observations, specifications, or data contained herein without first signing an ENSR Reliance Letter. A third party's signing of ENSR's Reliance Letter is a condition precedent to any additional use or reliance on this report.

The passage of time may result in changes in technology, economic conditions, site variations, or regulatory provisions which could render parts of this report inaccurate. As a result, this report accurately represents current conditions in the area of interest. Future reliance on the report shall be at the user's sole risk. Should ENSR be required to review the report after six (6) months from its date of submission, ENSR shall be entitled to additional compensation at then existing rates or such other terms as may be agreed upon between ENSR and the client.

1.4 Site Specific Limitations

During the course of this assessment, the following limitation was encountered:

- Per ASTM, past owners, operators, and occupants of the Subject Property, who are likely to have material information regarding the potential for contamination at the Subject Property, shall be conducted to the extent that they can be identified and that the information likely to be obtained is not duplicative of information already obtained from other sources. Limitations were encountered associated with contacting past owners, operators, and occupants of the Subject Property.

1.4.1 Data Failure/Data Gaps

The above-mentioned limitation and resulting data gap are discussed below.

- Site contacts were unable to obtain contact information for former owners or employees that are likely have information on historical waste management practices at the Longview Fibre facility/property. As a result, little is known about Longview Fibre's operations from the time the company commenced operations until the late 1980s. ENSR considers this a significant data gap.

1.5 Environmental Professional statement

I declare that, to the best of my professional knowledge and belief, I meet the definition of an Environmental Professional as defined in §312.10 of 40 CFR and that I have the specific qualifications based on education, training, and experience (See Appendix D) to assess a property of the nature, history, and setting of the Subject Property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Name: Don Clabaugh, PE Title: Senior Program Manager

Signature:  _____

Date: 10/23/06

(for Don Clabaugh)

2.0 Site Description

2.1 Location

The Subject Property consists of a 3.46 acre parcel addressed as 5901 E. Marginal Way South in Seattle, Washington (Figures 1 and 2). The City of Seattle Tax Assessor identifies the property as parcel 1924049091, King County, Seattle, Washington. Longview Fibre of Longview, Washington, is listed as the Subject Property's current owner.

2.2 Site and Vicinity Characteristics

The Subject Property is situated in a densely developed industrial area that includes a mix of residential and commercial properties. The Subject Property and those immediately to the north and south are zoned for industrial use. This general area is low and flat lying, having been developed on a former tidal flat in the south portion of Elliot Bay. The Subject Property is dominated by the Longview Fibre building, which covers roughly 90 percent of the property; asphaltic pavement covers the remaining 10 percent. Ground surface slopes slightly westward to accommodate stormwater drainage to the Duwamish River/Waterway, which adjoins the Subject Property to the west. No areas of exposed soil are present on the Subject Property, with the exception of minor landscaping near E. Marginal Way.

2.3 Current use of the Subject Property

The Longview Fibre Seattle facility is a 130,000-square-foot plant that produces corrugated boxes and displays. An office area in the northwestern corner of the building is mainly used for sales, managerial, and clerical/administrative activities.

Rolled sheets of paper stock, including lining, corrugated stock, and backing, are delivered via truck to the Subject Property as raw materials from the main Longview Pulp and Paper Manufacturing plant in Longview, Washington, and from several other suppliers (such as Weyerhaeuser and Smurfit-Stone). Propane-powered forklifts pick up the rolls and store them in the warehouse area in the southern portion of the building. Propane for the forklifts is stored in a 1,000-gallon tank on the north side of the building.

The rolls are fed through the corrugators located in the center of the building that combine the separate rolls of stock to produce corrugated board. The stock is combined using a mixture of starch, water, caustic soda, borax, and a water resistant resin that are mixed in the "Starch Kitchen," on the southwest side of the building. The Starch Kitchen utilizes a 4,200-gallon caustic aboveground storage tank (AST), an approximately 300-gallon AST for starch mixing and blending, an approximately 65-gallon tote containing borax, three approximately 300-gallon ASTs containing mixed starch for delivery to the corrugators, a water tank, a starch powder silo (located outside), and piping to treat, combine, prepare, and store the starch mixture.

Starch is delivered in powder form to the Subject Property and stored in a 25,000-gallon AST outside the production area. The blended starch mixture is pumped via overhead piping to the corrugators, where it is used as an adhesive in combining the sheets. After combining, the sheets are sent through a heat press to cure the starch. The cured sheets, called "blanks," are then sent through the cutting portion of the corrugators, which cuts the blanks to the desired size. The blanks then are sent to the corrugated board storage area. Movement of products throughout the facility is mostly accomplished using electric powered floor trucks set on rails.

The finished goods and processing area are used to print, die cut, fold, and glue the boxes to customer specifications. The facility employs six flexographic ink printers for box printing. Some inks are used directly as supplied; however, the majority of colors must be mixed to customer specification in the "Ink Kitchen." Near

the Ink Kitchen is a bucket washer that is utilized to wash buckets for reuse in mixing inks. Wash water from the bucket washer is directed to an onsite wastewater treatment system. The inks and some glues are applied to the boxes via a printing plate press. The printing plates used for the individual boxes are produced by Longview's customers. After the boxes are printed they are die cut and sent to the finisher for packaging and delivery.

Water, provided by the City of Seattle, is piped throughout the facility for use in various production processes. Specifically, the water is used for starch mixing, steam production, and printing press cleaning. Sanitary wastewater generated throughout the building is discharged directly to the City of Seattle sanitary sewer main.

Trimming from the die cutting and corrugated sheet cutting process are collected in a vacuum system and sent to a bailer. The trimmings are shipped via rail for recycling at the Longview Fibre paper plant in Longview, Washington.

The Subject Property and surrounding area are shown in Figure 2. Photographs of the site are presented in Appendix A.

2.4 Description of Structures

The Longview Fibre Seattle facility was constructed in 1955 with an expansion in 1980. The single story structure covers an area of 138,000 square feet. The structure is metal-framed with concrete reinforcements, concrete flooring, and metal siding. A second floor at the west end of the building provides meeting areas and administrative offices.

Parking is on asphalt pavement along the west and north sides of the structure. The shipping area occupies the northern portion of the structure, and finished product is stored in the west portion of the structure.

The office area is air conditioned by roof-top units. The remainder of the facility is not air conditioned or heated. Hot water is provided by the facility's boiler, which is fueled by natural gas.

The building is supplied with electricity from Seattle City Light, which owns and maintains a pad-mounted electrical transformer located immediately west of the building. The City of Seattle supplies potable water and sanitary sewer service. The building has been connected to the municipal sanitary sewer system and potable water supply since its initial construction, according to the site environmental coordinator. There was no evidence of historical septic systems or potable/process water supply wells on-site.

Stormwater drainage is conveyed to a storm water collection system on the west end of the Subject Property and outfalls to the Duwamish Waterway.

2.5 Utilities

As indicated above, the subject facility is serviced by Seattle municipal water and sanitary sewer service. All of the water distributed by the City is obtained from the 90,000-acre Cedar River Watershed and the 13,300-acre South Fork Tolt River Watershed in eastern King County. Wastewater from the facility is discharged to the municipal sewer system, which is managed by the City of Seattle. The building was connected to the sewer during building construction in 1955. According to Mr. Anderson, the facility has never had or used onsite water wells or septic systems.

As previously indicated, the office area is heated and cooled by roof-mounted HVAC units that utilize natural gas for heating and electricity for cooling. Hot water is provided by a natural gas fueled boiler. Natural gas is supplied by Puget Sound Energy Corporation.

No stains or other evidence of leaks from the equipment in the boiler room were noted, and the concrete floor was in good condition.

2.6 Current Use of Adjoining Properties

The following table identifies the properties located adjacent to the boundaries of the Subject Property (Figure 2).

Portion of property	Adjacent land use description
North	Adjacent property to the north is the St. Gobain Containers factory.
East	To the east is E Marginal Way S, beyond which are a Chevron retail service station and a Jack in the Box restaurant.
South	To the south is a BPB Gypsum factory.
West	To the west is the Duwamish Waterway.

3.0 User Provided Information

The purpose of this section is to describe tasks performed by the user of this report (Longview Fibre) that will help identify the presence of RECs that may be associated with the Subject Property. ENSR interviewed the site contacts to request the following specific information, discussed below.

3.1 Title Records/Environmental Liens/Specialized Knowledge/Value Reduction Issues

Longview Fibre did not inform ENSR of the existence of any environmental liens filed or recorded against the Subject Property. No specialized knowledge or experience related to the Subject Property or nearby properties was indicated or provided. ENSR requested an environmental lien search through a review of property title records. The lien report, provided in Appendix B, indicates that no such liens were identified.

Longview Fibre provided a document from Chicago Title Insurance Company dated October 24, 2005, for a standard loan policy. Schedule A of the document provides a legal description of the Subject Property. Schedule B of the document includes special conditions or exceptions. The earliest special condition (number 1) is for ingress and egress easements for roadways and spur tracks to the property dated September 14, 1951. A sewer construction easement was recorded in September 21, 1954.

3.2 Reason for Performing the Phase I ESA

ENSR was authorized by Longview Fibre to perform this Phase I ESA to assess the potential environmental issues associated with the Subject Property. ENSR has not been made aware of any specific business transaction associated with the Subject Property.

4.0 Records Information

4.1 Standard Environmental Records Sources

Standard environmental record sources are defined in Section 8.2.1 of ASTM E1527-05. These records consist of select federal and state environmental databases. ASTM also specifies the appropriate search distances from the subject site for which these records should be reviewed. ENSR retained the services of Environmental Data Resources, Inc. (EDR), of Milford, Connecticut, to provide specified state and federal regulatory database information for potential sites of environmental concern located at, or in the vicinity of, the Subject Property.

EDR maintains a computerized Geographic Information System (GIS) listing of various state and federal databases in accordance with ASTM E 1527-05. The database search was based upon ASTM-specified standard record sources. Additionally, databases searched by EDR satisfy records review requirements of the *all appropriate inquiry* rule. EDR includes these databases, when available, as a part of its report. The EDR report is presented in Appendix B.

The EDR report includes database information for each facility identified within the specified radius. Additional sites where recognized environmental risks are identified by EDR, but were not identified by specific location due to insufficient or contradicting address information. These sites were included in EDR's report as "orphan" sites. Based upon ENSR's review, none of the orphan sites appear to be associated with the Subject Property or adjacent properties. The specific databases and ASTM-specified search distances reviewed are identified in the EDR report (Appendix B).

Physical setting, including the reported and estimated direction of groundwater flow, is described in Section 4.3. For the purposes of this ESA, the groundwater direction has been estimated to flow westward toward the Duwamish River/Waterway, based on site characterization information described in Section 4.4.

The Subject Property address was listed in the following databases: RCRA-SQG (RCRA Small Quantity Generator); CSCSL (confirmed and suspected contaminated sites list); FINDS (Facility Index System); WA Manifest (hazardous waste manifest information); ICR (Independent Cleanup Reports); FTTS (the FIFRA/TSCA Tracking System [Federal Insecticide, Fungicide, and Rodenticide Act/Toxic Substances Control Act]); ERNS (Emergency Response Notification System); and LUST (Leaking Underground Storage Tank). The RCRA database indicates that the facility is a small quantity generator (EPA ID WAD009282161). No violations were recorded in the RCRAInfo database. The WA Manifest database confirms the waste management status of the site. The FTTS database indicates that an inspection was conducted in December 1988 and that no violations were recorded. The FINDS database cross-references the information found in the above-referenced databases.

The Subject Property is identified in the CSCSL database, which indicates that there was confirmed contamination of air, soil, groundwater, and/or surface water exceeding Model Toxics Control Act (MTCA) cleanup levels for petroleum products, organic compounds, and polynuclear aromatic hydrocarbons. No additional information is provided in the CSCSL database. Based on the CSCSL data entry date of March 1, 1988, ENSR believes this record is associated with the on-site LUST incident, described in Section 4.5 below, which was reported to the Washington Department of Ecology (WDOE) only three months earlier on January 1, 1988.

The ICR database indicates that in February 1996 an interim cleanup report (related to the LUST incident) was received by WDOE. No additional information is provided in the ICR database. Based on the date referenced in this database and the type of contaminant (petroleum products in soil and groundwater), it is likely that the

ICR listing relates to the on-site LUST case – see LUST database summary below and Section 4.5 for additional information on LUSTs.

The ERNS database reports that a spill of 7,100 gallons hydraulic fluid occurred on the Subject Property in 1990 resulting in releases to the storm sewer and to the Duwamish Waterway. No additional information is provided in the ERNS database with respect to the spill or associated response actions. Mr. Anderson, the Longview Fibre production supervisor, believes this spill report is in error. He conferred with several maintenance employees who worked at the facility in 1990. None recalled any hydraulic fluid spills. In addition, hydraulic fluid was never stored on site in such large quantities. Typically, no more than one or two 55-gallon drums were/are stored on site at any given time. The production equipment that use hydraulic fluid have relatively small reservoir capacities, usually a few gallons or less. Based on the information from Longview Fibre, ENSR believes this reported spill did not occur on the Subject Property.

The LUST database identifies a release from a UST in January 1988, with a last reporting date of March 2003. Additional information on the LUST case is provided in Section 4.5.

The following adjacent properties are identified in the EDR report:

- The Lower Duwamish Waterway (adjacent to the Subject Property to the west) is a NPL site for contaminated sediments. Contaminants of concern include organics, metals, and PCBs in sediment and surface water. Based on ENSR's prior experience, the regulatory agencies are currently identifying potentially responsible parties (PRPs) associated with this NPL site. ENSR considers this a REC with regard to the Subject Property, because neighboring properties have been notified of their PRP status.
- BPB Gypsum (5931 E Marginal Way S) is adjacent to the Subject Property to the south. The site is listed on the RCRAInfo database with multiple RCRA violations related to waste generator requirements. The former owner of this adjacent property, James Hardie Gypsum, appears on the LUST database, with a release notification date of January 1991. The site was reported cleanup up in January 2001. A spill of lube oil to surface water is recorded in June 2002. Chlorinated solvents, petroleum compounds, and carbon disulfide were reported in soils in September 2005. ENSR considers this a REC with regard to the Subject Property, based on the close proximity of affected soils to the Subject Property boundary. This site is discussed further in Section 4.2.
- The Chevron 90636 retail service station (5940 E Marginal Way S) is adjacent to the property to the east. The site is listed on the LUST database with a release notification date of November 1993. The LUST database indicates that an interim cleanup report was received by the WDOE in August 1995. Three underground storage tanks (USTs) remain operational at the site. ENSR considers this a REC with regard to the Subject Property since the Chevron site is hydraulically upgradient of the Subject Property, and given that the State has not closed the case.
- Saint Gobain Containers LLC (5801 E Marginal Way S) is adjacent to the Subject Property to the north. The site is listed on the RCRAInfo, FINDS, TRIS, WA Manifest, and EMI (Washington Emissions Data System) databases. The RCRAInfo database reports multiple violations related to generator requirements. No violations are noted in the other databases. Based on the nature of these listings, there is no indication of a spill or release of hazardous materials at this site; therefore, it is not a concern with respect to the Subject Property.

The environmental database identified the following other sites located within 1,000 feet of the Subject Property:

- Glacier Northwest (5975 E Marginal Way S) is located approximately 1000 feet south of the Subject Property. The site is listed in the RCRAInfo, FINDS, LUST, UST, NPDES and WA Manifest

databases. Information in the LUST database indicates that soil and surface water are contaminated by petroleum compounds and cleanup has started. Because this site is distant and hydraulically cross gradient from the Subject Property, this site is not considered a concern relative to the Subject Property.

- Northwest EnviroService 2W (1st Avenue SW and E. Marginal Way South) is located approximately 500 feet south-southeast of the Subject Property. The site is listed in the CSCSL database as having suspected contamination (i.e., solvents, halogenated organic compounds, and priority pollutants) and confirmed contaminated sediments. The contaminant plume reportedly has reached E. Marginal Way and may extend to the Duwamish Waterway. ENSR considers this site a potential environmental concern with regard to the Subject Property, based on the close proximity of the groundwater plume to the Subject Property. This site is discussed further in Section 4.2.

It is ENSR's opinion that the remaining listed sites within the search radius, which are not discussed above, are not likely to impact the Subject Property, based upon the groundwater gradient, the regulatory status of the sites, and/or their distance from the Subject Property.

4.2 Additional Environmental Records Sources

Per Section 8.2.2 of the ASTM standard, local, and/or additional state or tribal environmental records sources shall be reviewed to enhance and supplement the ASTM-required federal and state records reviewed and discussed in Section 4.1 of this report.

It is important to note that many of the available additional state and local databases are included in the EDR report along with the standard records sources. Any information from these sources is discussed in Section 4.1.

A table documenting the additional environmental records sources reviewed is provided below. Additional references are provided in Section 9.0.

Record source	Type of records	Comments
Interviews – City of Seattle Building Department	Building Records	ENSR reviewed building permits and plans on file with the City of Seattle.
City of Seattle Tax Assessors Records (on-line)	Parcel and ownership records	ENSR reviewed on-line records at the Assessor's website. Records for the Subject Property address show first development as the Longview Fibre building.
City of Seattle Fire Dept	Interview: Desk Clerk	The Fire Department representative had no information for the Subject Property.
WDOE Files	Site Files for BPB Gypsum Site	<p>A November 2004 report to WDOE, by Weston, reports soil and groundwater investigations for metals. Related correspondence between the WDOE Site Manager and another WDOE Manager indicated that metals did not appear to be a problem at the site and a "No Further Action" status was expected soon.</p> <p>A September 2005 memorandum to WDOE by Geomatrix reports soil contamination on</p>

Record source	Type of records	Comments
		the BPB site approximately 30 feet from the southwest corner of the Subject Property. Chlorinated solvents, petroleum compounds and carbon disulfide were detected at concentrations exceeding MTCA cleanup levels. The memorandum conjectures that the source is "chalky, fibrous material that resembled gypsum from 1.5 to 6 feet below ground surface." Because of the proximity to the Subject Property, and the historical joint use of the Subject Property and BPB Gypsum site, ENSR considers this a REC for the Subject Property.
WDOE Files	Site Files for the Subject Property	WDOE files confirm that the ICR database listing is for the LUST investigation and cleanup at the Subject Property.
WDOE Files	Site files for Northwest Enviroservice	WDOE files for Northwest Enviroservice document widespread contamination of groundwater by chlorinated solvents. The objective of current investigations is to determine if the groundwater plume is entering the Duwamish Waterway. The plume has been confirmed as far west as E Marginal Way. Given that it presents a threat of release to the subject property, this site is identified as a REC with respect to the Subject Property.
WDOE Files	Site files for Glacier Northwest	Regulatory files document WDOE's attempt to obtain site information for their investigation of Northwest Enviroservice, but do not include information on the LUST case at the site.
WDOE Files	Site files for Chevron Service Station No. 90636	A UST release at this site was reported in November 1993. WDOE files contained only groundwater monitoring reports, which document sampling of four groundwater monitoring wells. Currently, groundwater monitoring is conducted annually. Two of the four on-site wells show relatively low concentrations of fuel constituents. Typical groundwater flow direction is south to southeast. Occasional flow to the southwest also was noted. Southwest flow would potentially transport contaminants toward the BPB Gypsum and/or the Glacier Northwest facilities, but not the Subject Property.
US EPA ECHO database (on-	Compliance history of Subject	On August 31, 2006, ENSR searched the

Record source	Type of records	Comments
line)	Facility with respect to US EPA.	ECHO database listing for the Subject Facility, which includes information relative to various U.S. EPA regulatory programs (e.g., RCRA hazardous waste management regulations). The facility was not identified on the database.

According to information provided by EDR, the Subject Property is not located on or within 1 mile of tribal lands. As a result, tribal records were not researched as a part of this assessment.

4.3 Physical Setting Information

The Subject Property is located in an industrial area of South Seattle, adjacent to the Duwamish Waterway. Based on a review of the U.S. Geological Survey (USGS) topographic map for the area (South Seattle, Washington, quadrangle), the Subject Property is located at an elevation approximately 10 feet above mean sea level. Grade at the Subject Property is flat. Storm water is directed toward catchment basins in the parking area west of the building, and from there to the storm water outfall on the Duwamish River (Figure 2).

According to a report on a subsurface investigation conducted at the Subject Property (see Section 4.5), approximately 7 to 15 feet of fill material were encountered beneath the site. The fill consisted of fine sand and silt with some pebbles. Native material (i.e., sand and silt) was detected beneath the fill material. Shallow groundwater is influenced by tidal action, and depth to groundwater varies from 4 to 12 feet below grade. The general gradient is west toward the Duwamish Waterway; however, flow direction is complex due to the influence of tidal action and the heterogeneity of the subsurface sediments.

4.4 Historical Use Information on the Subject Property and Adjacent Sites

Information pertaining to historical uses of the Subject Property was obtained from various publicly available and readily reviewable sources including: (1) interviews with the current owner and Subject Property representatives; (2) interviews with Seattle Fire Department staff; (3) aerial photographs; (4) city directories; (5) tax assessment records; (6) building code department records; and, (7) old maps. Additionally, ENSR retained the services of EDR to provide copies of available city directories, Sanborn fire insurance maps, and aerial photographs for the Subject Property area. Selected historical information is presented in Appendix C.

According to tax assessor records, the buildings occupied by Longview Fibre were built in 1955. Building plans, site plans, and other related pre-construction documents and surveys were reviewed at the Subject Property, all of which concur with the above construction date of the facility. Tax assessor records show that a warehouse expansion occurred in 1980, which is consistent with site plans kept on file at the facility.

The City Directory search showed Longview Fibre Company at the Subject Property address in the 1960 R.L. Polk Company directory; no listing was present in directories for previous years. City directory information for E. Marginal Way listings near the Subject Property are as follows:

- The first addresses listed for E Marginal Way appeared in the 1925 R.L. Polk directory. The directory indicated that Greendale Novelty Manufacturing Company and the Paragon Soap Company were located at 5971 E Marginal Way (south of the Subject Property).
- In the 1930 directory, the Mart Products Corporation is listed at 5979 E Marginal Way (south of the Subject Property) as fertilizer manufacturers, and Smith Grace (Wood Hydraulic Hoist and Body Co.) is listed at 5915 E Marginal Way (adjacent to the Subject Property to the south).

- The 1935 directory shows Northwestern Glass Co at 5801 E Marginal Way, which is adjacent to the Subject Property, to the north. A fish oil and meal company is listed at 5919 E Marginal Way. A Standard (gas and oil) Station is listed at 5942 (south of the Subject Property).
- The 1940 directory lists the following:
 - Northwestern Glass adjacent to the Subject Property, to the north;
 - Siler Box Co at 5911 E Marginal Way, which may be on or adjacent to the Subject Property to the south;
 - 5935 E Marginal Way is listed as vacant; and
 - 5942 E Marginal Way is Standard Stations Inc (gas). This address is south of the Subject Property across E. Marginal Way.
- The 1944 directory lists the following:
 - 5801 E Marginal Way is Northwestern Glass adjacent to the Subject Property to the north;
 - 5911 E Marginal Way is Siler Box Co, which may be on or adjacent to the Subject Property to the south;
 - 5939 E Marginal Way is Modern Excavation Co adjacent or very near to the Subject Property to the north; and
 - 5940 E Marginal Way is Standard Stations Inc (gas), which is adjacent to the Subject Property to the east.
- The 1951 directory lists the following:
 - 5801 E Marginal Way is Northwestern Glass adjacent to the Subject Property to the north; and
 - 5940 E Marginal Way is Standard Stations Inc (gas), which is adjacent to the Subject Property to the east.
- The 1960 directory lists the following:
 - 5801 E Marginal Way is Northwestern Glass adjacent to the Subject Property to the north;
 - 5901 E Marginal Way is Longview Fibre Co, which is the Subject Property;
 - 5931 E Marginal Way is Kaiser Gypsum Co, which is adjacent to the Subject Property to the south; and
 - 5940 E Marginal Way is Standard Stations Inc (gas), which is adjacent to the Subject Property to the east.

Directory listings for 1966, 1970, 1980, 1986, 1990, and 2005 are substantially the same with associated name changes to the adjacent factory properties. The 5801 E Marginal Way address listings no longer list Northwestern Glass after the 1980 directory. Subsequent listings at that address include Incon Packaging

Manufacturers (1986 and 1990) and Saint Gobain Containers (2005). The 5931 E. Marginal Way address listings identify Norwest Gypsum Co (1986), Hardie James Gypsum (1990), and BPB Gypsum (2005).

Sanborn maps for the years 1929, 1949, and 1967 were reviewed. The 1929 map shows E. Marginal Way and Fidalgo Street in their current positions as well as a railroad spur onto the north portion of the Subject Property. The Subject Property appears as the northern portion of a larger parcel that includes the northern part of the current BPB Gypsum property (south adjacent site). Several structures are present on the Subject Property: (1) two structures are labeled "Bort Building (no use is identified), (2) one structure is labeled "Asbestos Block Mfg," and (3) a rug manufacturing facility is located on the east edge of the Subject Property along E. Marginal Way. There also are several additional smaller buildings labeled either "vacant" or "storage." Another building, located on E. Marginal Way (on the south adjacent property), south of the rug manufacturing facility, is identified as "Sodium Sulphite Dehydrating." The 1949 Sanborn map shows only one of the primary structures (the larger of the "Bort" buildings) remaining on the Subject Property and the structure is labeled "Paper Carton," suggesting a cardboard box manufacturing use. The 1967 Sanborn map shows the Subject Property as it generally appears today.

Aerial photographs of the Subject Property and vicinity were reviewed for the years 1956, 1965, 1977, 1985, and 1990. The Subject Property appears in all of the aerial photographs in its current form as do adjacent properties. No evidence of potential on-site environmental issues was identified through a review of the aforementioned historical information sources. According to Mr. Anderson, the Longview Fibre production supervisor, there are no Longview Fibre personnel currently working at the subject facility who were in a position to be knowledgeable of historical facility operations prior to about 1990. Therefore, the potential historical use and disposal of hazardous materials could not be evaluated by ENSR.

Based upon the historical information, it appears most likely that the Subject Property was historically part of a larger parcel that included roughly the northern half of the current BPB Gypsum property, which is currently the south adjacent site. The Subject Property also appeared to be used to manufacture paper cartons (possibly as the Siler Box Company) and potentially a fish processing company. The potential use of asbestos in the manufacture of asbestos blocks (identified on the 1929 Sanborn map) is considered a REC for the Subject Property.

4.5 Previous Environmental Reports

Longview Fibre provided the following documents for review:

- Report on removal of USTs (December 1987);
- Report on subsurface investigation of contamination related to former USTs (February 1988);
- Letter to Longview Fibre from WDOE Toxics Cleanup Program (March 2003); and
- September 8, 2005, analytical results of samples from groundwater monitoring wells.

The reports on the UST removals and associated subsurface investigation document a release of petroleum hydrocarbons to soil and groundwater at the site. Based on a review of the reports, three USTs were removed from the Subject Property in 1987 (Figure 2). Contamination was documented at each of the UST sites. In the early 1990s, remediation of petroleum and contaminated groundwater associated with the USTs was undertaken. Petroleum was bailed from numerous wells on a quarterly basis for approximately six years; however, residual petroleum in soil and dissolved petroleum constituents in groundwater remain.

The March 2003 letter to Longview Fibre (presented in Appendix C) formally changes the status of the site from "cleanup started" to "monitoring" status and states that "Ecology recommends that Longview Fibre Company continue to monitor the groundwater at this site annually . . ." The most recent groundwater

sampling results, for samples collected in September 2005, indicate 250 milligrams per liter (mg/L) diesel-range organics and 34 mg/L heavy-oil-range organics in the monitoring well located west of the building. The MTCA Method A groundwater cleanup level for diesel- and heavy-oil-range organics is 0.5 mg/L. Concentrations of petroleum constituents in the groundwater sample collected from the monitoring well north of the building also exceed cleanup levels. ENSR considers this a REC with regard to the Subject Property. The former UST locations are shown on Figure 2 along with the remaining groundwater monitoring wells.

5.0 Site Reconnaissance

5.1 Methodology

ENSR representative Don Clabaugh, PE, conducted a site reconnaissance of the Subject Property on September 21, 2006. ENSR's objectives were to visually inspect the area for potential evidence of site contamination and the presence of hazardous or regulated substances.

5.2 Water

5.2.1 Potable Water

As indicated above, the subject facility is serviced by municipal water service. No water supply wells were identified on site.

5.2.2 Wastewater

Wastewater from the facility is discharged to the municipal sanitary sewer system, which is managed by the City of Seattle. Primary wastewater discharges from the facility include sanitary effluent and, rarely, treated wastewater from the manufacturing process. The Beckart treatment system is used to treat and recycle operations wastewater. This involves precipitating, agglomerating, and filtering particulate waste to form a sludge. The sludge is dried, and then sent off site for disposal as solid waste. Following removal of particulates, the wastewater is checked for clarity and pH, then returned to the system for reuse. Three water storage tanks are used: a 7,000-gallon dirty water tank, a 5,000-gallon treatment tank, and a 7,000-gallon clean treated water tank. The treated water is sampled and analyzed quarterly (primarily for metals). Treated water, on rare occasion, is discharged to the sanitary system per King County discharge permit 631-02. Water discharge usually is necessary only to drain excess water from the system.

5.2.3 Stormwater

A stormwater pollution prevention plan (SWPPP) was prepared for the Subject Property. The most recent update of the SWPPP was dated December 2005. Stormwater is discharged to an outfall on the Duwamish Waterway under a State of Washington Permit S03-000206 issued in December 1992. The most recent inspection, in May 2006, recommended that the Subject Property request an exception from further sampling.

5.3 Hazardous Materials Use/Storage

Longview Fibre handles the following materials at the Subject Property:

- Liquid caustic soda (sodium hydroxide) stored as a 50 percent sodium hydroxide solution in water and stored in a 4,200-gallon polyethylene tank with a concrete secondary containment dike in the southeast corner of the building.
- Corn flour starch is stored in a steel silo on a concrete pad near the southeast corner of the building.
- Starch glue is distributed in a piping system from the Starch Kitchen to several locations along the corrugator line. Any releases would enter floor sumps or drains connected to the facility floor drain network, which is connected to the on-site wastewater treatment system.
- Printing ink is stored in sealed five-gallon containers in the ink storage room.

- Miscellaneous hydraulic and lubricating oils are stored in drums at various locations within the facility. Spills would either be contained within secondary containment, or would enter the facility floor drain network, which is connected to the wastewater treatment system.
- Hydrochloric acid is stored in two-gallon pails near the water treatment system.
- Diesel fuel is stored in a 5,000-gallon AST near the northwest corner of the building.
- Ketone aldehyde is stored in three-gallon pails in the ink kitchen.
- Sodium baborate pentahydrate powder is stored in totes of approximately one cubic yard capacity in the starch kitchen.
- Propylene glycol is stored in a 55-gallon drum in the oil and lubricants storage area.
- Propane is stored in a 1,000-gallon AST on the north side of the building.

No stains or other evidence of spills of hazardous materials were observed during the site visit.

5.3.1 Container Storage Areas

Hazardous materials in bulk quantities are stored in the following areas: (1) the treatment plant; (2) the drum storage area; (3) the used oil storage area; and (3) the ink storage area. No evidence of hazardous materials spills outside of bermed (contained) areas was noted during the site visit.

Containers of hazardous materials are stored throughout the facility, in close proximity to their points of use. Given the small volumes involved, if a spill were to occur, it is highly unlikely that it would reach the outside environment. Furthermore, the building would serve as secondary containment. As indicated above, no conditions of leakage or staining were noted in the hazardous material storage areas.

5.3.2 Above Ground Storage Tanks

Three ASTs are present at the Subject Property: (1) a 5,000-gallon diesel fuel AST, (2) a 1,000-gallon propane AST, and (3) a 4,200-gallon caustic AST. The diesel and caustic tanks reside within concrete secondary containment structures.

5.3.3 Underground Storage Tanks

ENSR did not observe any evidence (e.g., fill ports or vent pipes) of active USTs. Three groundwater monitoring wells are present at the Subject Property and are sampled annually in relation to UST releases that occurred previously onsite (see Section 4.5 and Figure 2).

5.4 Hazardous/Solid Waste

Several waste streams are generated by Longview Fibre at the Subject Property. Current waste stream profiles were developed by disposal company Waste Management Inc. Waste Management issued to Longview Fibre a permit to dispose of non-hazardous waste, according to Profile No. 489668. The permit expires in July 2007. The waste streams consist of the following materials:

- Beckart water treatment cake;
- Corrugator starch sludge; and,

- Flexo ink sludge.

The water treatment cake is generated about twice weekly. The corrugator starch sludge and Flexo ink sludge are removed from facility sumps about every six months and combined with the water treatment cake. These materials are placed in dumpsters and hauled by truck to Columbia Ridge Landfill near Arlington, Oregon. In April 2005, the most recent disposal event, approximately 18 tons of sludge were disposed of.

5.5 Polychlorinated Biphenyls (PCBs)

For informational purposes, polychlorinated biphenyl (PCB)-containing dielectric fluids have been widely used as coolants and lubricants in transformers, capacitors, and other electric equipment due to their insulating and nonflammable properties. The use, manufacture, and disposal of PCBs are regulated by the Toxic Substances Control Act (TSCA), 40 CFR Part 761. The regulations are, in part, based upon the relative PCB concentration, i.e., <50 parts per million (ppm), >50 ppm to <500 ppm, and >500 ppm. The production of PCBs in the United States began in 1929 and ended in 1977.

During the site visit, ENSR observed a pad-mounted electrical transformer at the Subject Property. A label on the transformer stated that the oil had been tested and the result was less than one milligram per liter PCBs. No other potential PCB-containing equipment was observed at the Subject Property.

5.6 Surface Staining/Stressed Vegetation/Debris

No surface staining, debris of potential concern, or stressed vegetation were identified on the Subject Property or adjacent properties.

The adjacent properties are identified in Section 2.2 of this report. During the site reconnaissance activities, ENSR visually inspected exterior areas of the adjacent properties from the Subject Property and from publicly accessible areas (e.g., public roadways) to the extent practicable. No notable environmental concerns were observed during this inspection.

6.0 Interviews

6.1 Interview with Current Subject Property Owner

ENSR interviewed the following Longview Fibre staff:

- Mr. Mike Anderson, Production General Supervisor and Environmental and Maintenance Supervisor; and
- Mr. Danny Buckholz, a long-time maintenance worker.

Information obtained during the interview process has been incorporated, as appropriate, throughout this report.

6.2 Interview with Past Owners, Operators, and Occupants

Per ASTM guidance, past owners, operators, and occupants of the Subject Property, who are likely to have material information regarding the potential for contamination at the Subject Property, shall be interviewed to the extent that they can be identified and that the information likely to be obtained is not duplicative of information already obtained from other sources. According to the information obtained, the Subject Property has been occupied by Longview Fibre since 1955. Mr. Anderson has been at the facility for three years and, prior to a break in employment, had been at the facility during most of the 1990s. Mr. Buckholz has been at the facility since 1994. No employees with knowledge of historical operations or waste disposal practices prior to about 1990 were identified at the facility. Information obtained through interviews with Mr. Anderson and Mr. Buckholz is presented in pertinent areas of this report.

6.3 Interviews with Government Agencies

Interviews with personnel of the City of Seattle Fire Department and Department of Public Works were conducted in conjunction with the review of additional regulatory records. WDOE also was contacted in relation to certain nearby sites identified on various incident-related databases. Information obtained through these interviews is discussed in Section 4.2, as well as other parts of this report.

7.0 Findings and Opinions

ENSR performed a Phase I ESA of the Longview Fibre Seattle, Washington, facility, located at 5901 E. Marginal Way South (Subject Property) in conformance with ENSR's proposal, dated August 17, 2006, and the scope and limitations of ASTM Practice E 1527-05.

Per the ASTM standard, potential findings may identify recognized environmental conditions (RECs), including historical RECs (HRECs) and de minimus conditions. RECs are conditions that indicate the presence or likely presence of a release, or potential for a release, of hazardous substances or petroleum products into the structures at the Subject Property, or into the ground, groundwater, or surface water of the Subject Property. HRECs are generally conditions that in the past have been remediated to the satisfaction of the responsible regulatory agency. De minimus conditions are those situations that do not present a material risk of harm to public health or the environment and generally would not be subject to enforcement action if brought to the attention of a regulatory authority.

This assessment has revealed evidence of the following RECs:

- In 1987, three USTs were removed from the Subject Property. In the early 1990s, remediation of petroleum and contaminated groundwater associated with the USTs was undertaken. Petroleum was bailed from numerous wells on a quarterly basis for approximately six years; however, residual petroleum in soil and dissolved petroleum constituents in groundwater remain. The March 2003 letter to Longview Fibre formally changes the status of the site from "cleanup started" to "monitoring" status. The most recent groundwater sampling results, for samples collected in September 2005, indicate 250 milligrams per liter (mg/L) diesel-range organics and 34 mg/L heavy-oil-range organics in the monitoring well located west of the building. The MTCA Method A groundwater cleanup level for diesel- and heavy-oil-range organics is 0.5 mg/L. Concentrations of petroleum constituents in the groundwater sample collected from the monitoring well north of the building also exceed cleanup levels.
- On the 1929 Sanborn map, the Subject Property appears to be a part of a larger parcel that includes part of the current south adjacent property. On the 1929 Sanborn map, a structure on the south part of the Subject Property is labeled "Asbestos Block Mfg". Therefore, it appears that the Subject Property was occupied by a small asbestos product manufacturing facility. ENSR has identified this as a REC given the potential for asbestos-containing materials in the subsurface at the Subject Property.
- A September 2005 memorandum to WDOE by Geomatrix reports soil contamination on the BPB Gypsum property located approximately 30 feet from the southwest corner of the Subject Property. Chlorinated solvents, petroleum compounds, and carbon disulfide were detected at concentrations exceeding MTCA soil cleanup levels. The memorandum speculates that the source is a "chalky, fibrous material that resembled gypsum from 1.5 to 6 feet below ground surface". In light of the proximity of this source to the Subject Property, this is considered a REC.
- The Lower Duwamish Waterway (adjacent to the Subject Property to the west) is a NPL site for contaminated sediments. Contaminants of concern include organics, metals, and PCBs in sediment and surface water. Based on ENSR's prior experience, the regulatory agencies are currently identifying potentially responsible parties (PRPs) associated with this NPL site. ENSR considers this a REC with regard to the Subject Property, because neighboring properties have been notified of their PRP status.
- Northwest Enviroservice 2W (1st Avenue SW and E. Marginal Way South) is located approximately 500 feet south-southeast of the Subject Property. The site is listed in the CSCSL database as having

suspected contamination (i.e., solvents, halogenated organic compounds, and priority pollutants) and confirmed contaminated sediments. The contaminant plume reportedly has reached E. Marginal Way and may extend to the Duwamish Waterway. ENSR considers this site a potential environmental concern with regard to the Subject Property, based on the close proximity of the groundwater plume to the Subject Property.

No HRECs or de minimus conditions were identified in association with the Subject Property.

8.0 Conclusions

ENSR performed this Phase I Environmental Site Assessment in conformance with the scope of work and limitations of ASTM Practice E 1527 at the Longview Fibre Seattle facility. Any exception to, or deletions from, this practice are described in Section 1.3 and 1.4 of this report. ENSR's assessment revealed the following recognized environmental conditions (RECs) in connection with the Subject Property:

- Underground Storage Tank Contamination: In 1987, three USTs were removed from the Subject Property. Residual petroleum hydrocarbons in soil and dissolved petroleum constituents in groundwater remain in the subsurface. Concentrations of petroleum constituents in groundwater samples collected from on-site monitoring wells in 2005 exceed applicable regulatory cleanup levels. ENSR considers this a REC with regard to the Subject Property.
- Former Use of Subject Property: On the 1929 Sanborn map, the Subject Property appears to be a part of a larger parcel that was occupied by an asbestos product manufacturer. ENSR considers this a REC given the potential for residual asbestos-containing materials to be present in soils near the former manufacturing building (now beneath the Longview Fibre building).
- Adjacent Property Contamination: A September 2005 memorandum to WDOE by Geomatrix reports soil contamination on the BPB Gypsum property located approximately 30 feet from the southwest corner of the Subject Property. Chlorinated solvents, petroleum compounds, and carbon disulfide were detected at concentrations exceeding MTCA soil cleanup levels. In light of the proximity of this source to the Subject Property, this is considered a REC.
- Adjacent Waterway Contamination: The Lower Duwamish Waterway (adjacent to the Subject Property to the west) is a NPL site for contaminated sediments. Contaminants of concern include organics, metals, and PCBs in sediment and surface water. Based on ENSR's prior experience, the regulatory agencies are currently identifying potentially responsible parties (PRPs) associated with this NPL site. ENSR considers this a REC with regard to the Subject Property, because neighboring properties have been notified of their PRP status.
- Off-site Contamination: Northwest Enviroservice 2W, which is located approximately 500 feet south-southeast of the Subject Property, is listed in the CSCSL database as having suspected contamination and confirmed contaminated sediments. The contaminant plume reportedly has reached E. Marginal Way and may extend to the Duwamish Waterway. ENSR considers this site a potential environmental concern with regard to the Subject Property, based on the close proximity of the groundwater plume to the Subject Property.

No HRECs or de minimus conditions were identified in association with the Subject Property.

9.0 References and Contacts


Reference sources and contacts utilized during these ESA activities are identified in the following table:

Description/Title of document(s) received or agency contacted	Date of contact or review	Reference source
Tax Assessor Records and Maps	9/26/06	Tax Assessor, City of Seattle
1990 aerial photograph	9/26/06	Terraserver image courtesy of the USGS
2002 aerial photograph	9/26/06	Terraserver image courtesy of the USGS
1956, 1985, 1977, 1985, 1990 aerial photographs	9/27/06	EDR Aerial Photo Decade Package
1929, 1949, 1967 Sanborn maps	9/28/06	EDR Sanborn Map Report
1920 through 2005 city directory review	9/26/06	EDR City Directory Abstract
Chicago Title Insurance Company Order 1175199 dated October 24, 2005.	9/24/06	Provided by User
Spill Prevention, Countermeasures and Control (SPCC) Plan	9/13/06	Provided by User
Storm Water Pollution Prevention Plan (SWPPP)	9/13/06	Provided by User
Waste stream profiles (489668)	9/13/06	Provided by User
Wastewater discharge permit (through King County number 631-02)	9/13/06	Provided by User
Stormwater permit	9/13/06	Provided by User
Puget Sound Clean Air Agency Inspection (May 2006)	9/13/06	Provided by User
Report on removal of USTs (December 1987)	9/13/06	Provided by User
Report on subsurface investigation of contamination related to former USTs (February 1988)	9/13/06	Provided by User
Letter from Dave Mendenhall from WDOE Toxics Cleanup	9/13/06	Provided by User


Description/Title of document(s) received or agency contacted	Date of contact or review	Reference source
Program (March 2003)		
Building permits	9/20/06	City of Seattle Building Department
Fire Department response, compliance, UST records	9/20/06	City of Seattle Fire Department
File information for BPB Gypsum site	10/4/06	Washington Department of Ecology
File information for Subject Property	10/4/06	Washington Department of Ecology
File information for Northwest Enviroservice site	10/4/06	Washington Department of Ecology
File information for Glacier Northwest site	10/4/06	Washington Department of Ecology
File information for Chevron Service Station 90636 site	10/13/06	Washington Department of Ecology
Compliance history for Subject Property	8/31/06	USEPA ECHO online database

Figures

Marginal-1

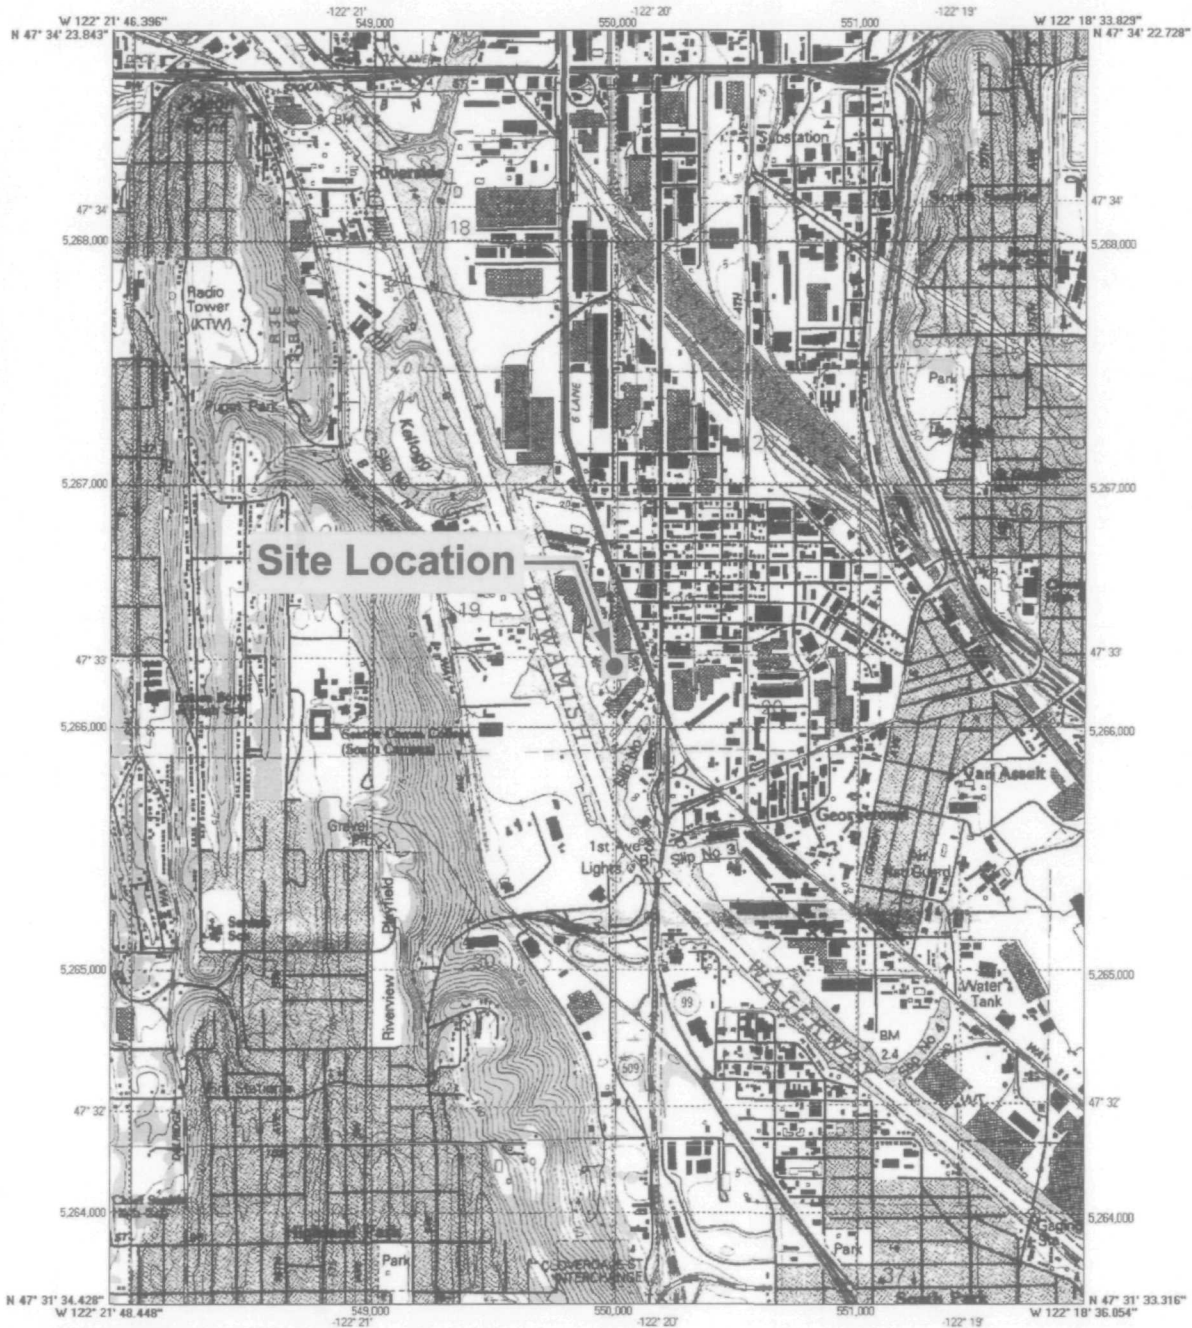

1927 North American Datum; 1,000-meter UTM grid zone 10
 Generated by BigTopo (www.bigtopo.com)
 Map compiled from USGS Quads: Seattle South, WA



BigTopo Map

ENSR | AECOM

SITE LOCATION MAP

FIGURE NUMBER:

1


ENSR CORPORATION
 9521 WILLOWS ROAD NE
 REDMOND, WASHINGTON 98052
 PHONE: (425) 881-7700
 FAX: (425) 883-4473
 WEB: [HTTP://WWW.ENSR.AECOM.COM](http://www.ensr.aecom.com)

Longview Fiber Company
 5901 East Marginal Way
 Seattle, Washington 98134

DRAWN BY:	DATE:	PROJECT NUMBER:	CHECKED BY:
KM	10/06/06	04320-006-0001	DL

FILENAME: 043200060001A

LFC000029

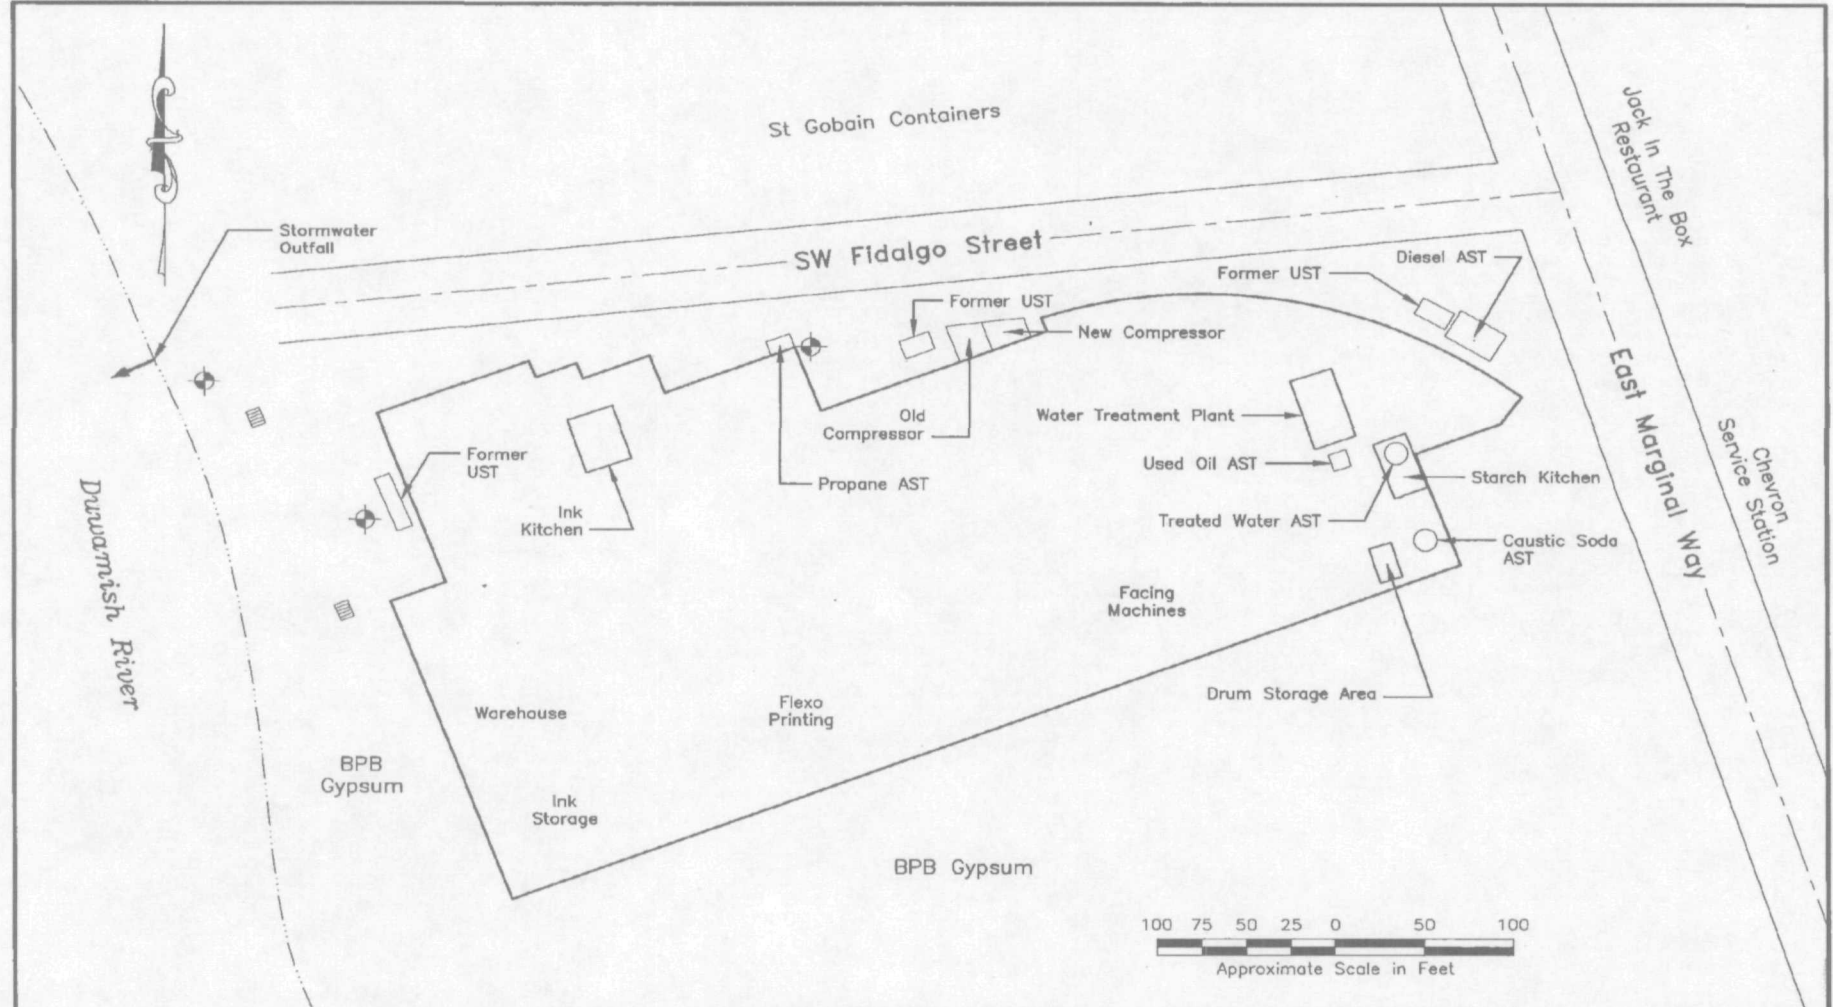

Legend

- Catch Basin
- Monitoring Well
- AST Above Ground Storage Tank
- UST Underground Storage Tank

ENSR | AECOM

ENSR CORPORATION
9521 WILLOWS ROAD NE
REDMOND, WASHINGTON 98052
PHONE: (425) 881-7700
FAX: (425) 883-4473
WEB: [HTTP://WWW.ENSR.AECOM.COM](http://www.ensr.aecom.com)

SITE PLAN

Longview Fiber Company
5901 East Marginal Way
Seattle, Washington 98134

DRAWN BY:	DATE:	PROJECT NUMBER:	CHECKED BY:
KM	10/06/06	04320-006-0001	DL

FIGURE NUMBER:

2

Appendix A

Photograph Log

ENSR

PHOTOGRAPHIC LOG

Client Name: Longview Fibre Company

Site Location: Seattle, Washington

Project No.
04320-006-001

Photo No.
3

Date:
Sep-20

Direction Photo Taken:

n/a

Description:

View of the stormwater outfall on the Duwamish Waterway that conveys stormwater from the roof and the parking area west of the structure.



Photo No.
4

Date:
Sep-20

Direction Photo Taken:

n/a

Description:

View of pad mounted transformer on subject property.



ENSR

PHOTOGRAPHIC LOG

Client Name: Longview Fibre Company

Site Location: Seattle, Washington

Project No.
04320-006-001

Photo No.
5 **Date:**
Sep-20

Direction Photo Taken:

n/a

Description:

View of diesel AST on the subject property.

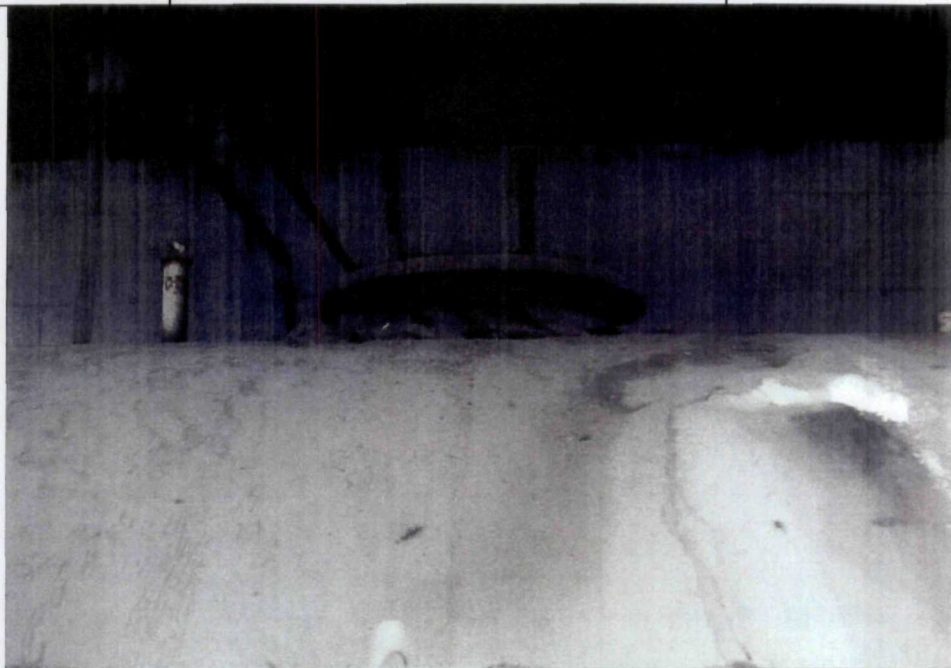


Photo No.
6 **Date:**
Sep-20

Direction Photo Taken:

Southwest

Description:

View of oil and lubricant storage area in southeast portion of building.



ENSR

PHOTOGRAPHIC LOG

Client Name: Longview Fibre Company

Site Location: Seattle, Washington

Project No.
04320-006-001

Photo No.
7

Date:
Sep-20

Direction Photo Taken:

South

Description:

View of parking area west of the facility.



Photo No.
8

Date:
Sept-31

Direction Photo Taken:

East

Description:

View of south side of structure (left side of photo) and alley.



ENSR

PHOTOGRAPHIC LOG

Client Name: Longview Fibre Company

Site Location: Seattle, Washington

Project No.
04320-006-001

Photo No.
9

Date:
Sep-20

Direction Photo Taken:

Southeast

Description:

View of parking area outside of office on the northwest corner of the structure.



Photo No.
10


Date:
Sept-20

Direction Photo Taken:

West

Description:

View of starch silo on northeast side of building.

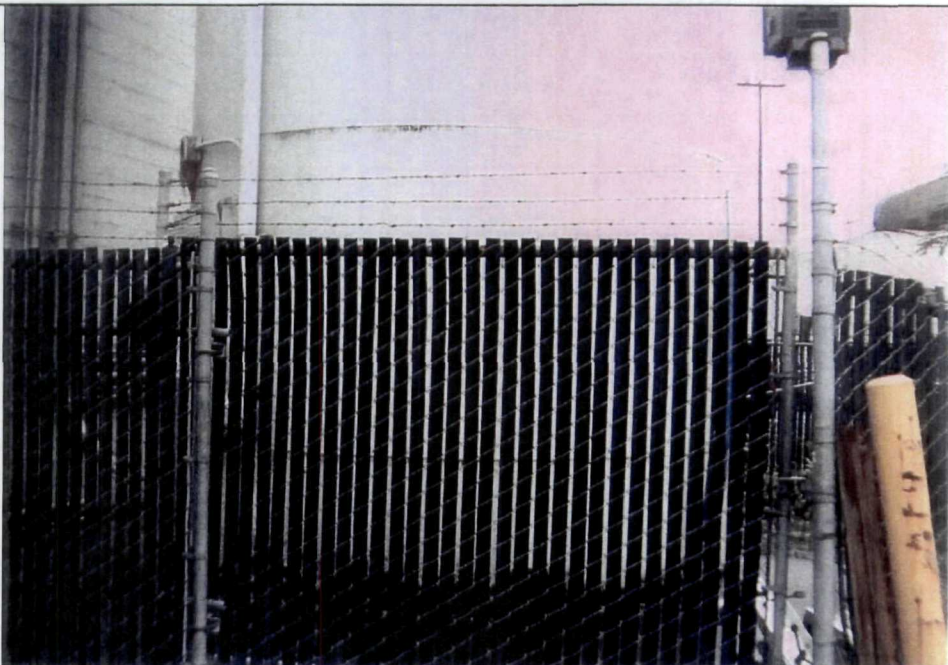


ENSR		PHOTOGRAPHIC LOG	
Client Name: Longview Fibre Company		Site Location: Seattle, Washington	
		Project No. 04320-006-001	
Photo No. 1	Date: Sep-20		
Direction Photo Taken: Northwest			
Description: View of the terminus of Fidalgo street, drying beds for the Saint Gobain facility and ships on the Duwamish Waterway.			

Photo No. 2	Date: Sep-20	
Direction Photo Taken: n/a		
Description: View of monitoring well MW-3.		

ENSR

PHOTOGRAPHIC LOG

Client Name: Longview Fibre Company

Site Location: Seattle, Washington

Project No.
04320-006-001

Photo No.
3

Date:
Sep-20

Direction Photo Taken:

n/a

Description:

View of the stormwater outfall on the Duwamish Waterway that conveys stormwater from the roof and the parking area west of the structure.



Photo No.
4

Date:
Sep-20

Direction Photo Taken:

n/a


Description:

View of pad mounted transformer on subject property.



Appendix B

EDR Radius Map Report and Environmental Lien Search Report

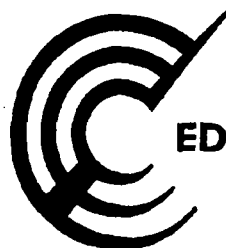

EDR® Environmental
Data Resources Inc

The EDR Radius Map™ Report

**Longview Fibre Seattle
5901 E MARGINAL WAY S
Seattle, WA 98108**

Inquiry Number: 01752816.3r

September 12, 2006

The Standard in Environmental Risk Management Information

**440 Wheelers Farms Road
Milford, Connecticut 06461**

Nationwide Customer Service

**Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com**

FORM-NUL-8RU

LFC000039

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary.....	ES1
Overview Map.....	2
Detail Map.....	3
Map Findings Summary.....	4
Map Findings.....	6
Orphan Summary.....	228
EPA Waste Codes.....	EPA-1
Government Records Searched/Data Currency Tracking.....	GR-1

GEOCHECK ADDENDUM

GeoCheck - Not Requested

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

5901 E MARGINAL WAY S
SEATTLE, WA 98108

COORDINATES

Latitude (North): 47.548700 - 47° 32' 55.3"
Longitude (West): 122.334500 - 122° 20' 4.2"
Universal Transverse Mercator: Zone 10
UTM X (Meters): 550076.2
UTM Y (Meters): 5266138.0
Elevation: 9 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 47122-E3 SEATTLE SOUTH, WA
Most Recent Revision: 1983

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following government records. For more information on this property see page 6 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
LONGVIEW FIBRE CO 5901 E MARGINAL WY S SEATTLE, WA 98134	RCRA-SQG CSCSL FINDS WA MANIFEST ICR	WAD009282161
LONGVIEW FIBRE CO SEATTLE 5901 E MARGINAL WAY S SEATTLE, WA 98134	FTTS	N/A
5901 EAST MARGINAL WAY 5901 EAST MARGINAL WAY SEATTLE, WA	ERNS	N/A
LONGVIEW FIBER CO. 5901 E. MARGINAL WAY S. SEATTLE, WA 98134	LUST ICR	N/A

EXECUTIVE SUMMARY

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

FEDERAL RECORDS

Delisted NPL.....	National Priority List Deletions
NPL RECOVERY.....	Federal Superfund Liens
RCRA-TSDF.....	Resource Conservation and Recovery Act Information
HMIRS.....	Hazardous Materials Information Reporting System
US INST CONTROL.....	Sites with Institutional Controls
DOD.....	Department of Defense Sites
FUDS.....	Formerly Used Defense Sites
CONSENT.....	Superfund (CERCLA) Consent Decrees
ROD.....	Records Of Decision
UMTRA.....	Uranium Mill Tailings Sites
ODI.....	Open Dump Inventory
TRIS.....	Toxic Chemical Release Inventory System
TSCA.....	Toxic Substances Control Act
SSTS.....	Section 7 Tracking Systems
ICIS.....	Integrated Compliance Information System
PADS.....	PCB Activity Database System
MLTS.....	Material Licensing Tracking System
MINES.....	Mines Master Index File
RAATS.....	RCRA Administrative Action Tracking System

STATE AND LOCAL RECORDS

SWF/LF.....	Solid Waste Facility Database
SWTIRE.....	Solid Waste Tire Facilities
AST.....	Aboveground Storage Tank Locations
SPILLS.....	Reported Spills
DRYCLEANERS.....	Drycleaner List
CDL.....	Clandestine Drug Lab Contaminated Site List
NPDES.....	Water Quality Permit System Data
EMI.....	Washington Emissions Data System
Inactive Drycleaners.....	Inactive Drycleaners

TRIBAL RECORDS

INDIAN RESERV.....	Indian Reservations
INDIAN LUST.....	Leaking Underground Storage Tanks on Indian Land
INDIAN UST.....	Underground Storage Tanks on Indian Land

EDR PROPRIETARY RECORDS

Manufactured Gas Plants... EDR Proprietary Manufactured Gas Plants

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

EXECUTIVE SUMMARY

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

FEDERAL RECORDS

NPL: Also known as Superfund, the National Priority List database is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund program. The source of this database is the U.S. EPA.

A review of the NPL list, as provided by EDR, and dated 07/05/2006 has revealed that there is 1 NPL site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>LOWER DUWAMISH WATERWAY</i>	<i>RK 2.5 TO RK 10.8</i>	<i>0 - 1/8</i>	<i>0</i>	<i>13</i>

Proposed NPL: Proposed NPL sites. The source of this database is the U.S. EPA.

A review of the Proposed NPL list, as provided by EDR, and dated 07/05/2006 has revealed that there is 1 Proposed NPL site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>LOWER DUWAMISH WATERWAY</i>	<i>RK 2.5 TO RK 10.8</i>	<i>0 - 1/8</i>	<i>0</i>	<i>13</i>

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 06/19/2006 has revealed that there is 1 CERCLIS site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>LOWER DUWAMISH WATERWAY</i>	<i>RK 2.5 TO RK 10.8</i>	<i>0 - 1/8</i>	<i>0</i>	<i>13</i>

EXECUTIVE SUMMARY

CERCLIS-NFRAP: Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

A review of the CERC-NFRAP list, as provided by EDR, and dated 07/17/2006 has revealed that there is 1 CERC-NFRAP site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
EMERALD TOOL INC	6332 6TH S	1/4 - 1/2ESE	59	112

CORRACTS: CORRACTS is a list of handlers with RCRA Corrective Action Activity. This report shows which nationally-defined corrective action core events have occurred for every handler that has had corrective action activity.

A review of the CORRACTS list, as provided by EDR, and dated 03/15/2006 has revealed that there are 3 CORRACTS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GENERAL ELECTRIC AVIATION DIV	220 S DAWSON ST	1/4 - 1/2NNE	67	125
BURLINGTON ENVIRONMENTAL INC G	734 S LUCILE ST	1/2 - 1 ENE	T75	160
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GREAT WESTERN CHEMICAL CO SEAT	6900 FOX AVE S	1/2 - 1 SSE	73	147

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/13/2006 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
CAPITAL INDUSTRIES INC	5801 3RD AVE S	1/8 - 1/4NE	35	76

EXECUTIVE SUMMARY

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/13/2006 has revealed that there are 15 RCRA-SQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
BPB GYPSUM	5931 E MARGINAL WY S	0 - 1/8 SSE	A5	21
BANK & OFFICE INTERIORS	5990 1ST AVE S	0 - 1/8 NNE	14	36
BECKWITH KUFFEL INC	5930 1ST AVE S	0 - 1/8 N	C16	43
OLYMPIC MEDICAL CORP 1ST AVE S	5900 1ST AVE S	0 - 1/8 N	18	44
MOBILE CRANE CO INC	5900 2ND AVE S	1/8 - 1/4 NE	D20	48
FRAY EQUIPMENT CO	5821 1ST AVE S	1/8 - 1/4 N	E22	53
SAINT GOBAIN CONTAINERS LLC	5801 EAST MARGINAL WAY	1/8 - 1/4 NNW	F25	56
AR TORRICO SONS SHIPPING IN	6335 1ST AVE S	1/8 - 1/4 S	H28	69
BURGESS ENTERPRISES	6361 1ST AVE S	1/8 - 1/4 S	H29	69
SAHLBERG EQUIPMENT	5950 4TH AVE S	1/8 - 1/4 ENE	J36	80
ALEUTIAN CONSTRUCTORS	5939 4TH AVE S	1/8 - 1/4 ENE	J38	84
CONTINENTAL INDUSTRIES	222 S ORCAS	1/8 - 1/4 NNE	39	85
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GLACIER NORTHWEST EAST MARGINA	5975 E MARGINAL WAY S	0 - 1/8 SSE	B8	25
CHEVRON 90636	5940 E MARGINAL WAY S	0 - 1/8 SSE	B10	29
CONSOLIDATED FREIGHTWAYS SEATT	6050 E MARGINAL WAY S	0 - 1/8 SSE	15	38

ENG CONTROLS: A listing of sites with engineering controls in place.

A review of the US ENG CONTROLS list, as provided by EDR, and dated 03/21/2006 has revealed that there is 1 US ENG CONTROLS site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GENERAL ELECTRIC AVIATION DIV	220 S DAWSON ST	1/4 - 1/2 NNE	67	125

US BROWNFIELDS: The EPA's listing of Brownfields properities addressed by Cooperative Agreement Recipients and Brownfields properties addressed by Targeted Brownfields Assessments

A review of the US BROWNFIELDS list, as provided by EDR, and dated 07/10/2006 has revealed that there are 2 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
SCENIC BOUND TOURS	300 SOUTH ORCAS STREET	1/4 - 1/2 NE	K41	88
ACE RADIATOR SHOP	311 SOUTH BRANDON	1/4 - 1/2 NNE	O52	102

EXECUTIVE SUMMARY

STATE AND LOCAL RECORDS

CSCSL: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Ecology's Confirmed & Suspected Contaminated Sites List.

A review of the CSCSL list, as provided by EDR, and dated 08/17/2006 has revealed that there are 30 CSCSL sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
FRANKS USED CARS	6305 E MARGINAL WAY S	1/8 - 1/4 SSE	G27	65
DUWAMISH MARINE CENTER	6365 1ST AVE S	1/8 - 1/4 S	H31	70
AIR TEC COMPANY	5701 1ST AVE SOUTH	1/8 - 1/4 N	I33	72
SAHLBERG EQUIPMENT	5950 4TH AVE S	1/8 - 1/4 ENE	J36	80
BLASER DIE CASTING CO	5700 3RD AVE S	1/4 - 1/2 NE	K40	86
BIG JOHNS TRUCK REPAIR INC	6533 3RD AVE S	1/4 - 1/2 SSE	45	94
EMERALD TOOL INC	6332 6TH S	1/4 - 1/2 ESE	59	112
GENERAL ELECTRIC AVIATION DIV	220 S DAWSON ST	1/4 - 1/2 NNE	67	125
M & T CHEMICALS INC	6000 W MARGINAL SW	1/2 - 1 W	70	134
GLACIER NORTHWEST SEATTLE TERM	5900 W MARGINAL WAY S	1/2 - 1 W	71	136
DUWAMISH SHIPYARD INC	5658 W MARGINAL WY SW	1/2 - 1 WNW	72	139
SCOUGAL RUBBER CORP	6239 CORSON AVE S	1/2 - 1 E	74	153
BURLINGTON ENVIRONMENTAL INC G	734 S LUCILE ST	1/2 - 1 ENE	T76	178
INDUSTRIAL CONTAINER SERVICES	7152 1ST AVE S	1/2 - 1 S	77	180
PIONEER ENAMEL MANUFACTURE	5531 AIRPORT WAY S	1/2 - 1 ENE	78	189
WASTE MANAGEMENT OF SEATTLE	7201 W MARGINAL WAY SW	1/2 - 1 SSW	79	193
UNOCAL SS 0907 ENSR INTNTL	1121 S BAILEY ST	1/2 - 1 E	80	198
MYRTLE STREET PROPERTY	606 S MYRTLE ST	1/2 - 1 SSE	81	199
KELLY MOORE PRESERVATIVE PAINT	6101 AIRPORT WAY SOUTH	1/2 - 1 E	82	201
BLOCH STEEL INDUSTRIES	4580 COLORADO AVE S	1/2 - 1 N	83	208
LAIDLAW	7739 1ST AVE S	1/2 - 1 SSW	84	211
US GENERAL SERVICES ADMIN SEAT	4735 E MARGINAL WAY S	1/2 - 1 NNW	85	214
ALASKA STREET PROPERTY	615 S ALASKA ST	1/2 - 1 NNE	86	216
BOEING NORTH FIELD JP4 TANKS	ELLIS AVE / E MARGINA	1/2 - 1 SE	U87	217
STERNOFF METALS	7201 E MARGINAL WY S	1/2 - 1 SE	U88	219
SAMIS LAND CO SITE	647 S ALASKA ST	1/2 - 1 NNE	V89	221
FEDEX EXPRESS - BFIA	651 S ALASKA ST	1/2 - 1 NNE	V90	223
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NORTHWEST ENVIROSERVICE 2W	1ST AV SW / MARGINAL	0 - 1/8 SSE	B13	34
CONSOLIDATED FREIGHTWAYS SEATT	6050 E MARGINAL WAY S	0 - 1/8 SSE	15	38
GREAT WESTERN CHEMICAL CO SEAT	6900 FOX AVE S	1/2 - 1 SSE	73	147

HSL: The Hazardous Sites List is a subset of the CSCSL Report. It includes sites which have been assessed and ranked using the Washington Ranking Method (WARM).

A review of the HSL list, as provided by EDR, and dated 02/22/2006 has revealed that there is 1 HSL site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
LAIDLAW	7739 1ST AVE S	1/2 - 1 SSW	84	211
Facility Type: Hazardous Sites List				

EXECUTIVE SUMMARY

CSCSL NFA: The data set contains information about sites previously on the Confirmed and Suspected Contaminated Sites list that have received a No Further Action (NFA) determination. Because it is necessary to maintain historical records of sites that have been investigated and cleaned up, sites are not deleted from the database when cleanup activities are completed. Instead a No Further Action code is entered based upon the type of NFA determination the site received.

A review of the CSCSL NFA list, as provided by EDR, and dated 08/17/2006 has revealed that there are 9 CSCSL NFA sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
BPB GYPSUM	5931 E MARGINAL WY S	0 - 1/8 SSE	A5	21
OTT REAL ESTATE PROPERTY	5903 1ST AV S	0 - 1/8 N	C17	44
MOBILE CRANE CO INC	5900 2ND AVE S	1/8 - 1/4 NE	D20	48
WESTERN PARCEL EXPRESS SEATTLE	525 S FRONT ST	1/4 - 1/2 E	L42	88
MASTER BUILDERS	64 S LUCILE ST	1/4 - 1/2 N	44	93
DRIVE LINE SERVICES OF SEATTLE	108 S BRANDON ST	1/4 - 1/2 N	46	96
EVERCLEAN INC DBA GAS N WASH	551 S MICHIGAN ST	1/4 - 1/2 ESE	N49	99
ACE RADIATOR	311 S BRANDON ST	1/4 - 1/2 NNE	O53	102
VIOX MCDOWELL SITE	551 S RIVER ST	1/4 - 1/2 SE	64	120

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Ecology's Leaking Underground Storage Tanks Site List.

A review of the LUST list, as provided by EDR, and dated 06/08/2006 has revealed that there are 15 LUST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
JAMES HARDIE GYPSUM	5931 E MARGINAL WAY SO	0 - 1/8 SSE	A6	24
INCON PACKAGING	5801 E MARGINAL WAY S	1/8 - 1/4 NNW	F24	54
AIR TEC COMPANY	5701 1ST AVE SOUTH	1/8 - 1/4 N	I33	72
AIR DATA EXPRESS, INC.	525 S FRONT ST	1/4 - 1/2 E	L43	92
WF CARMODY	220 S RIVER ST	1/4 - 1/2 SSE	M48	97
TEXACO STATION #63-232-0400	600 S MICHIGAN	1/4 - 1/2 ESE	P54	103
BOBS TEXACO SERVICE	5304 1ST AVE SO	1/4 - 1/2 N	Q56	109
NATIONAL TRANSFER INC	5265 UTAH AVE S	1/4 - 1/2 N	60	116
U S BANK OF WASHINGTON	1137 S W HANFORD ST	1/4 - 1/2 NE	62	117
PTL PARTNERSHIP/PENINSULA TRUC	6314 7TH S.	1/4 - 1/2 ESE	63	118
DAWSON STREET LAND COMPANY	54 S DAWSON	1/4 - 1/2 N	R66	122
PNB BUILDING	707 S ORCAS ST	1/4 - 1/2 ENE	S68	132
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GLACIER NORTHWEST, INC.	5975 E MARGINAL WAY S	0 - 1/8 SSE	B9	27
CHEVRON 90636	5940 E MARGINAL WAY	0 - 1/8 SSE	B11	32
CONSOLIDATED FREIGHTWAYS SEATT	6050 E MARGINAL WAY S	0 - 1/8 SSE	15	38

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Ecology's Statewide UST Site/Tank Report.

A review of the UST list, as provided by EDR, and dated 06/08/2006 has revealed that there are 10 UST

EXECUTIVE SUMMARY

sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
BECKWITH KUFFEL INC	5930 1ST AVE S	0 - 1/8 N	C16	43
WESTERN BRIDGE CO	5900 SECOND AVE SO	1/8 - 1/4 NE	D19	47
FRAY EQUIPMENT COMPANY INC	5821 1ST AVE SOUTH	1/8 - 1/4 N	E21	51
INCON PACKAGING	5801 E MARGINAL WAY S	1/8 - 1/4 NNW	F24	54
RAY BURGESS CO	6361 FIRST AVE S	1/8 - 1/4 S	H30	70
AIR TEC COMPANY	5701 1ST AVE SOUTH	1/8 - 1/4 N	I33	72
GEORGETOWN GASCO	6185 4TH AVE S	1/8 - 1/4 ESE	37	83
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GLACIER NORTHWEST, INC.	5975 E MARGINAL WAY S	0 - 1/8 SSE	B9	27
CHEVRON 90636	5940 E MARGINAL WAY	0 - 1/8 SSE	B11	32
CONSOLIDATED FREIGHTWAYS SEATT	6050 E MARGINAL WAY S	0 - 1/8 SSE	15	38

MANIFEST: Hazardous waste manifest information.

A review of the WA MANIFEST list, as provided by EDR, and dated 12/31/2004 has revealed that there are 8 WA MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
BPB GYPSUM	5931 E MARGINAL WY S	0 - 1/8 SSE	A5	21
BANK & OFFICE INTERIORS	5990 1ST AVE S	0 - 1/8 NNE	14	36
OLYMPIC MEDICAL CORP 1ST AVE S	5900 1ST AVE S	0 - 1/8 N	18	44
MOBILE CRANE CO INC	5900 2ND AVE S	1/8 - 1/4 NE	D20	48
SAINT GOBAIN CONTAINERS LLC	5801 EAST MARGINAL WAY	1/8 - 1/4 NNW	F25	56
CAPITAL INDUSTRIES INC	5801 3RD AVE S	1/8 - 1/4 NE	35	76
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GLACIER NORTHWEST EAST MARGINA	5975 E MARGINAL WAY S	0 - 1/8 SSE	B8	25
CHEVRON 90636	5940 E MARGINAL WAY S	0 - 1/8 SSE	B10	29

INST CONTROL: Sites that have institutional controls.

A review of the INST CONTROL list, as provided by EDR, and dated 06/06/2006 has revealed that there are 2 INST CONTROL sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
WESTERN PARCEL EXPRESS SEATTLE	525 S FRONT ST	1/4 - 1/2 E	L42	88
GENERAL ELECTRIC AVIATION DIV	220 S DAWSON ST	1/4 - 1/2 NNE	67	125

VCP: Sites that have entered either the Voluntary Cleanup Program or its predecessor Independent Remedial Action Program.

A review of the VCP list, as provided by EDR, and dated 08/17/2006 has revealed that there are 9 VCP sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
BPB GYPSUM	5931 E MARGINAL WY S	0 - 1/8 SSE	A5	21
MOBILE CRANE CO INC	5900 2ND AVE S	1/8 - 1/4 NE	D20	48

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
DUWAMISH MARINE CENTER	6365 1ST AVE S	1/8 - 1/4 S	H32	72
AIR TEC CO PARCEL C	5701 1ST AVE S	1/8 - 1/4 N	I34	75
WESTERN PARCEL EXPRESS SEATTLE	525 S FRONT ST	1/4 - 1/2 E	L42	88
BIG JOHNS TRUCK REPAIR INC	6533 3RD AVE S	1/4 - 1/2 SSE	45	94
EVERCLEAN INC DBA GAS N WASH	551 S MICHIGAN ST	1/4 - 1/2 ESE	N49	99
VIOX MCDOWELL SITE	551 S RIVER ST	1/4 - 1/2 SE	64	120
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
CONSOLIDATED FREIGHTWAYS SEATT	6050 E MARGINAL WAY S	0 - 1/8 SSE	15	38

ICR: These are remedial action reports Ecology has received from either the owner or operator of the site. These actions have been conducted without department oversight or approval and are not under an order or decree.

A review of the ICR list, as provided by EDR, and dated 12/01/2002 has revealed that there are 20 ICR sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
JAMES HARDIE GYPSUM	5931 E. MARGINAL WAY S.	0 - 1/8 SSE	A7	25
MOBILE CRANE CO INC	5900 2ND AVE S	1/8 - 1/4 NE	D20	48
BALL INCON	5801 E. MARGINAL WAY S.	1/8 - 1/4 NNW	F23	53
FRANK'S USED CARS	6305 E. MARGINAL WAY S.	1/8 - 1/4 SSE	G26	64
AIR TEC COMPANY	5701 1ST AVE SOUTH	1/8 - 1/4 N	I33	72
SAHLBERG EQUIPMENT	5950 4TH AVE S	1/8 - 1/4 ENE	J36	80
WESTERN PARCEL EXPRESS SEATTLE	525 S FRONT ST	1/4 - 1/2 E	L42	88
CARMODY PROPERTY - FORMER TR	220 S. RIVER ST.	1/4 - 1/2 SSE	M47	96
GAS N WASH	551 S. MICHIGAN ST.	1/4 - 1/2 ESE	N50	99
NATIONAL TRANSFER INC.	28 S. BRANDON ST.	1/4 - 1/2 NNW	51	102
TEXACO 632321455	600 S MICHIGAN	1/4 - 1/2 ESE	P55	106
MCWILLIAMS PROPERTY/TEXACO	5304 1ST AVE. S.	1/4 - 1/2 N	Q57	111
TEXACO (TWO REPORTS)	5303 1ST AVE. S.	1/4 - 1/2 N	Q58	112
SEATTLE CITY LIGHT	7TH / FIDALGO	1/4 - 1/2 ENE	61	117
PTL PARTNERSHIP/PENINSULA TRUC	6314 7TH S.	1/4 - 1/2 ESE	63	118
DAWSON STREET LAND CO	56 S DAWSON ST	1/4 - 1/2 N	R65	121
GENERAL ELECTRIC AVIATION DIV	220 S DAWSON ST	1/4 - 1/2 NNE	67	125
PACIFIC NW GROUP A	707 ORCAS ST	1/4 - 1/2 ENE	S69	133
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
CHEVRON #0636	5940 E. MARGINAL WAY	0 - 1/8 SSE	B12	33
CONSOLIDATED FREIGHTWAYS SEATT	6050 E MARGINAL WAY S	0 - 1/8 SSE	15	38

BROWNFIELDS: A listing of brownfields sites included in the Confirmed & Suspected Sites Listing. Brownfields are abandoned, idle or underused commercial or industrial properties, where the expansion or redevelopment is hindered by real or perceived contamination. Brownfields vary in size, location, age, and past use -- they can be anything from a five-hundred acre automobile assembly plant to a small, abandoned corner gas station.

A review of the BROWNFIELDS list, as provided by EDR, and dated 08/10/2006 has revealed that there is

EXECUTIVE SUMMARY

1 BROWNFIELDS site within approximately 0.5 miles of the target property.


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
EMERALD TOOL INC	6332 6TH S	1/4 - 1/2ESE	59	112

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

<u>Site Name</u>	<u>Database(s)</u>
SEATTLE CITY LIGHT STEAMPLANT GEOR	CSCSL
KING RESIDENCE	CSCSL, FINDS
PACIFIC EXPRESS	CSCSL, FINDS, VCP
PROLIANCE INTERNATIONAL INC	CSCSL, VCP
SONN PROPERTY	CSCSL
BOEING COMPANY N FIELD SEATTLE CY	CERC-NFRAP
SEATTLE, CY OF, 1ST AV BRG LDFL	CERC-NFRAP
FACTORIA PIT (SUNSET RAVINE PARK)	SWF/LF
GENESEE LANDFILL	SWF/LF
RICCHIAZZI INDUSTRIAL PROPERTY	FINDS, VCP, INST CONTROL
CITY OF SEATTLE WATER DEPARTMENT	UST
METRO TRANSIT	UST
LONGVIEW FIBRE COMPANY	UST
SEATTLE STEEL INC INDUSTRIAL FSTNR	UST
VACANT	UST
JAMES HARDIE GYPSUM	UST
SEATTLE CITY ENG DEPT 12TH AVE S	RCRA-SQG, FINDS
SEATTLE PUBLIC UTILITIES HBR. ISL.	RCRA-SQG, FINDS, WA MANIFEST
WA DOT BRG 099530E	RCRA-SQG, WA MANIFEST
SEATTLE CITY ENG DEPT AIRPORT WAY	RCRA-SQG, FINDS
SEATTLE CITY AIRPORT WAY PAINT SHO	RCRA-SQG, FINDS
1ST AVE S S MICHIGA	RCRA-SQG, FINDS
1ST AVE BRG BBC2	RCRA-SQG, FINDS
METRO TERM 117	RCRA-SQG, FINDS
SEATTLE CITY LIGHT STEAMPLANT GEOR	FINDS, BROWNFIELDS
FIRST AVE BRIDGE LANDFILL	FINDS, BROWNFIELDS
PAINTING BUSINESS/CENTRAL PAINTING	US BROWNFIELDS
SEATTLE CITY DOT AIRPORT WAY ARGO	WA MANIFEST
UPS SEATTLE IMPORT	WA MANIFEST

OVERVIEW MAP - 01752816.3r

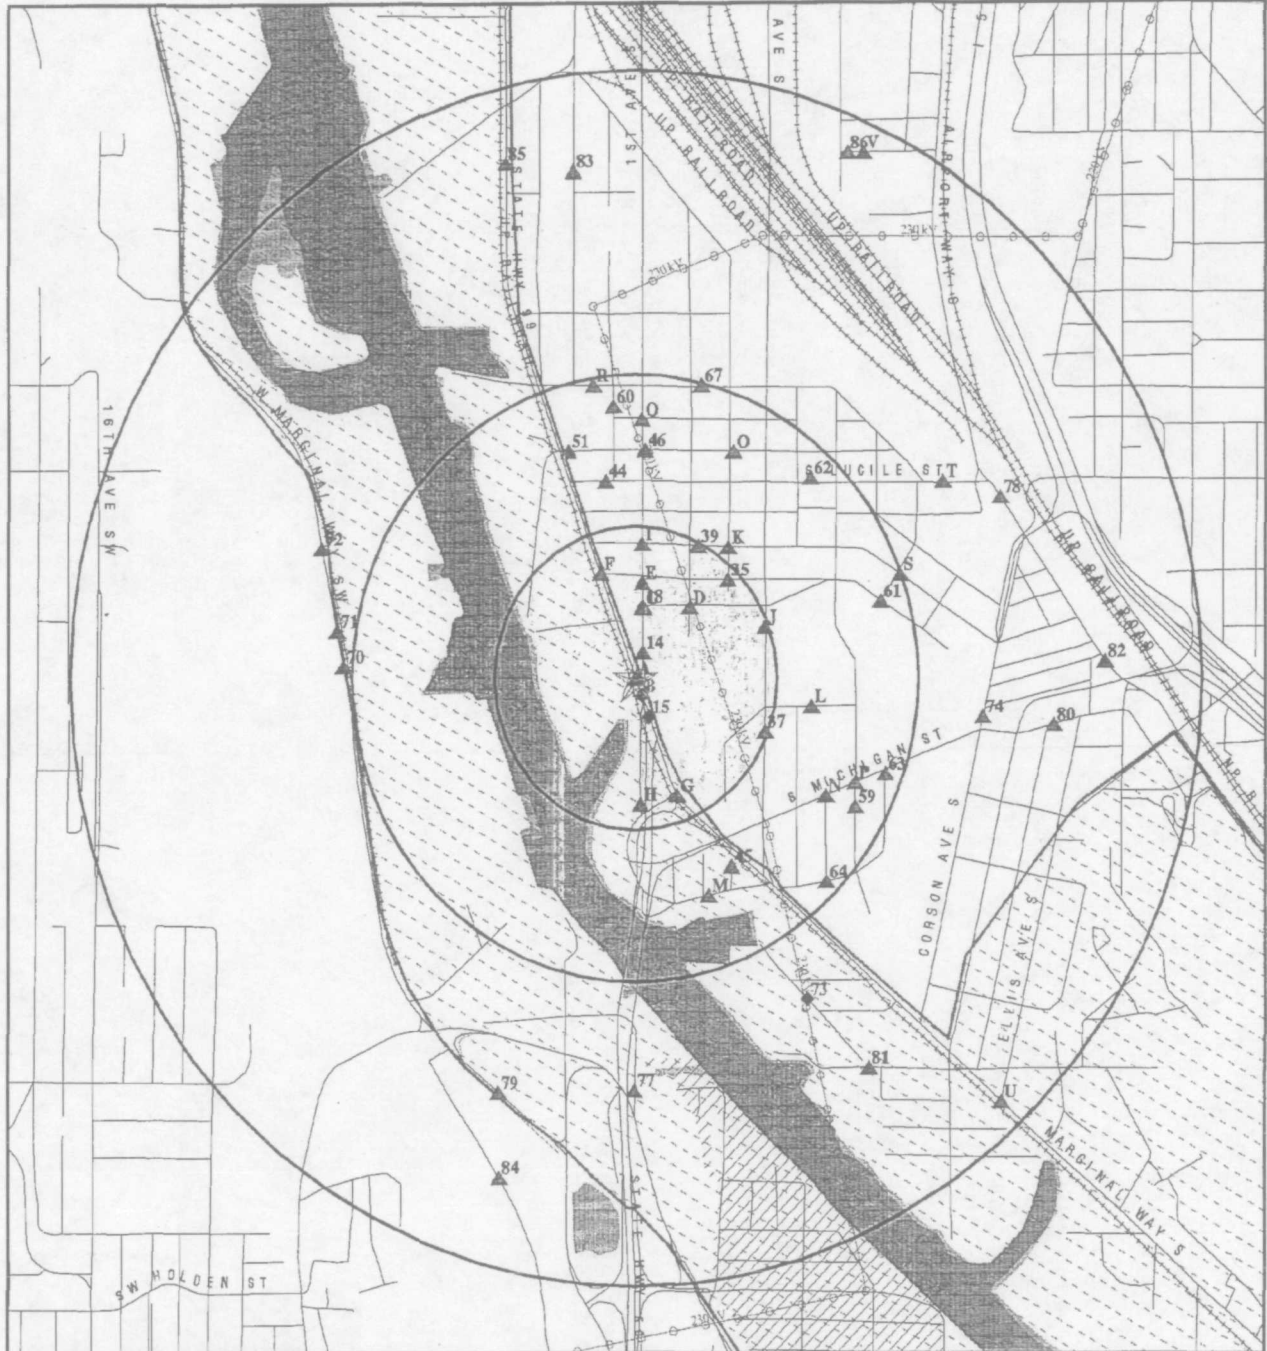

★ Target Property

▲ Sites at elevations higher than or equal to the target property

◆ Sites at elevations lower than the target property

▲ Manufactured Gas Plants

■ National Priority List Sites

■ Landfill Sites

■ Dept. Defense Sites

■ Indian Reservations BIA

▲ Power transmission lines

▲ Oil & Gas pipelines

■ 100-year flood zone

■ 500-year flood zone

■ National Wetland Inventory


SITE NAME: Longview Fibre Seattle
ADDRESS: 5901 E MARGINAL WAY S
Seattle WA 98108
LAT/LONG: 47.5487 / 122.3345

CLIENT: ENSR Consulting & Engineering
CONTACT: Don Clabaugh
INQUIRY #: 01752816.3r
DATE: September 12, 2006 10:42 am

Copyright © 2006 EDR, Inc. © 2006 Te & Atlas Rel. 07/2005.

LFC000052

DETAIL MAP - 01752816.3r

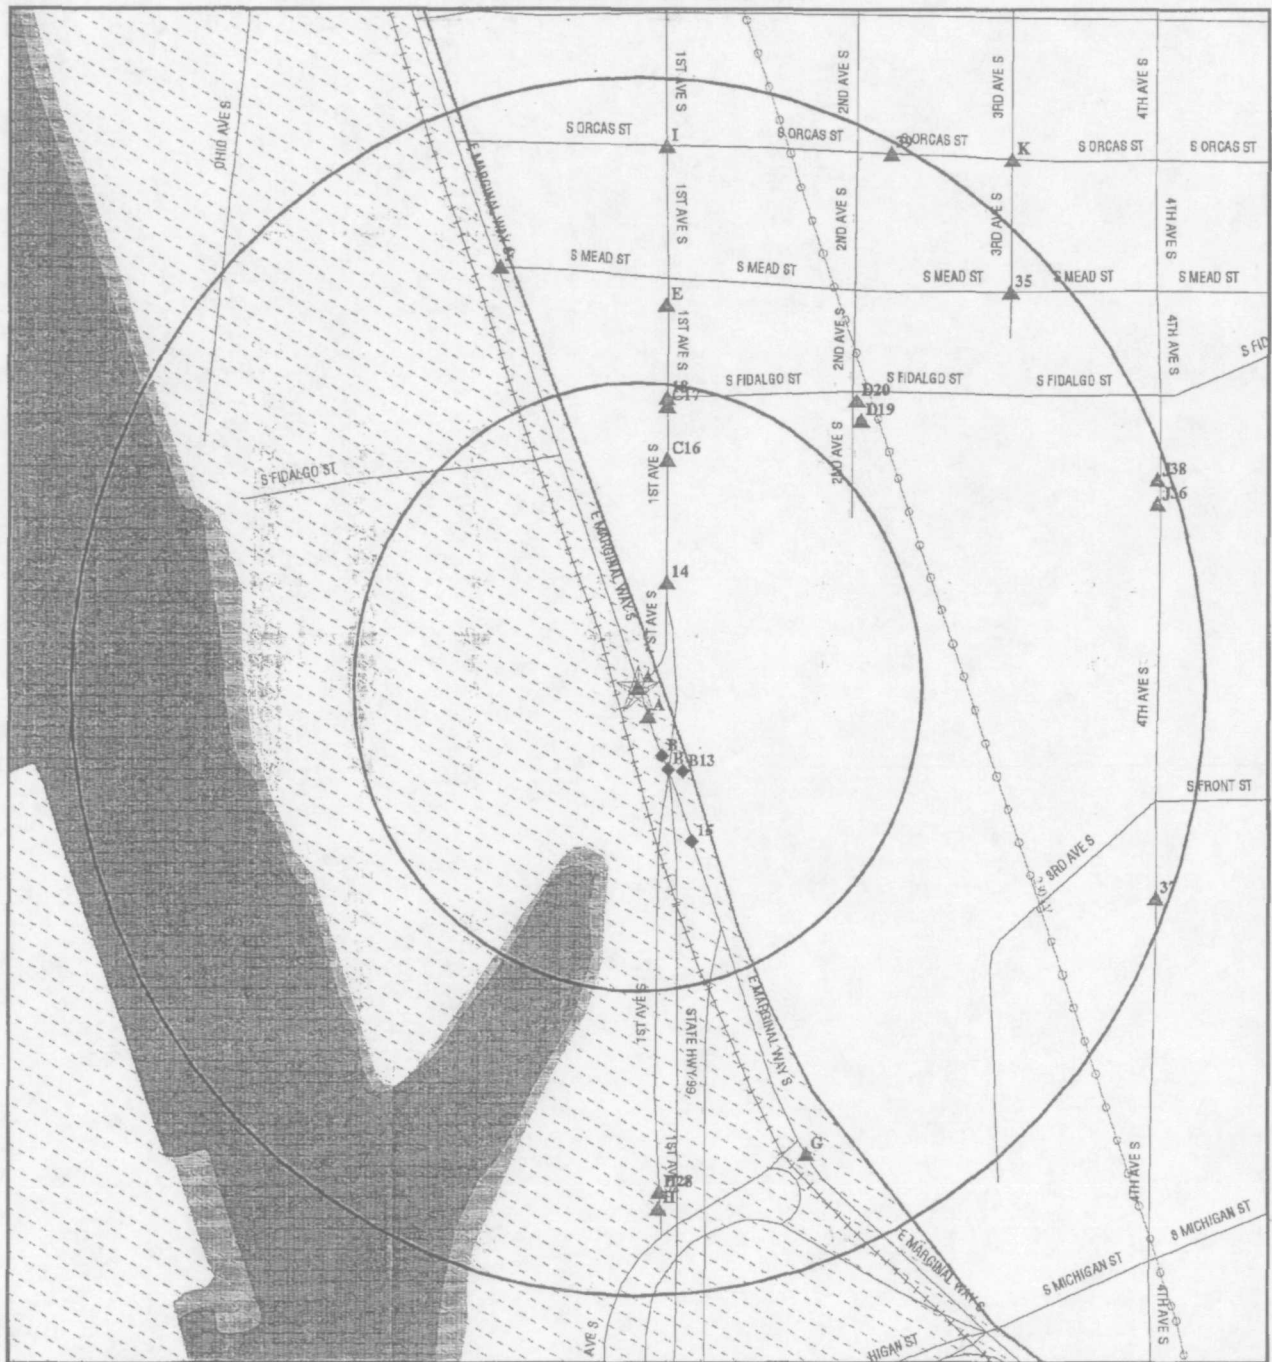

★ Target Property

▲ Sites at elevations higher than or equal to the target property

◆ Sites at elevations lower than the target property

▲ Manufactured Gas Plants

• Sensitive Receptors

■ National Priority List Sites

■ Landfill Sites

■ Dept. Defense Sites

■ Indian Reservations BIA

~ Power transmission lines

~ Oil & Gas pipelines

■ 100-year flood zone

■ 500-year flood zone

■ National Wetland Inventory

0 1/16 1/8 1/4 Miles

SITE NAME: Longview Fibre Seattle
ADDRESS: 5901 E MARGINAL WAY S
Seattle WA 98108
LAT/LONG: 47.5487 / 122.3345

CLIENT: ENSR Consulting & Engineering
CONTACT: Don Clabaugh
INQUIRY #: 01752816.3r
DATE: September 12, 2006 10:42 am

Copyright © 2006 EDR, Inc. © 2006 Tele Atlas Rel. 07/2005

LFC000053

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FEDERAL RECORDS								
NPL		1.000	1	0	0	0	NR	1
Proposed NPL		1.000	1	0	0	0	NR	1
Delisted NPL		1.000	0	0	0	0	NR	0
NPL RECOVERY		TP	NR	NR	NR	NR	NR	0
CERCLIS		0.500	1	0	0	NR	NR	1
CERC-NFRAP		0.500	0	0	1	NR	NR	1
CORRACTS		1.000	0	0	1	2	NR	3
RCRA TSD		0.500	0	0	0	NR	NR	0
RCRA Lg. Quan. Gen.		0.250	0	1	NR	NR	NR	1
RCRA Sm. Quan. Gen.	X	0.250	7	8	NR	NR	NR	15
ERNS	X	TP	NR	NR	NR	NR	NR	0
HMIRS		TP	NR	NR	NR	NR	NR	0
US ENG CONTROLS		0.500	0	0	1	NR	NR	1
US INST CONTROL		0.500	0	0	0	NR	NR	0
DOD		1.000	0	0	0	0	NR	0
FUDS		1.000	0	0	0	0	NR	0
US BROWNFIELDS		0.500	0	0	2	NR	NR	2
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
UMTRA		0.500	0	0	0	NR	NR	0
ODI		0.500	0	0	0	NR	NR	0
TRIS		TP	NR	NR	NR	NR	NR	0
TSCA		TP	NR	NR	NR	NR	NR	0
FTTS	X	TP	NR	NR	NR	NR	NR	0
SSTS		TP	NR	NR	NR	NR	NR	0
ICIS		TP	NR	NR	NR	NR	NR	0
PADS		TP	NR	NR	NR	NR	NR	0
MLTS		TP	NR	NR	NR	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
FINDS	X	TP	NR	NR	NR	NR	NR	0
RAATS		TP	NR	NR	NR	NR	NR	0
STATE AND LOCAL RECORDS								
CSCSL	X	1.000	2	4	4	20	NR	30
HSL		1.000	0	0	0	1	NR	1
CSCSL NFA		0.500	2	1	6	NR	NR	9
State Landfill		0.500	0	0	0	NR	NR	0
SWTIRE		0.500	0	0	0	NR	NR	0
LUST	X	0.500	4	2	9	NR	NR	15
UST		0.250	4	6	NR	NR	NR	10
AST		0.250	0	0	NR	NR	NR	0
MANIFEST	X	0.250	5	3	NR	NR	NR	8
SPILLS		TP	NR	NR	NR	NR	NR	0
INST CONTROL		0.500	0	0	2	NR	NR	2
VCP		0.500	2	3	4	NR	NR	9
ICR	X	0.500	3	5	12	NR	NR	20
DRYCLEANERS		0.250	0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
BROWNFIELDS		0.500	0	0	1	NR	NR	1
CDL	TP		NR	NR	NR	NR	NR	0
NPDES	TP		NR	NR	NR	NR	NR	0
WA Emissions	TP		NR	NR	NR	NR	NR	0
Inactive Drycleaners		0.250	0	0	NR	NR	NR	0
TRIBAL RECORDS								
INDIAN RESERV		1.000	0	0	0	0	NR	0
INDIAN LUST		0.500	0	0	0	NR	NR	0
INDIAN UST		0.250	0	0	NR	NR	NR	0
EDR PROPRIETARY RECORDS								
Manufactured Gas Plants		1.000	0	0	0	0	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

A1 LONGVIEW FIBRE CO
Target 5901 E MARGINAL WY S
Property SEATTLE, WA 98134

RCRA-SQG 1000237371
CSCSL WAD009282161
FINDS
WA MANIFEST
ICR

Actual: Site 1 of 7 in cluster A
9 ft.

RCRAInfo:
Owner: LONGVIEW FIBRE CO
 (360)425-1550
EPA ID: WAD009282161
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

CSCSL:
Facility ID: 2226
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54994000
Longitude: -122.33542000
Lat/Long: 47.54994000 / -122.33542000
Lat/Long (dms): 47 32 59.0000 / 122 20 7.0000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2914
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Not reported

Facility ID: 2226

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

LONGVIEW FIBRE CO (Continued)

1000237371

warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54994000
Longitude: -122.33542000
Lat/Long: 47.54994000 / -122.33542000
Lat/Long (dms): 47 32 59.0000 / 122 20 7.0000
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Confirmed
Affected Media: 2915
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Not reported

Facility ID: 2226
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54994000
Longitude: -122.33542000
Lat/Long: 47.54994000 / -122.33542000
Lat/Long (dms): 47 32 59.0000 / 122 20 7.0000
Media ID: 3
Media Type Desc: Air
Media Status Desc: Confirmed
Affected Media: 2916
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

LONGVIEW FIBRE CO (Continued)


1000237371

Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Not reported

Facility ID: 2226
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54994000
Longitude: -122.33542000
Lat/Long: 47.54994000 / -122.33542000
Lat/Long (dms): 47 32 59.0000 / 122 20 7.0000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2917
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site



Database(s) EDR ID Number
 EPA ID Number

LONGVIEW FIBRE CO (Continued)

1000237371

Wood Debris Contaminant Group: Not reported
 Other Deleterious Substance Group: Not reported
 Ecology Site Status (MTCA cleanup process): Independent Remedial Action
 Independent Site Status (independent cleanup): Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number: 2226
 Permit by Rule: False
 Treatment by Generator: False
 Mixed radioactive waste: False
 Importer of hazardous waste: False
 Immediate recycler: False
 Treatment/Storage/Disposal/Recycling Facility: False
 Generator of dangerous fuel waste: False
 Generator marketing to burner: False
 "Other marketers (i.e., blender, distributor, etc.):": False
 Utility boiler burner: False
 Industry boiler burner: False
 Industrial Furnace: False
 Smelter deferral: False
 Universal waste - batteries - generate: False
 Universal waste - thermostats - generate: False
 Universal waste - mercury - generate: False
 Universal waste - lamps - generate: False
 Universal waste - batteries - accumulate: False
 Universal waste - thermostats - accumulate: False
 Universal waste - mercury - accumulate: False
 Universal waste - lamps - accumulate: False
 Destination Facility for Universal Waste: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

LONGVIEW FIBRE CO (Continued)

1000237371

Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD009282161
Facility Address 2: Not reported
TAX REG NBR: 084000074
NAICS CD: 322211
BUSINESS TYPE: Not reported
MAIL NAME: Longview Fibre Co
MAIL ADDR LINE1: PO Box 24867
MAIL CITY,ST,ZIP: SEATTLE, WA 98124-0867
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Longview Fibre Co
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: PO Box 639
LEGAL CITY,ST,ZIP: LONGVIEW, WA 98632-7411
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (360)425-1550
LEGAL EFFECTIVE DATE: 08/21/96
LAND ORG NAME: Longview Fibre Co
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: PO Box 639
LAND CITY,ST,ZIP: LONGVIEW, WA 98632-7411
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (360)425-1550
OPERATOR ORG NAME: Longview Fibre Co
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: PO Box 24867
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98124-0867
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 206-762-7170
OPERATOR EFFECTIVE DATE: 01/01/97
SITE CONTACT NAME: George L Mitchell
SITE CONTACT ADDR LINE1: 5901 E MARGINAL WAY S
SITE CONTACT ZIP: SEATTLE, WA 98134-2414
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)762-7170
SITE CONTACT EMAIL: glmitchell@longfibre.com
FORM CONTACT NAME: Steve E Frase
FORM CONTACT ADDR LINE1: PO Box 639
FORM CONTACT CITY,ST,ZIP: LONGVIEW, WA 98632-7411
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (360)575-5578 5578
FORM CONTACT EMAIL: sefrase@longfibre.com
GEN STATUS CD: XQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False

Map ID
Direction
Distance
Distance (ft.)
Elevation



LONGVIEW FIBRE CO (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000237371

USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ICR:

Date Ecology Received Report: 02/05/1996
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-24
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

A2 **LONGVIEW FIBRE CO SEATTLE**
Target **5901 E MARGINAL WAY S**
Property **SEATTLE, WA 98134**

FTTS **1008183954**
N/A

Site 2 of 7 in cluster A

Actual:
9 ft.

FTTS Insp:
Region: 10
Inspected Date: Not reported
Insp Number: 19881228WA003 3
Violation occurred: No
Inspector: MAULE
Investigation Type: Section 6 PCB State Conducted
Facility Function: User
Investig Reason: Not reported
Legislation Code: TSCA

A3 **5901 EAST MARGINAL WAY**
Target **5901 EAST MARGINAL WAY**
Property **SEATTLE, WA**

ERNS **90191082**
N/A

Site 3 of 7 in cluster A

Actual:
9 ft.

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

A4 **LONGVIEW FIBER CO.**
Target **5901 E. MARGINAL WAY S.**
Property **SEATTLE, WA 98134**

LUST **U003028114**
ICR **N/A**

Site 4 of 7 in cluster A

Actual:
9 ft.

LUST:
FS ID: 2226
Facility ID: 7348
Release ID: 3449
Alternate Name: LONGVIEW FIBRE COMPANY
Release Notification Date: 1/1/1988 00:00:00
Release Status Date: 6/1/1995 00:00:00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

LONGVIEW FIBER CO. (Continued)

U003028114

Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.54993999999999 / -122.33542

FS ID: 2226
Facility ID: 7348
Release ID: 3449
Alternate Name: LONGVIEW FIBRE COMPANY
Release Notification Date: 1/1/1988 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.54993999999999 / -122.33542

FS ID: 2226
Facility ID: 7348
Release ID: 3449
Alternate Name: LONGVIEW FIBRE COMPANY
Release Notification Date: 1/1/1988 00:00:00
Release Status Date: 3/10/2003 00:00:00
Facility Status: Monitoring
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.54993999999999 / -122.33542

FS ID: 2226
Facility ID: 7348
Release ID: 3449
Alternate Name: LONGVIEW FIBRE COMPANY
Release Notification Date: 1/1/1988 00:00:00
Release Status Date: 3/10/2003 00:00:00
Facility Status: Monitoring
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.54993999999999 / -122.33542

ICR:
Date Ecology Received Report: 11/01/1996
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-22
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NPL
Region LOWER DUWAMISH WATERWAY
RK 2.5 TO RK 10.8
SEATTLE, WA 98168

< 1/8
1 ft.

Database(s)
EDR ID Number
EPA ID Number

CERCLIS
FINDS 1001217075
NPL WA0002329803
Proposed NPL

CERCLIS:

Site ID: 1002020
Federal Facility: Not a Federal Facility
NPL Status: Currently on the Final NPL
Non NPL Status: Not reported

CERCLIS Site Contact Name(s):

Contact Name: MONICA TONEL
Contact Tel: (206) 553-0323
Contact Title: Site Assessment Manager (SAM)

Contact Name: KRIS FLINT
Contact Tel: (206) 553-8155
Contact Title: Remedial Project Manager (RPM)

Contact Name: KAREN KEELEY
Contact Tel: (206) 553-2141
Contact Title: Remedial Project Manager (RPM)

Contact Name: ALLISON HILTNER
Contact Tel: (206) 553-2140
Contact Title: Remedial Project Manager (RPM)

Contact Name: RAVI SANGA
Contact Tel: (206) 553-0492
Contact Title: Remedial Project Manager (RPM)

Contact Name: CLAIRE HONG
Contact Tel: (206) 553-1813
Contact Title: Remedial Project Manager (RPM)

CERCLIS Site Alias Name(s):

Alias Name: LOWER DUWAMISH RIVER KM 2.5-10.8
Alias Address: KILOMETER 2.5 TO 10.8
SEATTLE, WA 98134

Alias Name: LOWER DUWAMISH RIVER KM 2.5-10.8
Alias Address: RIVER MILE 2.5
SEATTLE, WA 98134

Alias Name: LOWER DUWAMISH WATERWAY
Alias Address: RIVER KILOMETER 2.5 TO 11.5
SEATTLE, WA 98134

Alias Name: LOWER DUWAMISH RIVER KM 2.5
Alias Address: RIVER KILOMETER 2.5
SEATTLE, WA 98134

Alias Name: LOWER DUWAMISH WATERWAY
Alias Address: RK 2.5 TO RK 10.8
SEATTLE, WA 98168

Alias Name: LOWER DUWAMISH RIVER RM 1.5
Alias Address: RIVER MILE 1.5
SEATTLE, WA 98134

Alias Name: LOWER DUWAMISH RIVER KM 1.5
Alias Address: RIVER KILOMETER 1.5

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

LOWER DUWAMISH WATERWAY (Continued)

1001217075

Alias Name: SEATTLE, WA 98134
Alias Address: LOWER DUWAMISH RIVER RM 2.5
RIVER MILE 1.5
SEATTLE, WA 98134
Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 03/25/1998
Priority Level: Not reported

Action: SITE INSPECTION
Date Started: 04/15/1998
Date Completed: 04/21/1999
Priority Level: High

Action: PRELIMINARY ASSESSMENT
Date Started: 04/15/1998
Date Completed: 04/21/1999
Priority Level: High

Action: PROPOSAL TO NATIONAL PRIORITIES LIST
Date Started: Not reported
Date Completed: 12/01/2000
Priority Level: Not reported

Action: HAZARD RANKING SYSTEM PACKAGE
Date Started: Not reported
Date Completed: 12/01/2000
Priority Level: Being considered for proposal to the NPL

Action: ADMINISTRATIVE ORDER ON CONSENT
Date Started: Not reported
Date Completed: 12/20/2000
Priority Level: Not reported

Action: POTENTIALLY RESPONSIBLE PARTY REMEDIAL INVESTIGATION/FEASIBILITY STUDY
Date Started: 12/20/2000
Date Completed: Not reported
Priority Level: Not reported

Action: FINAL LISTING ON NATIONAL PRIORITIES LIST
Date Started: Not reported
Date Completed: 09/13/2001
Priority Level: Not reported

Action: ADMINISTRATIVE ORDER ON CONSENT
Date Started: Not reported
Date Completed: 07/10/2003
Priority Level: Not reported

Action: ENGINEERING EVALUATION/COST ANALYSIS
Date Started: 07/07/2004
Date Completed: 07/22/2005
Priority Level: Not reported

Action: TECHNICAL ASSISTANCE GRANT

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number

EPA ID Number

LOWER DUWAMISH WATERWAY (Continued)

1001217075

Date Started: 08/07/2001
Date Completed: 09/30/2005
Priority Level: Not reported

Action: ADMINISTRATIVE ORDER ON CONSENT
Date Started: Not reported
Date Completed: 10/17/2005
Priority Level: Not reported

Action: ADMINISTRATIVE ORDER ON CONSENT
Date Started: Not reported
Date Completed: 12/22/2005
Priority Level: Not reported

Action: TECHNICAL ASSISTANCE GRANT
Date Started: 03/06/2006
Date Completed: Not reported
Priority Level: Not reported

Action: ENGINEERING EVALUATION/COST ANALYSIS
Date Started: 06/15/2004
Date Completed: 05/05/2006
Priority Level: Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include: Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NPL:

EPA ID: WA0002329803
Region: 10
Federal: General
Final Date: 09/13/2001

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

LOWER DUWAMISH WATERWAY (Continued)

1001217075

Site Details:

Site Name: LOWER DUWAMISH WATERWAY
Site Status: Final
Status Date: 09/13/2001
Site City: SEATTLE
Site State: WA
Federal Site: Not a Federal Facility
HRS Score: 50.00
GW Score: 0.00
SW Score: 100.00
Air Score: Not reported
Soil Score: Not reported
DC Score: Not reported
FE Score: Not reported

Substance Details:

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: 3001
CAS #: 333-41-5
Substance: ALFA-TOXINS
Pathway: NO PATHWAY INDICATED
Scoring: 1

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: A005
CAS #: Not reported
Substance: ARSENIC AND COMPOUNDS
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: A008
CAS #: Not reported
Substance: BENZOFLUORANTHENE, 2,3-
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: A009
CAS #: 207-08-9
Substance: BENZO(K)FLUORANTHENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: A020
CAS #: Not reported
Substance: CHROMIUM AND COMPOUNDS
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: A038
CAS #: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

LOWER DUWAMISH WATERWAY (Continued)

1001217075

Substance: NICKEL AND COMPOUNDS
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: A046
CAS #: 1336-36-3
Substance: POLYCHLORINATED BIPHENYLS
Pathway: SURFACE WATER PATHWAY
Scoring: 4

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: C013
CAS #: 120-12-7
Substance: ANTHRACENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: C178
CAS #: Not reported
Substance: COPPER AND COMPOUNDS
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: C332
CAS #: 85-01-8
Substance: PHENANTHRENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: C385
CAS #: 129-00-0
Substance: PYRENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: C431
CAS #: 86-73-7
Substance: FLUORENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: C460
CAS #: 7439-97-6
Substance: MERCURY
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

LOWER DUWAMISH WATERWAY (Continued)

EDR ID Number
EPA ID Number

Database(s)

1001217075

NPL Status: Currently on the Final NPL
Substance ID: D006
CAS #: 7440-43-9
Substance: CADMIUM (CD)
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U018
CAS #: 56-55-3
Substance: BENZ(A)ANTHRACENE
Pathway: SURFACE WATER PATHWAY
Scoring: 4

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U022
CAS #: 50-32-8
Substance: BENZO(A)PYRENE
Pathway: SURFACE WATER PATHWAY
Scoring: 4

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U028
CAS #: 117-81-7
Substance: BIS(2-ETHYLHEXYL)PHTHALATE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U050
CAS #: 218-01-9
Substance: CHRYSENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U063
CAS #: 53-70-3
Substance: DIBENZ(A,H)ANTHRACENE
Pathway: SURFACE WATER PATHWAY
Scoring: 4

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U120
CAS #: 206-44-0
Substance: BENZO(J,K)FLUORENE
Pathway: SURFACE WATER PATHWAY
Scoring: 2

Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: U137
CAS #: 193-39-5
Substance: INDENO(1,2,3-CD)PYRENE
Pathway: SURFACE WATER PATHWAY

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

LOWER DUWAMISH WATERWAY (Continued)

1001217075

Scoring: 2
Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: Z038
CAS #: 688-73-3
Substance: TRIBUTYL TIN
Pathway: SURFACE WATER PATHWAY
Scoring: 2
Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: Z039
CAS #: 1002-53-5
Substance: DI-N-BUTYL TIN
Pathway: SURFACE WATER PATHWAY
Scoring: 2
Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: Z040
CAS #: 2406-65-7
Substance: N-BUTYL TIN
Pathway: NO PATHWAY INDICATED
Scoring: 1
Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: Z041
CAS #: 1461-25-2
Substance: TETRA-N-BUTYL TIN
Pathway: NO PATHWAY INDICATED
Scoring: 1
Site ID: Not reported
NPL Status: Currently on the Final NPL
Substance ID: Not reported
CAS #: Not reported
Substance: Not reported
Pathway: Not reported
Scoring: Not reported

Summary Details:

"Conditions at Proposal (December 1, 2000): Sediments in the lower Duwamish River are contaminated with semivolatile organic compounds, PCBs, inorganics, and organotins. In order to address the long-term threat to the human food chain and sensitive environments in the river, the EPA is adding this site to the NPL. The Duwamish River originates at the confluence of the Green and Black Rivers near Tukwila, Washington, then flows northeast for approximately 21 river kilometers, dividing at the southern end of Harbor Island to form the East and West waterways prior to discharging into Elliot Bay at Seattle, Washington. A segment of the river is maintained by the US Army Corps of Engineers as a federal navigation channel (i.e., the reach d ownchannel of Turning Basin #3). The shorelines along the majority of the Duwamish Waterway have been developed for industrial and commercial operations. Much of the upland areas are heavily industrialized. In addition, this reach of the river is the receiving water body for discharges from over 100 storm drains,

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

LOWER DUWAMISH WATERWAY (Continued)

1001217075

combined sewer overflows (CSOs), and other outfalls. Historical or current commercial and industrial operations include cargo handling and storage; marine construction; boat manufacturing; marina operations; paper and metals fabrication; food processing; and airplane parts manufacturing. Contaminants may have entered the river via several transport mechanisms, including spillage during product shipping and handling, direct disposal or discharge, contaminated ground water discharge, surface water runoff, storm water discharge, or contaminated soil erosion. The presence of polychlorinated terphenyl (PCT), polychlorinated biphenyl (PCB), inorganic, semivolatile organic compound, and organotin contamination to surface sediments has been documented in the lower Duwamish River. In addition, subsurface sample results indicate that semivolatile organic compound, inorganic, and organotin contamination exists up to a depth of 1.2 meters (i.e., 4 feet) at some locations within the river. Numerous investigations performed by USEPA, the Boeing Company, King County Department of Natural Resources, and the National Oceanographic and Atmospheric Administration (NOAA) have been conducted with varying scopes and have led to the documentation of the contamination in the lower Duwamish River. The lower Duwamish River is fished for recreational, commercial, and subsistence purposes. Three salmon hatcheries within the Green-Duwamish River system release approximately 10 million juvenile salmon each year. The Duwamish River is part of the traditional fishing grounds for the Muckleshoot and Suquamish Indian tribes. The National Marine Fisheries Service, has conducted numerous studies on the effects of contaminated sediments on biotic resources in the Duwamish River and elsewhere in Puget Sound. This research has shown that juvenile salmon from the Duwamish River exhibit reduced growth and immune system function relative to salmon from uncontaminated areas. The lower Duwamish River serves as a migratory route, nursery, and osmoregulatory transition zone for several species of Pacific salmon. Puget Sound Chinook salmon are federally listed as threatened and utilize the lower Duwamish River during a critical stage of their migration from a fresh water to a salt water environment. The federal candidate species Coho salmon also occurs in this area as does a nesting territory for the federal listed threatened Bald eagle and a wetland. Status (September 2001): EPA is considering various alternatives for this site. [The description of the site (release) is based on information available at the time the site was evaluated with the HRS. The description may change as additional information is gathered on the sources and extent of contamination. See 56 FR 5600, February 11, 1991, or subsequent FR notices.] For more information about the hazardous substances identified in this narrative summary, including general information regarding the effects of exposure to these substances on human health, please see the Agency for Toxic Substances and Disease Registry (ATSDR) ToxFAQs. ATSDR ToxFAQs can be found on the Internet at <http://www.atsdr.cdc.gov/toxfaq.html> or by telephone at 1-888-42-ATSDR or 1-888-422-8737."

Site Status Details:
NPL Status:
Proposed Date:
Final Date:

Final
12/01/2000
09/13/2001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

LOWER DUWAMISH WATERWAY (Continued)

EDR ID Number
EPA ID Number

Database(s)

Deleted Date: Not reported

1001217075

A6 BPB GYPSUM
SSE 5931 E MARGINAL WY S
< 1/8 SEATTLE, WA 98134
66 ft.

RCRA-SQG 1004793687
FINDS WAD980382972
CSCSL NFA
VCP
WA MANIFEST

Relative:
Equal

Site 5 of 7 in cluster A

Actual:
9 ft.

RCRAInfo:

Owner: MARK CUBBAGE
(206) 763-1441

EPA ID: WAD980382972

Contact: Not reported

Classification: Small Quantity Generator

TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: -515(6)(a)(i)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 09/11/2002
Actual Date Achieved Compliance: 12/26/2002

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 12/23/2002
Penalty Type: Not reported

Regulation Violated: -522(2)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 09/11/2002
Actual Date Achieved Compliance: 12/26/2002

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 12/23/2002
Penalty Type: Not reported

Regulation Violated: -515(6) / 40 CFR 279.22(c)(1)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 09/11/2002
Actual Date Achieved Compliance: 12/26/2002

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 12/23/2002
Penalty Type: Not reported

There are 3 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20021226
	GENERATOR-GENERAL REQUIREMENTS	20021226
	GENERATOR-GENERAL REQUIREMENTS	20021226

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

BPB GYPSUM (Continued)

1004793687

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CSCSL NFA:

Facility/Site Id: 2253
Ecology Status: Independent Remedial Action
Program Plan Code: 4
Independent Status Code: Final Independent RA Report received
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 2/23/2006 00:00:00
Latitude: 47.548386
Longitude: -122.337167

VCP:

Facility ID: 2253
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: NFA after assessment, IRAP, or VCP
Program Plan: 4

WA MANIFEST:

Facility Site ID Number: 2253
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BPB GYPSUM (Continued)

1004793687

Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD980382972
Facility Address 2: Not reported
TAX REG NBR: 601087384
NAICS CD: 32742
BUSINESS TYPE: Manufacturing
MAIL NAME: BPB Gypsum Inc
MAIL ADDR LINE1: 5301 W CYPRESS ST
MAIL CITY,ST,ZIP: TAMPA, FL 33609-1766
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: BPB Gypsum Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 5301 W CYPRESS ST
LEGAL CITY,ST,ZIP: TAMPA, FL 33609-1766
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: 8662723722
LEGAL EFFECTIVE DATE: 07/01/02
LAND ORG NAME: BPB Gypsum Inc
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 5301 W CYPRESS ST
LAND CITY,ST,ZIP: TAMPA, FL 33609-1766
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: 8662723722
OPERATOR ORG NAME: Not reported
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5931 E MARGINAL WAY S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98134-2414
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206) 763-1441
OPERATOR EFFECTIVE DATE: 03/13/97
SITE CONTACT NAME: Mark Cubbage
SITE CONTACT ADDR LINE1: 5931 E MARGINAL WAY S
SITE CONTACT ZIP: SEATTLE, WA 98134-2414
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)768-3711
SITE CONTACT EMAIL: mark.cubbage@bpb-na.com
FORM CONTACT NAME: Bob McKnight
FORM CONTACT ADDR LINE1: 5931 E MARGINAL WAY S
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98134-2414
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)768-3734
FORM CONTACT EMAIL: bob.mcknight@bpb-na.com
GEN STATUS CD: SQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BPB GYPSUM (Continued)

1004793687

USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

A6 JAMES HARDIE GYPSUM
SSE 5931 E MARGINAL WAY SO
< 1/8 SEATTLE, WA 98134
66 ft.

LUST 1000220991
SPILLS N/A

Site 6 of 7 in cluster A

Relative:
Equal

Actual:
9 ft.

LUST:
FS ID: 2253
Facility ID: 7095
Release ID: 1903
Alternate Name: JAMES HARDIE GYPSUM
Release Notification Date: 1/11/1991 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.548386000000001 / -122.33716699999999

FS ID: 2253
Facility ID: 7095
Release ID: 1903
Alternate Name: JAMES HARDIE GYPSUM
Release Notification Date: 1/11/1991 00:00:00
Release Status Date: 1/26/2001 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.548386000000001 / -122.33716699999999

SPILLS:

Facility ID: 527278
Medium: SURFACE WATER-FRESH
Material Desc: PETROLEUM - LUBE OIL
Material Qty: 1
Material Units: CUP
Date Received: 2002-06-23 00:00:00
Contact Name: Not reported
Company Name: GENERAL STEAMSHIP (LOCAL AGENT)

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A7 JAMES HARDIE GYPSUM
SSE 5931 E. MARGINAL WAY S.
< 1/8 SEATTLE, WA 98134
66 ft.

Database(s) EDR ID Number
EPA ID Number

ICR 1001819375
N/A

Site 7 of 7 in cluster A

Relative:
Equal

ICR:

Actual:
9 ft.

Date Ecology Received Report: 07/24/1991
Contaminants Found at Site: Metals
Media Contaminated: Groundwater, Soil
Waste Management: Not reported
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-05
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 05/13/1991
Contaminants Found at Site: Not reported
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 98-33
County Code: 17.00000
Contact: Not reported
Report Title: Initial Investigation

B8 GLACIER NORTHWEST EAST MARGINAL WAY
SSE 5975 E MARGINAL WAY S
< 1/8 SEATTLE, WA 98134
159 ft.

RCRA-SQG 1000198869
FINDS WAD980986061
WA MANIFEST

Site 1 of 6 in cluster B

Relative:
Lower

RCRAInfo:

Actual:
8 ft.

Owner: GLACIER NORTHWEST INC
(206)764-3000
EPA ID: WAD980986061
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

GLACIER NORTHWEST EAST MARGINAL WAY (Continued)

1000198869

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number:	95534411
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.):"	False
Utility boiler burner:	False
Industry boiler burner:	False
Industrial Furnace:	False
Smelter deferral:	False
Universal waste - batteries - generate:	False
Universal waste - thermostats - generate:	False
Universal waste - mercury - generate:	False
Universal waste - lamps - generate:	False
Universal waste - batteries - accumulate:	False
Universal waste - thermostats - accumulate:	False
Universal waste - mercury - accumulate:	False
Universal waste - lamps - accumulate:	False
Destination Facility for Universal Waste:	False
Off-specification used oil burner - utility boiler:	False
Off-specification used oil burner - industrial boiler:	False
Off-specification used oil burner - industrial furnace:	False
EPA ID:	WAD980986061
Facility Address 2:	Not reported
TAX REG NBR:	601301145
NAICS CD:	32732
BUSINESS TYPE:	Not reported
MAIL NAME:	Glacier Northwest Inc
MAIL ADDR LINE1:	PO Box 1730
MAIL CITY,ST,ZIP:	SEATTLE, WA 98111-1730
MAIL COUNTRY:	UNITED STATES
LEGAL ORG NAME:	Glacier Northwest Inc
LEGAL ORG TYPE:	Private
LEGAL ADDR LINE1:	PO Box 1730
LEGAL CITY,ST,ZIP:	SEATTLE, WA 98111-1730
LEGAL COUNTRY:	UNITED STATES
LEGAL PHONE NBR:	(206)764-3000
LEGAL EFFECTIVE DATE:	01/01/88
LAND ORG NAME:	Glacier Northwest Inc
LAND ORG TYPE:	Private
LAND PERSON NAME:	Not reported
LAND ADDR LINE1:	PO Box 1730
LAND CITY,ST,ZIP:	SEATTLE, WA 98111-1730

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

GLACIER NORTHWEST EAST MARGINAL WAY (Continued)

1000198869

LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206)764-3000
OPERATOR ORG NAME: Glacier Northwest Inc
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: PO Box 1730
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98111-1730
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 206-764-3000
OPERATOR EFFECTIVE DATE: 01/01/88
SITE CONTACT NAME: Ned Pettit
SITE CONTACT ADDR LINE1: PO Box 1730
SITE CONTACT ZIP: SEATTLE, WA 98111-1730
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)768-7612
SITE CONTACT EMAIL: npettit@glaciernw.com
FORM CONTACT NAME: Ned Pettit
FORM CONTACT ADDR LINE1: PO Box 1730
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98111-1730
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)768-7612
FORM CONTACT EMAIL: npettit@glaciernw.com
GEN STATUS CD: XQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

B9
SSE
< 1/8
159 ft.

**GLACIER NORTHWEST, INC.
5975 E MARGINAL WAY S
SEATTLE, WA 98134**

**LUST U003026267
UST N/A
NPDES**

Relative:
Lower

Site 2 of 6 in cluster B

Actual:
8 ft.

LUST:
FS ID: 95534411
Facility ID: 2211
Release ID: 1365
Alternate Name: LONE STAR (CONCRETE) NW
Release Notification Date: 6/1/1989 00:00:00
Release Status Date: 9/28/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.54853 / -122.33471

FS ID: 95534411
Facility ID: 2211

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

GLACIER NORTHWEST, INC. (Continued)

U003026267

Release ID: 1365
Alternate Name: LONE STAR (CONCRETE) NW
Release Notification Date: 6/1/1989 00:00:00
Release Status Date: 9/28/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Surface Water
Site Response Unit Code: NW
Lat/Long: 47.54853 / -122.33471

UST:

Facility ID: 95534411
Site ID: 2211
Status: Operational
Tank Name: 3
Install Date: 4/1/1990 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 7543
Compartment ID: 7676
Decimal Latitude: 47.54853
Decimal Longitude: -122.33471

Facility ID: 95534411
Site ID: 2211
Status: Operational
Tank Name: 4
Install Date: 4/1/1990 00:00:00
Capacity: 10,000 to 19,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 7399
Compartment ID: 7532
Decimal Latitude: 47.54853
Decimal Longitude: -122.33471

Facility ID: 95534411
Site ID: 2211
Status: Removed
Tank Name: 2
Install Date: 4/1/1990 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 7430
Compartment ID: 7563
Decimal Latitude: 47.54853
Decimal Longitude: -122.33471

Facility ID: 95534411
Site ID: 2211
Status: Removed
Tank Name: 1
Install Date: 8/1/1990 00:00:00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

GLACIER NORTHWEST, INC. (Continued)

U003026267

Capacity: Not reported
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 7480
Compartment ID: 7613
Decimal Latitude: 47.54853
Decimal Longitude: -122.33471

NPDES:

Facility ID: 5561
Facility Addr 2: Not reported
Facility Type: L
Region or Group ID: NW
Employee ID: DORT461
Facility Size: L - General Permits/Facilities Classified by EPA as Major or Minor, based on
faciliyt coplexity or size
Latitude Degrees: 47
Latitude Minutes: 32
Latitude Seconds: 56
Longitude Degrees: 122
Longitude Minutes: 20
Longitude Seconds: 3
Legislative District: 11
Basin Code: 41
Facility Description: S & G GENERAL PERMIT
Location Description: DISCHARGE TO DUWAMISH RIVER
Contact Name: NED PETTIT
Contact Phone Number: 2067687612
Permit ID: WAG503191C
Regulatory Program Code: WA - NPDES Federal Program
Type of General Permit: G50
Permit Number: 3191
Permit Issue Date: Not reported
Sequence of Permit Code: C
Permit Expiration Date: Not reported
Effective Permit Date: Not reported
Ecology Employee ID: DPEE461
Devl Empl ID: JKIL461
Permit Appliation Number: 52826.1
Permit Status Code: A - Active
Status Assigned Date: Not reported

B10 CHEVRON 90636
SSE 5940 E MARGINAL WAY S
< 1/8 SEATTLE, WA 98134
192 ft.

Relative: Site 3 of 6 in cluster B
Lower

Actual:
8 ft.

RCRA-SQG 1000434632
FINDS WAD982654006
WA MANIFEST

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

CHEVRON 90636 (Continued)

1000434632

RCRAInfo:
Owner: CHEVRON PRODUCTS CO
(925)842-5931
EPA ID: WAD982654006
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:


RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number:	1792892
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.)":	False
Utility boiler burner:	False
Industry boiler burner:	False
Industrial Furnace:	False
Smelter deferral:	False
Universal waste - batteries - generate:	False
Universal waste - thermostats - generate:	False
Universal waste - mercury - generate:	False
Universal waste - lamps - generate:	False
Universal waste - batteries - accumulate:	False
Universal waste - thermostats - accumulate:	False
Universal waste - mercury - accumulate:	False
Universal waste - lamps - accumulate:	False
Destination Facility for Universal Waste:	False
Off-specification used oil burner - utility boiler:	False
Off-specification used oil burner - industrial boiler:	False
Off-specification used oil burner - industrial furnace:	False
EPA ID:	WAD982654006
Facility Address 2:	Not reported
TAX REG NBR:	409018069
NAICS CD:	44711
BUSINESS TYPE:	Not reported
MAIL NAME:	Chevron Products Co

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

CHEVRON 90636 (Continued)

1000434632

MAIL ADDR LINE1: PO Box 6004
MAIL CITY,ST,ZIP: SAN RAMON, CA 94583-0804
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Chevron Products Co
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: PO Box 6004
LEGAL CITY,ST,ZIP: SAN RAMON, CA 94583
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (925)842-5931
LEGAL EFFECTIVE DATE: 08/09/96
LAND ORG NAME: Chevron Products Co
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: PO Box 6004
LAND CITY,ST,ZIP: SAN RAMON, CA 94583
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (925)842-5931
OPERATOR ORG NAME: APSI Chevron Inc
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5199 JOHNSON DR STE 110
OPERATOR CITY,ST,ZIP: PLEASANTON, CA 94588-3343
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (510)403-8373
OPERATOR EFFECTIVE DATE: 08/09/96
SITE CONTACT NAME: Sammy Ghantas
SITE CONTACT ADDR LINE1: 5940 E Marginal Way S
SITE CONTACT ZIP: SEATTLE, WA 98134
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)763-1567
SITE CONTACT EMAIL: Not reported
FORM CONTACT NAME: Kathy L Norris
FORM CONTACT ADDR LINE1: PO Box 6004
FORM CONTACT CITY,ST,ZIP: SAN RAMON, CA 94583
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (925)842-5931
FORM CONTACT EMAIL: knorris@chevrontexaco.com
GEN STATUS CD: MQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

B11 CHEVRON 90636
SSE 5940 E MARGINAL WAY
< 1/8 SEATTLE, WA 98134
192 ft.

LUST U003027225
UST N/A

Site 4 of 6 in cluster B

Relative:
Lower

LUST:

Actual:
8 ft.

FS ID: 1792892
Facility ID: 5061
Release ID: 393280
Alternate Name: CHEVRON 9-0636
Release Notification Date: 11/9/1993 00:00:00
Release Status Date: 11/9/1993 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.549309999999998 / -122.33444

FS ID: 1792892
Facility ID: 5061
Release ID: 393280
Alternate Name: CHEVRON 9-0636
Release Notification Date: 11/9/1993 00:00:00
Release Status Date: 11/9/1993 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.549309999999998 / -122.33444

UST:

Facility ID: 1792892
Site ID: 5061
Status: Removed
Tank Name: 4
Install Date: 2/20/1984 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 37000
Compartment ID: 37523
Decimal Latitude: 47.549309999999998
Decimal Longitude: -122.33444

Facility ID: 1792892
Site ID: 5061
Status: Operational
Tank Name: 1
Install Date: 1/1/1984 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 37091
Compartment ID: 37614
Decimal Latitude: 47.549309999999998
Decimal Longitude: -122.33444

Facility ID: 1792892

Map ID
Direction
Distance
Distance (ft.)
Elevation



CHEVRON 90636 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003027225

Site ID: 5061
Status: **Operational**
Tank Name: 2
Install Date: 1/1/1984 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 36924
Compartment ID: 37447
Decimal Latitude: 47.549309999999998
Decimal Longitude: -122.33444

Facility ID: 1792892
Site ID: 5061
Status: **Removed**
Tank Name: 5
Install Date: 2/20/1984 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 37074
Compartment ID: 37597
Decimal Latitude: 47.549309999999998
Decimal Longitude: -122.33444

Facility ID: 1792892
Site ID: 5061
Status: **Operational**
Tank Name: 3
Install Date: 1/1/1984 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 37060
Compartment ID: 37583
Decimal Latitude: 47.549309999999998
Decimal Longitude: -122.33444

B12 CHEVRON #0636
SSE 5940 E. MARGINAL WAY
< 1/8 SEATTLE, WA 98134
192 ft.

ICR S104488440
N/A

Site 5 of 6 in cluster B

Relative:
Lower

ICR:
Date Ecology Received Report: 08/16/1996
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-38
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Actual:
8 ft

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

B13 **NORTHWEST ENVIROSERVICE 2W**
SSE **1ST AV SW / MARGINAL**
< 1/8 **SEATTLE, WA 98108**
211 ft

CSCSL **S101703220**
 N/A

Site 6 of 6 in cluster B

Relative:
Lower

CSCSL:

Actual:
8 ft.

Facility ID: 2537
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.53569400
Longitude: -122.33583300
Lat/Long: 47.53569400 / -122.33583300
Lat/Long (dms): 47 32 8.5000 / 122 20 9.0000
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Suspected
Affected Media: 3757
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site

Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2537
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.53569400
Longitude: -122.33583300
Lat/Long: 47.53569400 / -122.33583300
Lat/Long (dms): 47 32 8.5000 / 122 20 9.0000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Suspected

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

NORTHWEST ENVIROSERVICE 2W (Continued)

S101703220

Affected Media: 3758
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received
Facility ID: 2537
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.53569400
Longitude: -122.33583300
Lat/Long: 47.53569400 / -122.33583300
Lat/Long (dms): 47 32 8.5000 / 122 20 9.0000
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Confirmed
Affected Media: 3759
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

NORTHWEST ENVIROSERVICE 2W (Continued)

S101703220

Base/Neutral/Acid Organics:	Not reported
Halogenated Organic Compounds:	C
EPA Priority Pollutants - Metals and Cyanide:	Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals:	Not reported
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Not reported
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tributyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Independent Remedial Action
Independent Site Status (independent cleanup):	Independent Site Assessment of Interim Remedial Action Report received

14
NNE
< 1/8
237 ft.

BANK & OFFICE INTERIORS
5990 1ST AVE S
SEATTLE, WA 98108

RCRA-SQG 1000878872
FINDS WAD988522074
WA MANIFEST

Relative:
Equal

RCRAInfo:

Owner: FBN ENTERPRISES INC
(425)820-8115

Actual:
9 ft.

EPA ID: WAD988522074

Contact: Not reported

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number:	63217123
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.)":	False
Utility boiler burner:	False
Industry boiler burner:	False
Industrial Furnace:	False

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s) EDR ID Number
EPA ID Number

BANK & OFFICE INTERIORS (Continued)

1000878872

Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD988522074
Facility Address 2: Not reported
TAX REG NBR: 601012810
NAICS CD: 423210
BUSINESS TYPE: Not reported
MAIL NAME: Bank & Office Interiors
MAIL ADDR LINE1: 5601 6TH AVE S
MAIL CITY,ST,ZIP: SEATTLE, WA 98108
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Workplace Development LLC
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 5990 1st Ave S
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108-3248
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)768-0205
LEGAL EFFECTIVE DATE: 03/01/00
LAND ORG NAME: Russak Investment Co
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 5601 6TH AVE S
LAND CITY,ST,ZIP: SEATTLE, WA 98108
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206)768-1587 2587
OPERATOR ORG NAME: FBN Enterprises Inc
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 11410 NE 124TH ST STE 142
OPERATOR CITY,ST,ZIP: KIRKLAND, WA 98034-4399
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (425)820-8115
OPERATOR EFFECTIVE DATE: 08/05/96
SITE CONTACT NAME: Gail Hopkins
SITE CONTACT ADDR LINE1: 5601 6TH AVE S
SITE CONTACT ZIP: SEATTLE, WA 98108
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)768-0254
SITE CONTACT EMAIL: ghopkins@bankandoffice.com
FORM CONTACT NAME: Gail Hopkins
FORM CONTACT ADDR LINE1: 5601 6TH AVE S
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)768-0254
FORM CONTACT EMAIL: ghopkins@bankandoffice.com
GEN STATUS CD: SQG
MONTHLY GENERATION: True

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BANK & OFFICE INTERIORS (Continued)

1000878872

BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

15
SSE
< 1/8
357 ft

CONSOLIDATED FREIGHTWAYS SEATTLE
6050 E MARGINAL WAY S
SEATTLE, WA 98108

RCRA-SQG 1000383968
CSCSL WAD041918897
FINDS
LUST
UST
VCP
ICR

Relative:
Lower

Actual:
8 ft

RCRAInfo:

Owner: CONSOLIDATED FREIGHTWAYS
(360)448-4000
EPA ID: WAD041918897
Contact: Not reported

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: 200(1)(c)(d)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/23/1996
Actual Date Achieved Compliance: 04/26/1996

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/23/1996
Penalty Type: Not reported

Regulation Violated: 220
Area of Violation: GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined: 04/23/1996
Actual Date Achieved Compliance: 05/18/1996

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/23/1996
Penalty Type: Not reported

There are 2 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19960426
	GENERATOR-RECORDKEEPING REQUIREMENTS	19960518

CSCSL:
Facility ID: 54757868

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONSOLIDATED FREIGHTWAYS SEATTLE (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000383968

warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.55111000
Longitude: -122.33682600
Lat/Long: 47.55111000 / -122.33682600
Lat/Long (dms): 47 33 3.9900 / 122 20 12.5700
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 6860
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 54757868
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.55111000
Longitude: -122.33682600
Lat/Long: 47.55111000 / -122.33682600
Lat/Long (dms): 47 33 3.9900 / 122 20 12.5700
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 6861
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CONSOLIDATED FREIGHTWAYS SEATTLE (Continued)

1000383968

Asbestos:	Not reported
Responsible Unit:	Northwest Region
Arsenic Code:	Not reported
MTBE Code:	Not reported
UXO Code:	Not reported
Dioxin:	Not reported
Non-Halogenated Solvents:	Suspected to be present
Base/Neutral/Acid Organics:	Not reported
Halogenated Organic Compounds:	Not reported
EPA Priority Pollutants - Metals and Cyanide:	Not reported
Metals - Other non-priority pollutant metals:	Not reported
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Suspected to be present
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tibutyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Independent Remedial Action
Independent Site Status (independent cleanup):	Independent Site Assessment of Interim Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and at Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include: Incident Tracking, Compliance Assistance, and Compliance Monitoring.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

LUST:

FS ID:	54757868
Facility ID:	11012
Release ID:	2626
Alternate Name:	CONSOLIDATED FREIGHTWAYS
Release Notification Date:	6/2/1988 00:00:00
Release Status Date:	6/1/1995 00:00:00
Facility Status:	Cleanup Started
Affected Media:	Soil
Site Response Unit Code:	NW
Lat/Long:	47.551110000000001 / -122.335826

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

CONSOLIDATED FREIGHTWAYS SEATTLE (Continued)

1000383968

FS ID: 54757868
Facility ID: 11012
Release ID: 2626
Alternate Name: CONSOLIDATED FREIGHTWAYS
Release Notification Date: 6/2/1988 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.551110000000001 / -122.336826

UST:

Facility ID: 54757868
Site ID: 11012
Status: Removed
Tank Name: D-2
Install Date: 1/1/1981 00:00:00
Capacity: 20,000 to 29,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 2361
Compartment ID: 2406
Decimal Latitude: 47.551110000000001
Decimal Longitude: -122.336826

Facility ID: 54757868
Site ID: 11012
Status: Removed
Tank Name: D-1
Install Date: 1/1/1981 00:00:00
Capacity: 20,000 to 29,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 2518
Compartment ID: 2564
Decimal Latitude: 47.551110000000001
Decimal Longitude: -122.336826

Facility ID: 54757868
Site ID: 11012
Status: Temporarily Closed
Tank Name: D-3
Install Date: 3/17/1998 00:00:00
Capacity: 10,000 to 19,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 455677
Compartment ID: 455725
Decimal Latitude: 47.551110000000001
Decimal Longitude: -122.336826

Facility ID: 54757868
Site ID: 11012
Status: Exempt

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

CONSOLIDATED FREIGHTWAYS SEATTLE (Continued)

1000383968

Tank Name: HO-1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 29761
Compartment ID: 30181
Decimal Latitude: 47.551110000000001
Decimal Longitude: -122.336826

VCP:

Facility ID: 54757868
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 54757868
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

ICR:

Date Ecology Received Report: 03/21/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-23
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 02/28/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-23
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 02/28/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-26
County Code: 17.00000
Contact: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONSOLIDATED FREIGHTWAYS SEATTLE (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000383968

Report Title: Not reported

Date Ecology Received Report: 10/02/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-09
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 05/12/1997
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-53
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

C16
North
< 1/8
499 ft.

BECKWITH KUFFEL INC
5930 1ST AVE S
SEATTLE, WA 98108

RCRA-SQG 1000838339
FINDS WAD988511127
UST

Relative:
Higher

Actual:
10 ft

Site 1 of 2 in cluster C

RCRAInfo:
Owner: BECKWITH KUFFEL INC
EPA ID: WAD988511127
Contact: LOUIS KUFFEL
(206) 767-6700

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

UST:

Facility ID: 96937296
Site ID: 9853
Status: Removed

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

BECKWITH KUFFEL INC (Continued)

1000838339

Tank Name: 2
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 42402
Compartment ID: 42998
Decimal Latitude: 47.549770000000002
Decimal Longitude: -122.335296

Facility ID: 96937296
Site ID: 9853
Status: Removed
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 42344
Compartment ID: 42940
Decimal Latitude: 47.549770000000002
Decimal Longitude: -122.335296

C17
North
< 1/8
614 ft.

OTT REAL ESTATE PROPERTY
5903 1ST AV S
SEATTLE, WA 98108

CSCSL NFA S104971725
N/A

Relative:
Higher

Site 2 of 2 in cluster C

Actual:
10 ft.

CSCSL NFA:
Facility/Site Id: 17634
Ecology Status: Independent Remedial Action
Program Plan Code: 3
Independent Status Code: Final Independent RA Report received
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 5/22/1996 00:00:00
Latitude: 47.55
Longitude: -122.334138

18
North
< 1/8
632 ft.

OLYMPIC MEDICAL CORP 1ST AVE S
5900 1ST AVE S
SEATTLE, WA 98108

RCRA-SQG 1000660042
FINDS WAD988497228
WA MANIFEST

Relative:
Higher

Actual:
10 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

OLYMPIC MEDICAL CORP 1ST AVE S (Continued)

1000660042

RCRAInfo:

Owner: OLYMPIC MEDICAL CORP
(206)767-3500

EPA ID: WAD988497228

Contact: Not reported

Classification: Conditionally Exempt Small Quantity Generator

TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: -606(4)
Area of Violation: GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined: 04/10/1992
Actual Date Achieved Compliance: 06/01/1992

Enforcement Action: VERBAL INFORMAL
Enforcement Action Date: 06/01/1992
Penalty Type: Not reported

There are 1 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>
Other Evaluation	GENERATOR-RECORDKEEPING REQUIREMENTS

<u>Date of Compliance</u>
19920601

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number:	57957617
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.):"	False
Utility boiler burner:	False
Industry boiler burner:	False
Industrial Furnace:	False
Smelter defferal:	False
Universal waste - batteries - generate:	False
Universal waste - thermostats - generate:	False
Universal waste - mercury - generate:	False
Universal waste - lamps - generate:	False
Universal waste - batteries - accumulate:	False
Universal waste - thermostats - accumulate:	False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

OLYMPIC MEDICAL CORP 1ST AVE S (Continued)

1000660042

Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD988497228
Facility Address 2: Not reported
TAX REG NBR: 578074770
NAICS CD: 339112
BUSINESS TYPE: Not reported
MAIL NAME: Olympic Medical Corp
MAIL ADDR LINE1: 5900 1st Ave S
MAIL CITY,ST,ZIP: SEATTLE, WA 98108-3248
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Olympic Medical Corp
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 5900 1st Ave S
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108-3248
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)767-3500
LEGAL EFFECTIVE DATE: 05/02/96
LAND ORG NAME: Michigan Properties
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 5301 2nd Ave S
LAND CITY,ST,ZIP: SEATTLE, WA 98108
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206)762-7474
OPERATOR ORG NAME: Not reported
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5900 1ST AVE S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206)767-3500
OPERATOR EFFECTIVE DATE: 05/15/97
SITE CONTACT NAME: Chuck Potts
SITE CONTACT ADDR LINE1: 5900 1ST AVE S
SITE CONTACT ZIP: SEATTLE, WA 98108
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: 206268-5125 5125
SITE CONTACT EMAIL: chuckpotts@olymed.com
FORM CONTACT NAME: Chuck Potts
FORM CONTACT ADDR LINE1: 5900 1ST AVE S
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: 206268-5125 5125
FORM CONTACT EMAIL: chuckpotts@olymed.com
GEN STATUS CD: SQG
MONTHLY GENERATION: False
BATCH GENERATION: True
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

OLYMPIC MEDICAL CORP 1ST AVE S (Continued)

1000660042

UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

D19 WESTERN BRIDGE CO
NE 5900 SECOND AVE SO
1/8-1/4 SEATTLE, WA 98108
776 ft.

UST U001126242
N/A

Site 1 of 2 in cluster D

Relative:
Higher

Actual:
10 ft.

UST:
Facility ID: 96851494
Site ID: 10209
Status: Removed
Tank Name: 1
Install Date: 6/27/1973 00:00:00
Capacity: 1,101 to 2,000 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 7650
Compartment ID: 7784
Decimal Latitude: 47.550579999999997
Decimal Longitude: -122.333636

Facility ID: 96851494
Site ID: 10209
Status: Removed
Tank Name: 2
Install Date: 7/24/1961 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 7620
Compartment ID: 7754
Decimal Latitude: 47.550579999999997
Decimal Longitude: -122.333636

Facility ID: 96851494
Site ID: 10209
Status: Removed
Tank Name: 3
Install Date: 7/24/1961 00:00:00
Capacity: 1,101 to 2,000 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 7677
Compartment ID: 7811
Decimal Latitude: 47.550579999999997
Decimal Longitude: -122.333636

Facility ID: 96851494

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

WESTERN BRIDGE CO (Continued)

U001126242

Site ID: 10209
Status: Exempt
Tank Name: 5
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 7638
Compartment ID: 7772
Decimal Latitude: 47.55057999999997
Decimal Longitude: -122.333636

Facility ID: 96851494
Site ID: 10209
Status: Removed
Tank Name: 4
Install Date: 6/30/1973 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 7576
Compartment ID: 7710
Decimal Latitude: 47.55057999999997
Decimal Longitude: -122.333636

D20
NE
1/8-1/4
803 ft.

MOBILE CRANE CO INC
5900 2ND AVE S
SEATTLE, WA 98108

Site 2 of 2 in cluster D

RCRA-SQG 1000659608
FINDS WAD988492823
CSCSL NFA
VCP
WA MANIFEST
ICR

Relative:
Higher

Actual:
10 ft.

RCRAInfo:
Owner: MOBILE CRANE CO INC
(206)767-4767
EPA ID: WAD988492823
Contact: Not reported
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

MOBILE CRANE CO INC (Continued)

1000659608

CSCSL NFA:

Facility/Site Id: 96851494
Ecology Status: Independent Remedial Action
Program Plan Code: 4
Independent Status Code: Final Independent RA Report received
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 5/10/2002 00:00:00
Latitude: 47.55058
Longitude: -122.333636

VCP:

Facility ID: 96851494
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: NFA after assessment, IRAP, or VCP
Program Plan: 4

WA MANIFEST:

Facility Site ID Number: 96851494
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD988492823
Facility Address 2: Not reported
TAX REG NBR: 601009502
NAICS CD: 532412
BUSINESS TYPE: Not reported
MAIL NAME: Mobile Crane Co Inc
MAIL ADDR LINE1: PO Box 3767
MAIL CITY,ST,ZIP: SEATTLE, WA 98124-3767
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Mobile Crane Co Inc
LEGAL ORG TYPE: Private

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MOBILE CRANE CO INC (Continued)

1000659608

LEGAL ADDR LINE1: 5900 2ND AVE S
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108-3203
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)767-4767
LEGAL EFFECTIVE DATE: 05/02/96
LAND ORG NAME: Wallace Enterprises
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: PO Box 3767
LAND CITY,ST,ZIP: SEATTLE, WA 98124-3767
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: 000-000-0000
OPERATOR ORG NAME: Not reported
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: PO Box 3767
OPERATOR CITY,ST,ZIP: Seattle, WA 98124-3767
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 206-767-4767
OPERATOR EFFECTIVE DATE: / /
SITE CONTACT NAME: Walter White
SITE CONTACT ADDR LINE1: PO Box 3767
SITE CONTACT ZIP: SEATTLE, WA 98124-3767
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)767-4767
SITE CONTACT EMAIL: Not reported
FORM CONTACT NAME: Walter White
FORM CONTACT ADDR LINE1: PO Box 3767
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98124-3767
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)767-4767
FORM CONTACT EMAIL: Not reported
GEN STATUS CD: SQG
MONTHLY GENERATION: False
BATCH GENERATION: True
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACLT: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ICR:

Date Ecology Received Report: 04/24/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 98-26
County Code: 17.00000

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

MOBILE CRANE CO INC (Continued)

1000659608

Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 04/11/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-15
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 12/05/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 98-31
County Code: 17.00000
Contact: Not reported
Report Title: Addendum 2 - Waste Oil UST (Site B)

E21
North
1/8-1/4
833 ft.

FRAY EQUIPMENT COMPANY INC
5821 1ST AVE SOUTH
SEATTLE, WA 98108

UST **1000439989**
N/A

Site 1 of 2 in cluster E

Relative:
Higher

Actual:
10 ft.

UST:
Facility ID: 62393528
Site ID: 3150
Status: Removed
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 30624
Compartment ID: 31060
Decimal Latitude: 47.550759999999997
Decimal Longitude: -122.33531600000001

Facility ID: 62393528
Site ID: 3150
Status: Closed in Place
Tank Name: 6
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Kerosene
Ecology Region: North Western
Tank ID: 30905
Compartment ID: 31350
Decimal Latitude: 47.550759999999997

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

FRAY EQUIPMENT COMPANY INC (Continued)

1000439989

Decimal Longitude: -122.33531600000001

Facility ID: 62393528
Site ID: 3150
Status: Removed
Tank Name: 2
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 30837
Compartment ID: 31280
Decimal Latitude: 47.550759999999997
Decimal Longitude: -122.33531600000001

Facility ID: 62393528
Site ID: 3150
Status: Removed
Tank Name: 5
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 30681
Compartment ID: 31119
Decimal Latitude: 47.550759999999997
Decimal Longitude: -122.33531600000001

Facility ID: 62393528
Site ID: 3150
Status: Closed in Place
Tank Name: 3
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 30769
Compartment ID: 31207
Decimal Latitude: 47.550759999999997
Decimal Longitude: -122.33531600000001

Facility ID: 62393528
Site ID: 3150
Status: Closed in Place
Tank Name: 4
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 30984
Compartment ID: 31431
Decimal Latitude: 47.550759999999997
Decimal Longitude: -122.33531600000001

Map ID
Direction
Distance
Distance (ft.)
Elevation



FRAY EQUIPMENT COMPANY INC (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000439989

Facility ID: 62393528
Site ID: 3150
Status: Removed
Tank Name: 7
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 30758
Compartment ID: 31196
Decimal Latitude: 47.550759999999997
Decimal Longitude: -122.33531600000001

E22
North
1/8-1/4
833 ft.

FRAY EQUIPMENT CO
5821 1ST AVE S
SEATTLE, WA 98108

RCRA-SQG 1001490250
FINDS WAD027430735

Site 2 of 2 in cluster E

Relative:
Higher

RCRAInfo:

Owner: JOHN FRAY JR
(206) 324-2915

Actual:
10 ft.

EPA ID: WAD027430735

Contact: Not reported

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

F23
NNW
1/8-1/4
966 ft.

BALL INCON
5801 E. MARGINAL WAY S.
SEATTLE, WA 98134

ICR S104486065
N/A

Site 1 of 3 in cluster F

Relative:
Equal

ICR:

Date Ecology Received Report: / /
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report

Actual:
9 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BALL INCON (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104486065

Site Register Issue: 91-23
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

F24 INCON PACKAGING
NNW 5801 E MARGINAL WAY S
1/8-1/4 SEATTLE, WA 98134
966 ft.

LUST U003027329
UST N/A

Site 2 of 3 in cluster F

Relative:
Equal

Actual:
9 ft.

LUST:
FS ID: 94925241
Facility ID: 5333
Release ID: 1644
Alternate Name: BALL INCON
Release Notification Date: 12/15/1989 00:00:00
Release Status Date: 12/15/1989 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.55166599999997 / -122.335274

FS ID: 94925241
Facility ID: 5333
Release ID: 1644
Alternate Name: BALL INCON
Release Notification Date: 12/15/1989 00:00:00
Release Status Date: 12/15/1989 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.55166599999997 / -122.335274

FS ID: 94925241
Facility ID: 5333
Release ID: 1644
Alternate Name: BALL INCON
Release Notification Date: 12/15/1989 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.55166599999997 / -122.335274

FS ID: 94925241
Facility ID: 5333
Release ID: 1644
Alternate Name: BALL INCON
Release Notification Date: 12/15/1989 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.55166599999997 / -122.335274

UST:

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

INCON PACKAGING (Continued)

U003027329

Facility ID: 94925241
Site ID: 5333
Status: Closed in Place
Tank Name: 4
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 39987
Compartment ID: 40547
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

Facility ID: 94925241
Site ID: 5333
Status: Removed
Tank Name: 6
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 40051
Compartment ID: 40613
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

Facility ID: 94925241
Site ID: 5333
Status: Removed
Tank Name: 3
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 39904
Compartment ID: 40462
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

Facility ID: 94925241
Site ID: 5333
Status: Closed in Place
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 39952
Compartment ID: 40512
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

Facility ID: 94925241

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

INCON PACKAGING (Continued)

U003027329

Site ID: 5333
Status: **Removed**
Tank Name: 7
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 39922
Compartment ID: 40480
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

Facility ID: 94925241
Site ID: 5333
Status: **Closed in Place**
Tank Name: 5
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 39980
Compartment ID: 40540
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

Facility ID: 94925241
Site ID: 5333
Status: **Removed**
Tank Name: 2
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 40035
Compartment ID: 40597
Decimal Latitude: 47.551665999999997
Decimal Longitude: -122.335274

F25 SAINT GOBAIN CONTAINERS LLC
NNW 5801 EAST MARGINAL WAY SOUTH
1/8-1/4 SEATTLE, WA 98134
966 ft.

Relative:
Equal

Actual:
9 ft.

Site 3 of 3 in cluster F

RCRA-SQG 1000411057
FINDS 98134BLLNC58
TRIS
WA MANIFEST
EMI

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s)
EDR ID Number
EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

RCRAInfo:

Owner: BALL INCON GLASS PACKAGING CORP
EPA ID: WAD044589935

Contact: Not reported

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: -515(6)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 03/19/2003
Actual Date Achieved Compliance: 08/22/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/15/2003
Penalty Type: Not reported

Regulation Violated: -170(1)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 03/19/2003
Actual Date Achieved Compliance: 09/17/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/15/2003
Penalty Type: Not reported

Regulation Violated: -515(6)(a)(i)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 03/19/2003
Actual Date Achieved Compliance: 08/22/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/15/2003
Penalty Type: Not reported

Regulation Violated: -141(1)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 03/19/2003
Actual Date Achieved Compliance: 07/30/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/15/2003
Penalty Type: Not reported

Regulation Violated: -330(3) / -200(1)(e)
Area of Violation: GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined: 03/19/2003
Actual Date Achieved Compliance: 09/22/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/15/2003
Penalty Type: Not reported

There are 5 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20030822
	GENERATOR-GENERAL REQUIREMENTS	20030917
	GENERATOR-GENERAL REQUIREMENTS	20030822
	GENERATOR-GENERAL REQUIREMENTS	20030730

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

GENERATOR-RECORDKEEPING REQUIREMENTS

20030922

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include: Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number:	94925241
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.):"	False

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter defferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD044589935
Facility Address 2: Not reported
TAX REG NBR: 601656793
NAICS CD: 327213
BUSINESS TYPE: Glass Container Manufactu
MAIL NAME: Saint Gobain Containers LLC
MAIL ADDR LINE1: 5801 E Marginal Way S
MAIL CITY,ST,ZIP: SEATTLE, WA 98134-2413
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Saint Gobain Containers LLC
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: PO Box 4200
LEGAL ADDR LINE2: 1509 S Macedonia Ave
LEGAL CITY,ST,ZIP: MUNCIE, IN 47302-3664
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: 765-741-7112
LEGAL EFFECTIVE DATE: 09/15/95
LAND ORG NAME: Saint Gobain Containers LLC
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: PO Box 4200
LAND CITY,ST,ZIP: MUNCIE, IN 47302-3664
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: 765-741-7112
OPERATOR ORG NAME: Saint Gobain Containers
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5801 E MARGINAL WAY S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98134-2413
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 206-762-0600 6275
OPERATOR EFFECTIVE DATE: 09/15/95
SITE CONTACT NAME: David Grega
SITE CONTACT ADDR LINE1: 5801 E MARGINAL WAY S
SITE CONTACT ZIP: SEATTLE, WA 98134-2413
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: 206-762-0660 6275
SITE CONTACT EMAIL: david.L.Grega@saint.gobain.com
FORM CONTACT NAME: Jayne Browning
FORM CONTACT ADDR LINE1: PO Box 4200
FORM CONTACT CITY,ST,ZIP: Muncie, IN 47307-4200
FORM CONTACT COUNTRY: UNITED STATES

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

FORM CONTACT PHONE NBR: 765-741-7112
FORM CONTACT EMAIL: Jayne.E.Browning@saint.gobain.com
GEN STATUS CD: MQG
MONTHLY GENERATION: False
BATCH GENERATION: True
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

EMI:

Facility ID: 0004
Ecology Fac ID: Not reported
Local ID: C
County Code: 033
Facility type: Not reported
Local Air Agency ID: Not reported
Fed County Code: Not reported
Source Number: Not reported
Process ID: Not reported
Year Of Info: Not reported
Contact Name: Not reported
Contact Phone: Not reported
Contact Fax: Not reported
Contact E-mail: Not reported
Mailing Name: BALL-INCON GLASS PACKAGING CORP
Mailing Address: 5801 EAST MARGINAL WAY WOUTH
Mailing City,St,Zip: SEATTLE, 53 98134
Tot Suspended Particulate Emissions Estmn Code: Not reported
PM10 Nonattainment Area: 61.2535
% Control Of Sulfur Dioxide Emissions: 114.7625
NO2 Chemical: 409.1445
% Cntrl Of Volatile Organic Compound Emissions: 0.0000
CO Nonattainment Area: 0.0000
Univsl Business ID: Not reported
Boilers Design Capacity At A Point: Not reported
% Of Ops Occuring During Qtr Dec-Feb: Not reported
% Of Ops Occuring During Qtr Mar-May: Not reported
% Of Ops Occuring During Qtr Jun-Aug: Not reported
% Of Ops Occuring During Qtr Sep-Nov: Not reported
Of Hours Facility Operates Each Day: Not reported
Of Days Facility Operates Each Week: Not reported
Of Weeks Facility Operates Each Year: Not reported
Exit Temp Of A Stack Or Vent: Not reported
% Wtr In Stack / Vent Exhaust: Not reported
Height Of Stack: Not reported
Diameter Of Stack: Not reported
Air Flow From A Vent Or Stack: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site



Database(s) EDR ID Number
 EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

% Oxygen In Stack / Vent Exhaust:	Not reported
Vertical Dist Exhaust Travels From Stack/vent Outlet:	Not reported
SCC Process Desc:	Not reported
EPA Code For Throughput Unit Of Measure:	Not reported
EPA Mat Code For Throughput At Each Process:	Not reported
EPA Code For Mat Throput Fate Desc/input/output/existing:	Not reported
Description Of Material:	Not reported
Annual Qty Of Throughput Mat:	Not reported
Maximum Rate/amount Of Annual Throughput:	Not reported
% Of Sulfur In Fuels:	Not reported
% Of Ash In Fuels:	Not reported
Emission Unit Output Threshold:	Not reported
Facility's Throughput Data Confidential:	Not reported
Tot Suspended Partclt Emissn Tons/Year:	Not reported
Tot Suspended Partclte Emissions Estmn Code:	Not reported
Pri Particulate Matter Cntrl Tech Code At Point/Segment:	Not reported
Sec Particulate Matter Cntrl Tech Code At Point/segment:	Not reported
% Control Of Particulate Matter Emissions:	Not reported
Particulate Matter Emission (?10microns) Tons/Year:	Not reported
Partclte Matter Emission (?10microns) Est Code:	Not reported
Pri Prtclte Matter (?10microns) Cntrl Tech Code At Pt/Seg:	Not reported
Sec Prtclte Matter (?10microns) Cntl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Prtclte Matter (? 10microns) Emisns:	Not reported
Prtclte Matter (?2.5microns)emisns In Tons/Yr:	Not reported
Prtclte Matter Emisn (?2.5microns) Est Code:	Not reported
Pri Ptcuate Matter (?2.5microns) Ctl Tech Code At Pt/Seg:	Not reported
Sec Prtclte Matter (?2.5microns) Ctl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Particulate Matter (?2.5microns) Emissions:	Not reported
Sulfur Dioxide Emissions Tons/Year:	Not reported
Sulfur Dioxide Emission Estimation Code:	Not reported
Pri Sulfur Dioxide Cntrl Tech Code At Pt/Seg:	Not reported
Secondary Sulfur Dioxide Cntrl Tech Code At Pt/Seg:	Not reported
% Control Of Sulfur Dioxide Emissions:	Not reported
Nitrous Oxides Emissions In Tons/Yr:	Not reported
Nitrous Oxides Emission Estimation Code:	Not reported
Pri Nitrous Oxides Cntrl Tech Code At Point/Segment:	Not reported
Sec Nitrous Oxide Control Tech Code At Point Segment:	Not reported
% Control Of Nitrous Oxides Emissions:	Not reported
Volatile Organic Compound Emitted Desc:	Not reported
Volatile Organic Compound Emissions In Tons/Year:	Not reported
Voltl Organic Compound Emissions Est Code:	Not reported
Pri Voltl Organic Compound Cntl Tech Code At Pt/seg:	Not reported
Sec Voltl Organic Compound Cntl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Volatile Organic Compound Emissions:	Not reported
Carbon Monoxide Emissions In Tons/Year:	Not reported
Carbon Monoxide Emission Est Code:	Not reported
Pri Carbon Monoxide Cntrl Tech Code At Pt/Seg:	Not reported
Sec Carbon Monoxide Cntrl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Carbon Monoxide Emissions:	Not reported
Lead Emissions In Tons/Year:	Not reported
Lead Emission Estimation Code:	Not reported
PM10 Nonattainment Area:	Not reported
Ozone Nonattainment Area:	Not reported
CO Nonattainment Area:	Not reported
UTM East:	Not reported
UTM North:	Not reported
UTM Zone:	Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

P NH3 Control:	Not reported
NH3 tpy:	Not reported
S NH3 ctrl:	Not reported
NH3 % ctrl:	Not reported
STK ACFS:	Not reported
Plant Name:	Not reported
Plant SIC Code:	Not reported
Plant NAICS:	Not reported
Plant Lat/Long:	Not reported
Plant Lat/Long (dms):	Not reported
Plant UTM East:	Not reported
Plant UTM North:	Not reported
Plant UTM Zone:	Not reported
Point Process SIC:	Not reported
Point Num:	Not reported
Point NAICS:	Not reported
Lat/Long:	Not reported
Lat/Long (dms):	Not reported
Point UTM East:	Not reported
Point UTM North:	Not reported
Point UTM Zone:	Not reported
Point Desc:	Not reported
Point Comments:	Not reported
SCC Process Desc:	Not reported
Facility ID:	0004
Ecolgy Fac ID:	Not reported
Local ID:	C
County Code:	033
Facility type:	Not reported
Local Air Agency ID:	Not reported
Fed County Code:	Not reported
Source Number:	Not reported
Process ID:	Not reported
Year Of Info:	96
Contact Name:	Not reported
Contact Phone:	Not reported
Contact Fax:	Not reported
Contact E-mail:	Not reported
Mailing Name:	BALL-INCON GLASS PACKAGING CORP
Mailing Address:	5801 EAST MARGINAL WAY WOUTH
Mailing City,St,Zip:	SEATTLE, 53 98134 2497
Tot Suspended Partic Emissions Estmn Code:	Not reported
PM10 Nonattainment Area:	64
% Control Of Sulfur Dioxide Emissions:	119
NO2 Chemical:	407
% Cntrl Of Volatile Organic Compound Emissions:	0
CO Nonattainment Area:	0
Univsl Business ID:	Not reported
Boilers Design Capacity At A Point:	Not reported
% Of Ops Occuring During Qtr Dec-Feb:	Not reported
% Of Ops Occuring During Qtr Mar-May:	Not reported
% Of Ops Occuring During Qtr Jun-Aug:	Not reported
% Of Ops Occuring During Qtr Sep-Nov:	Not reported
# Of Hours Facility Operates Each Day:	Not reported
# Of Days Facility Operates Each Week:	Not reported
# Of Weeks Facility Operates Each Year:	Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site



Database(s) EDR ID Number
 EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

Exit Temp Of A Stack Or Vent:	Not reported
% Wtr In Stack / Vent Exhaust:	Not reported
Height Of Stack:	Not reported
Diameter Of Stack:	Not reported
Air Flow From A Vent Or Stack:	Not reported
% Oxygen In Stack / Vent Exhaust:	Not reported
Vertical Dist Exhaust Travels From Stack/vent Outlet:	Not reported
SCC Process Desc:	Not reported
EPA Code For Throughput Unit Of Measure:	Not reported
EPA Mat Code For Throughput At Each Process:	Not reported
EPA Code For Mat Throput Fate Desc/input/output/existing:	Not reported
Description Of Material:	Not reported
Annual Qty Of Throughput Mat:	Not reported
Maximum Rate/amount Of Annual Throughput:	Not reported
% Of Sulfur In Fuels:	Not reported
% Of Ash In Fuels:	Not reported
Emission Unit Output Threshold:	Not reported
Facility's Throughput Data Confidential:	Not reported
Tot Suspended Partclt Emissn Tons/Year:	Not reported
Tot Suspended Partclte Emissions Estmn Code:	Not reported
Pri Particulate Matter Cntrl Tech Code At Point/Segment:	Not reported
Sec Particulate Matter Cntrl Tech Code At Point/segment:	Not reported
% Control Of Particulate Matter Emissions:	Not reported
Particulate Matter Emission (?10microns) Tons/Year:	Not reported
Partclte Matter Emission (?10microns) Est Code:	Not reported
Pri Prtclte Matter (?10microns) Cntrl Tech Code At Pt/Seg:	Not reported
Sec Prtclte Matter (?10microns) Cntl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Prtclte Matter (? 10microns) Emisns:	Not reported
Prtclte Matter (?2.5microns)emisns In Tons/Yr:	Not reported
Prtclte Matter Emisn (?2.5microns) Est Code:	Not reported
Pri Ptcuate Matter (?2.5microns) Ctl Tech Code At Pt/Seg:	Not reported
Sec Prtclte Matter (?2.5microns) Ctl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Particulate Matter (?2.5microns) Emissions:	Not reported
Sulfur Dioxide Emissions Tons/Year:	Not reported
Sulfur Dioxide Emission Estimation Code:	Not reported
Pri Sulfur Dioxide Cntrl Tech Code At Pt/Seg:	Not reported
Secondary Sulfur Dioxide Cntrl Tech Code At Pt/Seg:	Not reported
% Control Of Sulfur Dioxide Emissions:	Not reported
Nitrous Oxides Emissions In Tons/Yr:	Not reported
Nitrous Oxides Emission Estimation Code:	Not reported
Pri Nitrous Oxides Cntrl Tech Code At Point/Segment:	Not reported
Sec Nitrous Oxide Control Tech Code At Point Segment:	Not reported
% Control Of Nitrous Oxides Emissions:	Not reported
Volatile Organic Compound Emitted Desc:	Not reported
Volatile Organic Compound Emissions In Tons/Year:	Not reported
Voltl Organic Compound Emissions Est Code:	Not reported
Pri Voltl Organic Compound Cntl Tech Code At Pt/seg:	Not reported
Sec Voltle Organic Compound Cntl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Volatile Organic Compound Emissions:	Not reported
Carbon Monoxide Emissions In Tons/Year:	Not reported
Carbon Monoxide Emission Est Code:	Not reported
Pri Carbon Monoxide Cntrl Tech Code At Pt/Seg:	Not reported
Sec Carbon Monoxide Cntrl Tech Code At Pt/Seg:	Not reported
% Cntrl Of Carbon Monoxide Emissions:	Not reported
Lead Emissions In Tons/Year:	Not reported
Lead Emission Estimation Code:	Not reported
PM10 Nonattainment Area:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

SAINT GOBAIN CONTAINERS LLC (Continued)

1000411057

Ozone Nonattainment Area:	Not reported
CO Nonattainment Area:	Not reported
UTM East:	Not reported
UTM North:	Not reported
UTM Zone:	Not reported
P NH3 Control:	Not reported
NH3 tpy:	Not reported
S NH3 ctrl:	Not reported
NH3 % ctrl:	Not reported
STK ACFS:	Not reported
Plant Name:	Not reported
Plant SIC Code:	Not reported
Plant NAICS:	Not reported
Plant Lat/Long:	Not reported
Plant Lat/Long (dms):	Not reported
Plant UTM East:	Not reported
Plant UTM North:	Not reported
Plant UTM Zone:	Not reported
Point Process SIC:	Not reported
Point Num:	Not reported
Point NAICS:	Not reported
Lat/Long:	Not reported
Lat/Long (dms):	Not reported
Point UTM East:	Not reported
Point UTM North:	Not reported
Point UTM Zone:	Not reported
Point Desc:	Not reported
Point Comments:	Not reported
SCC Process Desc:	Not reported

G26 FRANK'S USED CARS
SSE 6305 E. MARGINAL WAY S.
1/8-1/4 SEATTLE, WA 98108
1085 ft.

ICR S104486796
N/A

Site 1 of 2 In cluster G

Relative:
Higher

ICR:	
Date Ecology Received Report:	01/25/1993
Contaminants Found at Site:	Metals, Petroleum products
Media Contaminated:	Soil
Waste Management:	Not reported
Region:	North Western
Type of Report Ecology Received:	Interim cleanup report
Site Register Issue:	92-42
County Code:	17.00000
Contact:	Not reported
Report Title:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



G27 FRANKS USED CARS
SSE 6305 E MARGINAL WAY S
1/8-1/4 SEATTLE, WA 98108
1085 ft.

Database(s) EDR ID Number
EPA ID Number

CSCSL 1007080551
FINDS 110015572717

Site 2 of 2 in cluster G

Relative:
Higher

Actual:
15 ft.

CSCSL:

Facility ID: 2337
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.54516000
Longitude: -122.33105000
Lat/Long: 47.54516000 / -122.33105000
Lat/Long (dms): 47 32 42.5800 / 122 19 51.7800
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Confirmed
Affected Media: 3251
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Suspected to be present
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2337
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.54516000
Longitude: -122.33105000
Lat/Long: 47.54516000 / -122.33105000
Lat/Long (dms): 47 32 42.5800 / 122 19 51.7800
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 3252
Affected Media Status: C

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s)
EDR ID Number
EPA ID Number

FRANKS USED CARS (Continued)

1007080551

Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2337
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.54516000
Longitude: -122.33105000
Lat/Long: 47.54516000 / -122.33105000
Lat/Long (dms): 47 32 42.5800 / 122 19 51.7800
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Suspected
Affected Media: 3253
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site

Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)
EDR ID Number
EPA ID Number

FRANKS USED CARS (Continued)

1007080551

EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Suspected to be present
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2337
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.54516000
Longitude: -122.33105000
Lat/Long: 47.54516000 / -122.33105000
Lat/Long (dms): 47 32 42.5800 / 122 19 51.7800
Media ID: 3
Media Type Desc: Air
Media Status Desc: Suspected
Affected Media: 3254
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2337
warm_bin_n: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

FRANKS USED CARS (Continued)

1007080551

Prog plan code: Not reported
Latitude: 47.54516000
Longitude: -122.33105000
Lat/Long: 47.54516000 / -122.33105000
Lat/Long (dms): 47 32 42.5800 / 122 19 51.7800
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Suspected
Affected Media: 3255
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

H28 AR TORRICO SONS SHIPPING IN
South 6335 1ST AVE S
1/8-1/4 SEATTLE, WA 98106
1095 ft.

Database(s) EDR ID Number
EPA ID Number

RCRA-SQG 1000134127
FINDS WAD980984207

Site 1 of 5 in cluster H

Relative:
Higher

RCRAInfo:

Actual:
20 ft.

Owner: AR TORRICO SONS SHIPPING IN
EPA ID: WAD980984207
Contact: KATHRYN MCPHERSON
(425) 771-2677

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

H29 BURGESS ENTERPRISES
South 6361 1ST AVE S
1/8-1/4 SEATTLE, WA 98108
1131 ft.

RCRA-SQG 1000697132
FINDS WAD988508305

Site 2 of 5 in cluster H

Relative:
Higher

RCRAInfo:

Actual:
20 ft.

Owner: BURGESS ENTERPRISES
EPA ID: WAD988508305
Contact: EDWARD WORTH
(206) 763-0255

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

H30 RAY BURGESS CO
South 6361 FIRST AVE S
1/8-1/4 SEATTLE, WA 98108
1131 ft.

UST U001128361
N/A

Site 3 of 5 in cluster H

Relative:
Higher

UST:

Actual:
20 ft.

Facility ID: 65697348
Site ID: 101434
Status: Closure in Process
Tank Name: 1-4000
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 23067
Compartment ID: 23388
Decimal Latitude: 47.54618
Decimal Longitude: -122.33423999999999

H31 DUWAMISH MARINE CENTER
South 6365 1ST AVE S
1/8-1/4 SEATTLE, WA 98108
1142 ft.

CSCSL S104971197
N/A

Site 4 of 5 in cluster H

Relative:
Higher

CSCSL:

Actual:
20 ft.

Facility ID: 21945598
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54504400
Longitude: -122.33581100
Lat/Long: 47.54504400 / -122.33581100
Lat/Long (dms): 47 32 42.1584 / 122 20 8.9196
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 8142
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Confirmed above MTCA cleanup levels
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

DUWAMISH MARINE CENTER (Continued)

S104971197

Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 21945598
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54504400
Longitude: -122.33581100
Lat/Long: 47.54504400 / -122.33581100
Lat/Long (dms): 47 32 42.1584 / 122 20 8.9196
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 8141
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Suspected to be present
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

H32 DUWAMISH MARINE CENTER
South 6365 1ST AVE S
1/8-1/4 SEATTLE, WA 98108
1142 ft.

FINDS 1007074367
VCP 110015510053

Site 5 of 5 in cluster H

Relative:
Higher

FINDS:

Other Pertinent Environmental Activity Identified at Site:

Actual:
20 ft.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

VCP:

Facility ID: 21945598
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 21945598
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

I33 AIR TEC COMPANY
North 5701 1ST AVE SOUTH
1/8-1/4 SEATTLE, WA 98108
1173 ft.

CSCSL U003029056
LUST N/A
UST
ICR

Site 1 of 2 in cluster I

Relative:
Higher

CSCSL:

Actual:
10 ft.

Facility ID: 57633623
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.55148800
Longitude: -122.33427400
Lat/Long: 47.55148800 / -122.33427400
Lat/Long (dms): 47 33 5.3600 / 122 20 3.3900
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 6920
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

AIR TEC COMPANY (Continued)

U003029056

Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 57633623
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.55148800
Longitude: -122.33427400
Lat/Long: 47.55148800 / -122.33427400
Lat/Long (dms): 47 33 5.3600 / 122 20 3.3900
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 6921
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

LUST:

FS ID: 57633623
Facility ID: 97435

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

AIR TEC COMPANY (Continued)

U003029056

Release ID: 532723
Alternate Name: AIR TEC COMPANY
Release Notification Date: 5/9/2000 00:00:00
Release Status Date: 4/4/2000 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.55148799999999 / -122.33427399999999

UST:

Facility ID: 57633623
Site ID: 97435
Status: Removed
Tank Name: 4
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 719
Compartment ID: 733
Decimal Latitude: 47.55148799999999
Decimal Longitude: -122.33427399999999

Facility ID: 57633623
Site ID: 97435
Status: Removed
Tank Name: 3
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 863
Compartment ID: 880
Decimal Latitude: 47.55148799999999
Decimal Longitude: -122.33427399999999

Facility ID: 57633623
Site ID: 97435
Status: Removed
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 802
Compartment ID: 818
Decimal Latitude: 47.55148799999999
Decimal Longitude: -122.33427399999999

Facility ID: 57633623
Site ID: 97435
Status: Removed
Tank Name: 2
Install Date: 12/31/1964 00:00:00

Map ID
Direction
Distance
Distance (ft.)
Elevation



AIR TEC COMPANY (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003029056

Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 769
Compartment ID: 783
Decimal Latitude: 47.55148799999999
Decimal Longitude: -122.33427399999999

ICR:

Date Ecology Received Report: 05/09/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Not reported
Site Register Issue: 98-26
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

I34
North
1/8-1/4
1173 ft.

AIR TEC CO PARCEL C
5701 1ST AVE S
SEATTLE, WA 98108

FINDS 1007068405
VCP 110015450046

Relative:
Higher

Site 2 of 2 in cluster I

Actual:
10 ft.

FINDS:


Other Pertinent Environmental Activity Identified at Site:
WA-DOEFIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

VCP:

Facility ID: 57633623
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 57633623
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

35
NE
1/8-1/4
1216 ft.

CAPITAL INDUSTRIES INC
5801 3RD AVE S
SEATTLE, WA 98108

FINDS
RCRA-LQG
FTTS
WA MANIFEST

1000264308
WAD009245465

Relative:
Higher

Actual:
11 ft.

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

RCRAInfo:

Owner: KEN GRIMM

(206) 762-8585

EPA ID: WAD009245465

Contact: Not reported

Classification: Large Quantity Generator

TSDF Activities: Not reported

BIENNIAL REPORTS:

Last Biennial Reporting Year: 2003

Waste	Quantity (Lbs)
D001	9608.01
F005	16205.01

Waste	Quantity (Lbs)
F003	16205.01

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

CAPITAL INDUSTRIES INC (Continued)

1000264308

Violation Status: Violations exist

Regulation Violated: 170(1)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 02/13/1998
Actual Date Achieved Compliance: 08/31/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1998
Penalty Type: Not reported

Regulation Violated: 630(5)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 02/13/1998
Actual Date Achieved Compliance: 03/20/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1998
Penalty Type: Not reported

Regulation Violated: 200(1)(c)(d)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 02/13/1998
Actual Date Achieved Compliance: 03/20/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1998
Penalty Type: Not reported

Regulation Violated: 201(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 02/13/1998
Actual Date Achieved Compliance: 03/20/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1998
Penalty Type: Not reported

Regulation Violated: 200(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 02/13/1998
Actual Date Achieved Compliance: 03/20/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1998
Penalty Type: Not reported

Regulation Violated: 630(6)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 02/13/1998
Actual Date Achieved Compliance: 03/27/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1998
Penalty Type: Not reported

There are 6 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19980831
	GENERATOR-GENERAL REQUIREMENTS	19980320
	GENERATOR-GENERAL REQUIREMENTS	19980320
	GENERATOR-GENERAL REQUIREMENTS	19980320

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CAPITAL INDUSTRIES INC (Continued)

1000264308

GENERATOR-GENERAL REQUIREMENTS
GENERATOR-GENERAL REQUIREMENTS

19980320
19980327

FTTS:

Case Number: Not reported
Docket Number: 1091-06-22-325
Complaint Issued: 07/23/1991
Complaint Closed: / /
Abatement Amount: 0.0000
Proposed Penalty: 117000.0000
Final Assessment: 45500.0000
Final Order Date: 10/09/1991
Close Date: / /
Violation: EPCRA, Nonreporting/Failure to RPT to EPA

FTTS Insp:

Region: 10
Inspected Date: Not reported
Insp Number: 19910124AX001 1
Violation occurred: Yes
Inspector: DAVIS
Investigation Type: EPCRA, Enforcement, Federal Conducted
Facility Function: Manufacturer
Investig Reason: Not reported
Legislation Code: EPCRA

WA MANIFEST:

Facility Site ID Number: 11598755
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD009245465
Facility Address 2: Not reported
TAX REG NBR: 578009230
NAICS CD: 332439
BUSINESS TYPE: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

CAPITAL INDUSTRIES INC (Continued)

1000264308

MAIL NAME: Capital Industries Inc
MAIL ADDR LINE1: 5801 3RD AVE S
MAIL CITY,ST,ZIP: SEATTLE, WA 98108-3205
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Capital Industries Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: PO Box 80983
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108-0983
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)762-8585
LEGAL EFFECTIVE DATE: 03/06/01
LAND ORG NAME: Capital Industries Inc
LAND ORG TYPE: Private
LAND PERSON NAME: Ronald Taylor
LAND ADDR LINE1: PO Box 80983
LAND CITY,ST,ZIP: SEATTLE, WA 98108-0983
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206)762-8585
OPERATOR ORG NAME: Not reported
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5801 3RD AVE S
OPERATOR ADDR LINE2: PO Box 80983
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108-3205
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 206762-8585
OPERATOR EFFECTIVE DATE: 04/04/85
SITE CONTACT NAME: Ray Carr
SITE CONTACT ADDR LINE1: 5801 3RD AVE S
SITE CONTACT ZIP: SEATTLE, WA 98108-3205
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: 206762-8585
SITE CONTACT EMAIL: rcarr@capitalind.com
FORM CONTACT NAME: Ray Carr
FORM CONTACT ADDR LINE1: 5801 3RD AVE S
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108-3205
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: 206762-8585
FORM CONTACT EMAIL: rcarr@capitalind.com
GEN STATUS CD: LQG
MONTHLY GENERATION: True
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: True
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

J36 SAHLBERG EQUIPMENT
ENE 5950 4TH AVE S
1/8-1/4 SEATTLE, WA 98108
1271 ft.

RCRA-SQG 1001490702
CSCSL WAD988490496
FINDS
ICR

Site 1 of 2 in cluster J

Relative:
Higher

RCRAInfo:

Owner: US BANK TRUST
(206) 344-4571

Actual:
11 ft.

EPA ID: WAD988490496

Contact: ROBERT SAHLBERG
(253) 859-8200

Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

CSCSL:

Facility ID: 2450
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55367000
Longitude: -122.32336000
Lat/Long: 47.55367000 / -122.32336000
Lat/Long (dms): 47 33 13.2100 / 122 19 24.1000

Media ID: 4

Media Type Desc: Soil

Media Status Desc: Remediated

Affected Media: 3599

Affected Media Status: R (Remediated) - Contaminants have been treated, removed, or contained to meet cleanup levels established for the site. (This status determination may only be made by Ecology)

Pesticides: Not reported

Petroleum Products: Treated, removed, or contained

Phenolic Compounds: Not reported

Reactive Wastes: Not reported

Corrosive Wastes: Not reported

Radioactive Wastes: Not reported

Asbestos: Not reported

Responsible Unit: Northwest Region

Arsenic Code: Not reported

MTBE Code: Not reported

UXO Code: Not reported

Dioxin: Not reported

Non-Halogenated Solvents: Not reported

Base/Neutral/Acid Organics: Not reported

Halogenated Organic Compounds: Not reported

EPA Priority Pollutants - Metals and Cyanide: Not reported

Metals - Other non-priority pollutant metals: Not reported

Polychlorinated biPhenyls (PCBs): Not reported

Polynuclear Aromatic Hydrocarbons (PAH): Not reported

Conventional Contaminants, Organic: Not reported

Conventional Contaminants, Inorganic: Not reported

Tibutyl Tin Contaminant Group: Not reported

Bioassay/Benthic Failures Contaminant Group: Not reported

Wood Debris Contaminant Group: Not reported

Other Deleterious Substance Group: Not reported

Ecology Site Status (MTCA cleanup process): Independent Remedial Action

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

SAHLBERG EQUIPMENT (Continued)

1001490702

Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2450
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55367000
Longitude: -122.32336000
Lat/Long: 47.55367000 / -122.32336000
Lat/Long (dms): 47 33 13.2100 / 122 19 24.1000
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Suspected
Affected Media: 3600
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 2450
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55367000
Longitude: -122.32336000
Lat/Long: 47.55367000 / -122.32336000
Lat/Long (dms): 47 33 13.2100 / 122 19 24.1000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 3601
Affected Media Status: C
Pesticides: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

SAHLBERG EQUIPMENT (Continued)

1001490702

Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

ICR:

Date Ecology Received Report: 07/21/1993
Contaminants Found at Site: Total petroleum hydrocarbons, Halogenated Solvents
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 93-07
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 07/21/1993
Contaminants Found at Site: Total petroleum hydrocarbons, Polynuclear aromatic hydrocarbons, Chlorinated solvents
Media Contaminated: Groundwater, Soil
Waste Management: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



SAHLBERG EQUIPMENT (Continued)

EDR ID Number
EPA ID Number

Database(s)

1001490702

Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 93-18
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 04/01/1993
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Not reported
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 93-04
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

37
ESE
1/8-1/4
1288 ft.

Relative:
Higher

Actual:
11 ft.

GEORGETOWN GASCO
6185 4TH AVE S
SEATTLE, WA 98108

UST U001127921
N/A

UST:

Facility ID: 55698119
Site ID: 100530
Status: **Operational**
Tank Name: 2-SUPER UNLE
Install Date: 1/1/1984 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 300365
Compartment ID: 36823
Decimal Latitude: 47.547449999999998
Decimal Longitude: -122.330636

Facility ID: 55698119
Site ID: 100530
Status: **Operational**
Tank Name: 4 WASTE OIL
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 23567
Compartment ID: 23896
Decimal Latitude: 47.547449999999998
Decimal Longitude: -122.330636

Facility ID: 55698119
Site ID: 100530
Status: **Operational**
Tank Name: 1-UNLEADED
Install Date: 12/31/1964 00:00:00
Capacity: 5,000 to 9,999 Gallons

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

GEORGETOWN GASCO (Continued)

U001127921

Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 26773
Compartment ID: 27136
Decimal Latitude: 47.547449999999998
Decimal Longitude: -122.330636

Facility ID: 55698119
Site ID: 100530
Status: **Operational**
Tank Name: 3-REGULAR
Install Date: 12/31/1964 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 27208
Compartment ID: 27577
Decimal Latitude: 47.547449999999998
Decimal Longitude: -122.330636

J38
ENE
1/8-1/4
1288 ft.

ALEUTIAN CONSTRUCTORS
5939 4TH AVE S
SEATTLE, WA 98108

RCRA-SQG 1000428719
FINDS WAD982654972

Site 2 of 2 in cluster J

Relative:
Higher

Actual:
11 ft.

RCRAInfo:
Owner: CHRISTENSON RABER KIEF & ASSOC INC
(206)762-4215
EPA ID: WAD982654972
Contact: Not reported

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: 170(1)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 08/17/1998
Actual Date Achieved Compliance: 09/04/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/17/1998
Penalty Type: Not reported

Regulation Violated: 170(3)(b)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 08/13/1998
Actual Date Achieved Compliance: 09/04/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/17/1998
Penalty Type: Not reported

Regulation Violated: 200(1)(c)(d)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 08/13/1998
Actual Date Achieved Compliance: 09/04/1998

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

ALEUTIAN CONSTRUCTORS (Continued)

1000428719

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/17/1998
Penalty Type: Not reported

Regulation Violated: 200(1)(b), 630(5)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 08/13/1998
Actual Date Achieved Compliance: 09/04/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/17/1998
Penalty Type: Not reported

Regulation Violated: 200(1)(b), 630(7)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 08/13/1998
Actual Date Achieved Compliance: 09/04/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/17/1998
Penalty Type: Not reported

There are 5 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19980904
	GENERATOR-GENERAL REQUIREMENTS	19980904
	GENERATOR-GENERAL REQUIREMENTS	19980904
	GENERATOR-GENERAL REQUIREMENTS	19980904
	GENERATOR-GENERAL REQUIREMENTS	19980904

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

39
NNE
1/8-1/4
1295 ft.

CONTINENTAL INDUSTRIES
222 S ORCAS
SEATTLE, WA 98108

RCRA-SQG 1000412949
FINDS WAD027421494

Relative:
Higher

RCRAInfo:
Owner: CONTINENTAL INDUSTRIES
EPA ID: WAD027421494

Actual:
11 ft.

Contact: Not reported

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

CONTINENTAL INDUSTRIES (Continued)

1000412949

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

K40 **BLASER DIE CASTING CO**
NE **5700 3RD AVE S**
1/4-1/2 **SEATTLE, WA 98108**
1434 ft.

CSCSL **S107565911**
N/A

Site 1 of 2 in cluster K

Relative:
Higher

Actual:
11 ft.

CSCSL:

Facility ID: 7118747
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47 55268100
Longitude: -122.33146900
Lat/Long: 47 55268100 / -122.33146900
Lat/Long (dms): 47 33 9.6516 / 122 19 53.2884
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Suspected
Affected Media: 11854
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 7118747
warm_bin_n: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BLASER DIE CASTING CO (Continued)

S107565911

Prog plan code: Not reported
Latitude: 47.55268100
Longitude: -122.33146900
Lat/Long: 47.55268100 / -122.33146900
Lat/Long (dms): 47 33 9.6516 / 122 19 53.2884
Media ID: 3
Media Type Desc: Air
Media Status Desc: Confirmed
Affected Media: 11853
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 7118747
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55268100
Longitude: -122.33146900
Lat/Long: 47.55268100 / -122.33146900
Lat/Long (dms): 47 33 9.6516 / 122 19 53.2884
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Below Cleanup Level
Affected Media: 11852
Affected Media Status: B (Below) - The presence of hazardous substances below MTCA cleanup levels has been confirmed by laboratory analysis (or field determination in the case of petroleum products) The B code may only be applied following completion of analytical work in conjunction with a Site Hazard Assessment (SHA) or Remedial Investigation/Feasibility Study (RI/FS)
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BLASER DIE CASTING CO (Continued)

S107565911

Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: B
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

K41 SCENIC BOUND TOURS
NE 300 SOUTH ORCAS STREET
1/4-1/2 SEATTLE, WA 98108
1434 ft.

US BROWNFIELDS 1008410567
N/A

Site 2 of 2 in cluster K

Relative: Higher
Actual: 11 ft.
US BROWNFIELDS:
Pilot Name: Seattle/King County, WA
EPA ID: Not reported
Latitude: Not reported
Longitude: Not reported
Assessment: Not reported

L42 WESTERN PARCEL EXPRESS SEATTLE
East 525 S FRONT ST
1/4-1/2 SEATTLE, WA 98108
1658 ft.

RCRA-SQG 1000110121
FINDS WAD988468518
CSCSL NFA
VCP
INST CONTROL
ICR

Site 1 of 2 in cluster L

Relative: Higher

Actual: 11 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN PARCEL EXPRESS SEATTLE (Continued)

1000110121

RCRAInfo:

Owner: WESTERN PARCEL EXPRESS INC
(253)796-2301
EPA ID: WAD988468518
Contact: CHRIS ROBERG
(206)762-2540

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CSCSL NFA:

Facility/Site Id: 39352815
Ecology Status: Independent Remedial Action
Program Plan Code: 4
Independent Status Code: Final Independent RA Report received
WARM Bin Number: Not reported
NFA Code: Restrictive Covenant, Institutional Controls
NFA Date: 2/5/2002 00:00:00
Latitude: 47.54787
Longitude: -122.32762

VCP:

Facility ID: 39352815
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Restrictive Covenant, Institutional Controls
Program Plan: 4

INST CONTROL:

Facility Site ID: 39352815
Nfa Code: Restrictive Covenant, Institutional Controls
NFA Desc: Restrictive Covenant, Institutional Controls
Nfa Date: 2/5/2002 00:00:00
Decision Document Id: 207
Document Type: VCP
IC Doc Type: VCP
Filing Num (county): 20020122002230
Filing Date: 1/17/2002 00:00:00
Inst Control Doc Id: 1
IC Document Type: Restrictive Covenant
Status Of IC Doc Type: Active

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

WESTERN PARCEL EXPRESS SEATTLE (Continued)

1000110121

IC Doc Status: Active
County Filing # For Individual IC Doc: 20020122002230
Filing Date Of Individual IC Doc: 1/17/2002 00:00:00
Status Date: 1/17/2002 00:00:00
IC Category Id: 427
IC Category: Ground Water Restriction
IC Category Desc: Ground Water Restriction
Comments: RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A.

Facility Site ID: 39352815
Nfa Code: Restrictive Covenant, Institutional Controls
NFA Desc: Restrictive Covenant, Institutional Controls
Nfa Date: 2/5/2002 00:00:00
Decision Document Id: 207
Document Type: VCP
IC Doc Type: VCP
Filing Num (county): 20020122002230
Filing Date: 1/17/2002 00:00:00
Inst Control Doc Id: 1
IC Document Type: Restrictive Covenant
Status Of IC Doc Type: Active
IC Doc Status: Active
County Filing # For Individual IC Doc: 20020122002230
Filing Date Of Individual IC Doc: 1/17/2002 00:00:00
Status Date: 1/17/2002 00:00:00
IC Category Id: 428
IC Category: Maintenance Requirements
IC Category Desc: Maintenance Requirements
Comments: RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A.

Facility Site ID: 39352815
Nfa Code: Restrictive Covenant, Institutional Controls
NFA Desc: Restrictive Covenant, Institutional Controls
Nfa Date: 2/5/2002 00:00:00
Decision Document Id: 207
Document Type: VCP
IC Doc Type: VCP
Filing Num (county): 20020122002230
Filing Date: 1/17/2002 00:00:00
Inst Control Doc Id: 1
IC Document Type: Restrictive Covenant
Status Of IC Doc Type: Active
IC Doc Status: Active
County Filing # For Individual IC Doc: 20020122002230
Filing Date Of Individual IC Doc: 1/17/2002 00:00:00

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

WESTERN PARCEL EXPRESS SEATTLE (Continued)

1000110121

Status Date: 1/17/2002 00:00:00
IC Category Id: 429
IC Category: Property Use Restriction
IC Category Desc: Property Use Restriction
Comments: RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A.

Facility Site ID: 39352815
Nfa Code: Restrictive Covenant, Institutional Controls
NFA Desc: Restrictive Covenant, Institutional Controls
Nfa Date: 2/5/2002 00:00:00
Decision Document Id: 207
Document Type: VCP
IC Doc Type: VCP
Filing Num (county): 20020122002230
Filing Date: 1/17/2002 00:00:00
Inst Control Doc Id: 1
IC Document Type: Restrictive Covenant
Status Of IC Doc Type: Active
IC Doc Status: Active
County Filing # For Individual IC Doc: 20020122002230
Filing Date Of Individual IC Doc: 1/17/2002 00:00:00
Status Date: 1/17/2002 00:00:00
IC Category Id: 430
IC Category: Soil Restriction
IC Category Desc: Soil Restriction
Comments: RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A. RC obtained by Bay West Seattle LLC. Residual concentrations of petroleum hydrocarbon remain in soil that exceed Method A.

ICR:

Date Ecology Received Report: 03/18/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-14
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



EDR ID Number
EPA ID Number
Database(s)

L43 AIR DATA EXPRESS, INC.
East 525 S FRONT ST
1/4-1/2 SEATTLE, WA 98108
1658 ft.

LUST U003029207
UST N/A

Site 2 of 2 in cluster L

Relative:
Higher

LUST:

Actual:
11 ft.

FS ID: 39352815
Facility ID: 97775
Release ID: 491225
Alternate Name: WESTERN PARCEL EXPRESS
Release Notification Date: 3/18/1999 00:00:00
Release Status Date: 3/18/1999 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.547870000000003 / -122.32762

FS ID: 39352815
Facility ID: 97775
Release ID: 491225
Alternate Name: WESTERN PARCEL EXPRESS
Release Notification Date: 3/18/1999 00:00:00
Release Status Date: 3/18/1999 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.547870000000003 / -122.32762

FS ID: 39352815
Facility ID: 97775
Release ID: 491225
Alternate Name: WESTERN PARCEL EXPRESS
Release Notification Date: 3/18/1999 00:00:00
Release Status Date: 3/31/1999 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.547870000000003 / -122.32762

FS ID: 39352815
Facility ID: 97775
Release ID: 491225
Alternate Name: WESTERN PARCEL EXPRESS
Release Notification Date: 3/18/1999 00:00:00
Release Status Date: 3/31/1999 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.547870000000003 / -122.32762

FS ID: 39352815
Facility ID: 97775
Release ID: 491225
Alternate Name: WESTERN PARCEL EXPRESS
Release Notification Date: 3/18/1999 00:00:00
Release Status Date: 8/7/2000 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Ground Water

Map ID
Direction
Distance
Distance (ft.)
Elevation



AIR DATA EXPRESS, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003029207

Site Response Unit Code: NW
Lat/Long: 47.547870000000003 / -122.32762

FS ID: 39352815
Facility ID: 97775
Release ID: 491225
Alternate Name: WESTERN PARCEL EXPRESS
Release Notification Date: 3/18/1999 00:00:00
Release Status Date: 8/7/2000 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.547870000000003 / -122.32762

UST:

Facility ID: 39352815
Site ID: 97775
Status: Removed
Tank Name: 1
Install Date: 5/13/1988 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 14500
Compartment ID: 14724
Decimal Latitude: 47.547870000000003
Decimal Longitude: -122.32762

Facility ID: 39352815
Site ID: 97775
Status: Removed
Tank Name: 2
Install Date: 5/13/1988 00:00:00
Capacity: 5,000 to 9,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 14200
Compartment ID: 14418
Decimal Latitude: 47.547870000000003
Decimal Longitude: -122.32762

44
North
1/4-1/2
1741 ft.

MASTER BUILDERS
64 S LUCILE ST
SEATTLE, WA 98134

CSCSL NFA S104971695
N/A

Relative:
Equal

Actual:
9 ft.

CSCSL NFA:
Facility/Site Id: 2254
Ecology Status: Awaiting Site Hazard Assessment
Program Plan Code: Not reported
Independent Status Code: Not reported
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 7/10/1998 00:00:00
Latitude: 47.55344

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

MASTER BUILDERS (Continued)

S104971695

Longitude: -122.33559

45
SSE
1/4-1/2
1862 ft.

BIG JOHNS TRUCK REPAIR INC
6533 3RD AVE S
SEATTLE, WA 98108

RCRA-SQG
CSCSL
FINDS
VCP

1004794574
WAD988519781

Relative:
Equal

RCRAInfo:

Owner: **BIG JOHNS TRUCK REPAIR INC**
(206)767-3939

Actual:
9 ft.

EPA ID: **WAD988519781**

Contact: Not reported

Classification: Conditionally Exempt Small Quantity Generator

TSDF Activities: Not reported

Violation Status: No violations found

CSCSL:

Facility ID: 44383713
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54423900
Longitude: -122.33105800
Lat/Long: 47.54423900 / -122.33105800
Lat/Long (dms): 47 32 39.2604 / 122 19 51.8088
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 7158
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Confirmed above MTCA cleanup levels

Base/Neutral/Acid Organics: Not reported

Halogenated Organic Compounds: Not reported

EPA Priority Pollutants - Metals and Cyanide: Not reported

Metals - Other non-priority pollutant metals: Not reported

Polychlorinated biPhenyls (PCBs): Not reported

Polynuclear Aromatic Hydrocarbons (PAH): Not reported

Conventional Contaminants, Organic: Not reported

Conventional Contaminants, Inorganic: Not reported

Tibutyl Tin Contaminant Group: Not reported

Bioassay/Benthic Failures Contaminant Group: Not reported

Wood Debris Contaminant Group: Not reported

Other Deleterious Substance Group: Not reported

Ecology Site Status (MTCA cleanup process): Independent Remedial Action

Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BIG JOHNS TRUCK REPAIR INC (Continued)

1004794574

Facility ID: 44383713
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54423900
Longitude: -122.33105800
Lat/Long: 47.54423900 / -122.33105800
Lat/Long (dms): 47 32 39.2604 / 122 19 51.8088
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 7159
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

VCP:

Facility ID: 44383713
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BIG JOHNS TRUCK REPAIR INC (Continued)

1004794574

NFA Code: Not reported
Program Plan: 4

Facility ID: 44383713
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

46 **DRIVE LINE SERVICES OF SEATTLE INC**
North **108 S BRANDON ST**
1/4-1/2 **SEATTLE, WA 98108**
1988 ft.

CSCSL NFA S104971609
N/A

Relative: **CSCSL NFA:**
Higher Facility/Site Id: 2521
Ecology Status: Independent Remedial Action
Actual: Program Plan Code: 3
10 ft. Independent Status Code: Final Independent RA Report received
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 11/29/1994 00:00:00
Latitude: 47.55437
Longitude: -122.3374

M47 **CARMODY PROPERTY - FORMER TR**
SSE **220 S. RIVER ST.**
1/4-1/2 **SEATTLE, WA 98108**
2003 ft.

ICR S104485564
N/A

Site 1 of 2 in cluster M
Relative: **ICR:**
Equal Date Ecology Received Report: 06/08/1999
Contaminants Found at Site: Petroleum products
Actual: Media Contaminated: Groundwater, Soil
9 ft. Waste Management: Not reported
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-16
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 05/18/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Not reported
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-16
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 10/31/1999
Contaminants Found at Site: Petroleum products

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

CARMODY PROPERTY - FORMER TR (Continued)

S104485564

Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-33
County Code: 17.00000
Contact: Not reported
Report Title: Phase II Subsurface Soil and Ground Water Investigation

Date Ecology Received Report: 10/25/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-33
County Code: 17.00000
Contact: Not reported
Report Title: Third Quarter Ground Water Sampling & Testing

Date Ecology Received Report: 05/13/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-33
County Code: 17.00000
Contact: Not reported
Report Title: Phase II Subsurface Exploration

Date Ecology Received Report: 12/23/1997
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-33
County Code: 17.00000
Contact: Not reported
Report Title: Phase I Enviro Audit & Limited Sampling

M48 WF CARMODY
SSE 220 S RIVER ST
1/4-1/2 SEATTLE, WA 98108
2003 ft.

LUST U001127382
UST N/A

Relative:
Equal

Actual:
9 ft.

Site 2 of 2 in cluster M

LUST:
FS ID: 37289288
Facility ID: 97212
Release ID: 499583
Alternate Name: CARMODY PROPERTY, FORMER TRUCK REPAIR FACILITY
Release Notification Date: 5/18/1999 00:00:00
Release Status Date: 10/26/1998 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

WF CARMODY (Continued)

U001127382

Lat/Long: 47.54368000000002 / -122.33143
FS ID: 37289288
Facility ID: 97212
Release ID: 499583
Alternate Name: CARMODY PROPERTY, FORMER TRUCK REPAIR FACILITY
Release Notification Date: 5/18/1999 00:00:00
Release Status Date: 10/26/1998 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.54368000000002 / -122.33143

UST:

Facility ID: 37289288
Site ID: 97212
Status: Closed In Place
Tank Name: 2
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 23701
Compartment ID: 24031
Decimal Latitude: 47.54368000000002
Decimal Longitude: -122.33143

Facility ID: 37289288
Site ID: 97212
Status: Closed In Place
Tank Name: 3
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 23447
Compartment ID: 23772
Decimal Latitude: 47.54368000000002
Decimal Longitude: -122.33143

Facility ID: 37289288
Site ID: 97212
Status: Closed in Place
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 23539
Compartment ID: 23865
Decimal Latitude: 47.54368000000002
Decimal Longitude: -122.33143

Map ID
Direction
Distance
Distance (ft.)
Elevation



N49
ESE
1/4-1/2
2048 ft.

EVERCLEAN INC DBA GAS N WASH
551 S MICHIGAN ST
SEATTLE, WA 98108

Database(s)	EDR ID Number EPA ID Number
RCRA-SQG FINDS CSCSL NFA VCP	1001491434 WA0000997585

Site 1 of 2 in cluster N

Relative:
Higher

Actual:
11 ft.

RCRAInfo:
Owner: EVERCLEAN INC
(206)442-9100
EPA ID: WA0000997585
Contact: Not reported
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CSCSL NFA:

Facility/Site Id: 64981477
Ecology Status: Independent Remedial Action
Program Plan Code: 4
Independent Status Code: Final Independent RA Report received
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 6/28/2004 00:00:00
Latitude: 47.54564
Longitude: -122.32785

VCP:

Facility ID: 64981477
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: NFA after assessment, IRAP, or VCP
Program Plan: 4

N50
ESE
1/4-1/2
2048 ft.

GAS N WASH
551 S. MICHIGAN ST.
SEATTLE, WA 98108

ICR S104485354
N/A

Site 2 of 2 in cluster N

Relative:
Higher

Actual:
11 ft.

ICR:
Date Ecology Received Report: 03/16/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

GAS N WASH (Continued)

S104485354

Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-25
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 12/13/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-25
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 09/21/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-25
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 07/13/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-27
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 06/13/1994
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 93-30
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 10/23/1995
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-15

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

GAS N WASH (Continued)

S104485354

County Code:	17.00000
Contact:	Not reported
Report Title:	Not reported
Date Ecology Received Report:	09/21/1998
Contaminants Found at Site:	Petroleum products
Media Contaminated:	Soil
Waste Management:	Tank
Region:	North Western
Type of Report Ecology Received:	Interim cleanup report
Site Register Issue:	98-13
County Code:	17.00000
Contact:	Not reported
Report Title:	Not reported
Date Ecology Received Report:	08/17/1999
Contaminants Found at Site:	Petroleum products
Media Contaminated:	Soil
Waste Management:	Tank
Region:	North Western
Type of Report Ecology Received:	Interim cleanup report
Site Register Issue:	98-18
County Code:	17.00000
Contact:	Not reported
Report Title:	Not reported
Date Ecology Received Report:	10/30/2000
Contaminants Found at Site:	Petroleum products
Media Contaminated:	Groundwater, Soil
Waste Management:	Tank
Region:	North Western
Type of Report Ecology Received:	Interim cleanup report
Site Register Issue:	98-32
County Code:	17 00000
Contact:	Not reported
Report Title:	Ground Water Monitoring - Third Quarter 2000
Date Ecology Received Report:	02/13/2001
Contaminants Found at Site:	Petroleum products
Media Contaminated:	Groundwater, Soil
Waste Management:	Tank
Region:	North Western
Type of Report Ecology Received:	Interim cleanup report
Site Register Issue:	98-34
County Code:	17.00000
Contact:	Not reported
Report Title:	Monitoring - January 2001

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

51
NNW
1/4-1/2
2076 ft
NATIONAL TRANSFER INC.
28 S. BRANDON ST.
SEATTLE, WA 98134

ICR
S104487141
N/A

Relative:
Equal
Actual:
9 ft
ICR:
Date Ecology Received Report: 10/04/1990
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 90-13
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

O62
NNE
1/4-1/2
2177 ft
ACE RADIATOR SHOP
311 SOUTH BRANDON
SEATTLE, WA 98108

US BROWNFIELDS
1008410606
N/A

Site 1 of 2 in cluster O

Relative:
Higher
Actual:
12 ft
US BROWNFIELDS:
Pilot Name: Seattle/King County, WA
EPA ID: Not reported
Latitude: Not reported
Longitude: Not reported
Assessment: Not reported

O53
NNE
1/4-1/2
2177 ft
ACE RADIATOR
311 S BRANDON ST
SEATTLE, WA 98108

RCRA-SQG
FINDS
SPILLS
CSCSL NFA
1000129406
WAD027405406

Site 2 of 2 in cluster O

Relative:
Higher
Actual:
12 ft
RCRAInfo:
Owner: ACE RADIATOR
EPA ID: WAD027405406
Contact: BONNIE COLES
(602) 726-5260
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

Map ID
Direction
Distance
Distance (ft.)
Elevation



ACE RADIATOR (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000129406

SPILLS:

Facility ID: 429791
Medium: UNKNOWN
Material Desc: CHEMICAL
Material Qty: Not reported
Material Units: Not reported
Date Received: 1998-07-10 00:00:00
Contact Name: Not reported
Company Name: UNKNOWN

CSCSL NFA:

Facility/Site Id: 59441643
Ecology Status: Awaiting Site Hazard Assessment
Program Plan Code: Not reported
Independent Status Code: Not reported
WARM Bin Number: Not reported
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 12/30/2002 00:00:00
Latitude: 47.55419
Longitude: -122.33061

P54
ESE
1/4-1/2
2243 ft.

TEXACO STATION #63-232-0400
600 S MICHIGAN
SEATTLE, WA 98108

LUST U003378497
UST N/A

Site 1 of 2 in cluster P

Relative:
Higher

LUST:


Actual:
12 ft.

FS ID: 19688471
Facility ID: 4487
Release ID: 309690
Alternate Name: TEXACO 63 232 1455
Release Notification Date: 3/23/1994 00:00:00
Release Status Date: 8/29/1995 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.546100000000003 / -122.327236

FS ID: 19688471
Facility ID: 4487
Release ID: 309690
Alternate Name: TEXACO 63 232 1455
Release Notification Date: 3/23/1994 00:00:00
Release Status Date: 3/28/1996 10:49:47.76
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.546100000000003 / -122.327236

FS ID: 19688471
Facility ID: 4487
Release ID: 309690
Alternate Name: TEXACO 63 232 1455
Release Notification Date: 3/23/1994 00:00:00
Release Status Date: 3/28/1996 10:49:47.76
Facility Status: Cleanup Started

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

TEXACO STATION #63-232-0400 (Continued)

U003378497

Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.546100000000003 / -122.327236

FS ID: 19688471
Facility ID: 4487
Release ID: 309690
Alternate Name: TEXACO 63 232 1455
Release Notification Date: 3/23/1994 00:00:00
Release Status Date: 1/20/2000 00:00:00
Facility Status: Monitoring
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.546100000000003 / -122.327236

FS ID: 19688471
Facility ID: 4487
Release ID: 309690
Alternate Name: TEXACO 63 232 1455
Release Notification Date: 3/23/1994 00:00:00
Release Status Date: 1/20/2000 00:00:00
Facility Status: Monitoring
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.546100000000003 / -122.327236

FS ID: 19688471
Facility ID: 4487
Release ID: 309690
Alternate Name: TEXACO 63 232 1455
Release Notification Date: 3/23/1994 00:00:00
Release Status Date: 8/29/1995 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.546100000000003 / -122.327236

UST:

Facility ID: 19688471
Site ID: 4487
Status: Exempt
Tank Name: 5-1,000
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 42919
Compartment ID: 43528
Decimal Latitude: 47.546100000000003
Decimal Longitude: -122.327236

Facility ID: 19688471
Site ID: 4487
Status: Operational
Tank Name: 4-10,000
Install Date: 1/1/1983 00:00:00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

TEXACO STATION #63-232-0400 (Continued)

U003378497

Capacity: 10,000 to 19,999 Gallons
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 23358
Compartment ID: 23682
Decimal Latitude: 47.546100000000003
Decimal Longitude: -122.327236

Facility ID: 19688471
Site ID: 4487
Status: Removed
Tank Name: 6-550
Install Date: 1/1/1986 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 5470
Compartment ID: 5572
Decimal Latitude: 47.546100000000003
Decimal Longitude: -122.327236

Facility ID: 19688471
Site ID: 4487
Status: Operational
Tank Name: 3-10,000
Install Date: 1/1/1986 00:00:00
Capacity: 10,000 to 19,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 21276
Compartment ID: 21585
Decimal Latitude: 47.546100000000003
Decimal Longitude: -122.327236

Facility ID: 19688471
Site ID: 4487
Status: Operational
Tank Name: 2-10,000
Install Date: 1/1/1986 00:00:00
Capacity: 10,000 to 19,999 Gallons
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 22353
Compartment ID: 22672
Decimal Latitude: 47.546100000000003
Decimal Longitude: -122.327236

Facility ID: 19688471
Site ID: 4487
Status: Operational
Tank Name: 1-10,000
Install Date: 1/1/1986 00:00:00
Capacity: 10,000 to 19,999 Gallons

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)
EDR ID Number
EPA ID Number

TEXACO STATION #63-232-0400 (Continued)

U003378497

Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 21780
Compartment ID: 22091
Decimal Latitude: 47.546100000000003
Decimal Longitude: -122.327236

P55 TEXACO 632321455
ESE 600 S MICHIGAN
1/4-1/2 SEATTLE, WA 98108
2243 ft.

RCRA-SQG 1000660718
FINDS WAD988504056
SPILLS
ICR

Relative:
Higher

Site 2 of 2 in cluster P

Actual:
12 ft.

RCRAInfo:
Owner: EQUILION ENTERPRISES LLC DBA SHELL OIL P
(425)827-0761
EPA ID: WAD988504056
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

SPILLS:

Facility ID: 525837
Medium: ROADWAY-PAVED
Material Desc: PETROLEUM - GASOLINE
Material Qty: 10
Material Units: GALLON
Date Received: 2002-04-13 00:00:00
Contact Name: Not reported
Company Name: TEXACO

ICR:

Date Ecology Received Report: 06/21/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-27
County Code: 17.00000
Contact: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

TEXACO 632321455 (Continued)

1000660718

Report Title: Not reported

Date Ecology Received Report: 01/17/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-27
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 03/18/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-02
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 08/20/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-07
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 05/04/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-07
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 10/13/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-08
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

TEXACO 632321455 (Continued)

1000660718

Date Ecology Received Report: 10/23/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-09
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 10/22/1998
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-09
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 05/06/1997
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 95-01
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 05/01/1997
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 95-01
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 08/12/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-17
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 12/26/2000
Contaminants Found at Site: Petroleum products

Map ID
Direction
Distance
Distance (ft.)
Elevation



TEXACO 632321455 (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000660718

Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-32
County Code: 17.00000
Contact: Not reported
Report Title: Monitoring - October 2000

Date Ecology Received Report: 08/03/2001
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-39
County Code: 17.00000
Contact: Not reported
Report Title: Sampling - April 2001

Date Ecology Received Report: 03/11/2002
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-46
County Code: 17.00000
Contact: Not reported
Report Title: Monitoring - October 2001

Q56 BOBS TEXACO SERVICE
North 5304 1ST AVE SO
1/4-1/2 SEATTLE, WA 98108
2249 ft.

LUST U000589546
UST N/A

Site 1 of 3 in cluster Q

Relative:
Higher

Actual:
10 ft.

LUST:
FS ID: 47157762
Facility ID: 4734
Release ID: 1959
Alternate Name: TEXACO STATION BOB'S
Release Notification Date: 2/13/1991 00:00:00
Release Status Date: 5/24/1995 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.554769999999998 / -122.335516

FS ID: 47157762
Facility ID: 4734
Release ID: 1959
Alternate Name: TEXACO STATION BOB'S
Release Notification Date: 2/13/1991 00:00:00
Release Status Date: 5/24/1995 00:00:00
Facility Status: Awaiting Cleanup
Affected Media: Ground Water
Site Response Unit Code: NW

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BOBS TEXACO SERVICE (Continued)

U000589546

Lat/Long: 47.554769999999998 / -122.335516

UST:

Facility ID: 47157762
Site ID: 4734
Status: **Removed**
Tank Name: #4
Install Date: 1/1/1941 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 9119
Compartment ID: 9274
Decimal Latitude: 47.554769999999998
Decimal Longitude: -122.335516

Facility ID: 47157762
Site ID: 4734
Status: **Removed**
Tank Name: #1
Install Date: 6/1/1966 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 9007
Compartment ID: 9161
Decimal Latitude: 47.554769999999998
Decimal Longitude: -122.335516

Facility ID: 47157762
Site ID: 4734
Status: **Removed**
Tank Name: #2
Install Date: 6/1/1962 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Diesel
Ecology Region: North Western
Tank ID: 9073
Compartment ID: 9228
Decimal Latitude: 47.554769999999998
Decimal Longitude: -122.335516

Facility ID: 47157762
Site ID: 4734
Status: **Removed**
Tank Name: #5
Install Date: 1/1/1900 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 343205
Compartment ID: 343206
Decimal Latitude: 47.554769999999998

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BOBS TEXACO SERVICE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000589546

Decimal Longitude: -122.335516

Facility ID: 47157762
Site ID: 4734
Status: Removed
Tank Name: #3
Install Date: 6/1/1959 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 9068
Compartment ID: 9223
Decimal Latitude: 47.554769999999998
Decimal Longitude: -122.335516

Q57 MCWILLIAMS PROPERTY/TEXACO
North 5304 1ST AVE. S.
1/4-1/2 SEATTLE, WA 98108
2249 ft.

ICR S104485416
N/A

Site 2 of 3 in cluster Q

Relative:
Higher

ICR:

Actual:
10 ft.

Date Ecology Received Report: 09/11/1996
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-40
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 09/11/1996
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Not reported
Site Register Issue: 98-13
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 07/12/1991
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-04
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

Q58
North
1/4-1/2
2255 ft.

TEXACO (TWO REPORTS)
5303 1ST AVE. S.
SEATTLE, WA 98108

ICR **S104487736**
N/A

Site 3 of 3 in cluster Q

Relative:
Higher

Actual:
10 ft.

ICR:
Date Ecology Received Report: 03/09/1992
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-21
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

59
ESE
1/4-1/2
2335 ft.

EMERALD TOOL INC
6332 6TH S
SEATTLE, WA 98108

RCRA-SQG **1000101621**
CSCSL **WAD042476788**
FINDS
CERC-NFRAP
BROWNFIELDS
WA MANIFEST

Relative:
Higher

Actual:
12 ft.

RCRAInfo:
Owner: EMERALD TOOL INC
(206)767-5670
EPA ID: WAD042476788
Contact: Not reported
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

CSCSL:

Facility ID: 2084
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54538000
Longitude: -122.32040000
Lat/Long: 47.54538000 / -122.32040000
Lat/Long (dms): 47 32 43.3700 / 122 19 13.4400
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Suspected
Affected Media: 2631
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Suspected to be present
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



EMERALD TOOL INC (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000101621

MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Suspected to be present
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2084
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54538000
Longitude: -122.32040000
Lat/Long: 47.54538000 / -122.32040000
Lat/Long (dms): 47 32 43.3700 / 122 19 13.4400
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2632
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Suspected to be present
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Suspected to be present
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

EMERALD TOOL INC (Continued)

1000101621

Independent Site Status (independent cleanup): Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CERC-NFRAP:

Site ID: 1000713
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP

CERCLIS Site Alias Name(s):

Alias Name: AND ALL ELECTRO CHROME, INC.
Alias Address: Not reported
WA
Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 05/12/1982
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: 09/24/1984
Date Completed: 09/26/1984
Priority Level: High

Action: SITE INSPECTION
Date Started: 01/15/1986
Date Completed: 03/31/1986
Priority Level: NFRAP (No Further Remedial Action Planned)

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 01/24/1994
Priority Level: Not reported

BROWNFIELDS:

Facility ID: 2084
Site Stat Code: 2

Facility ID: 2084
Site Stat Code: 2

WA MANIFEST:

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

EMERALD TOOL INC (Continued)

1000101621

Facility Site ID Number: 2084
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter defferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD042476788
Facility Address 2: Not reported
TAX REG NBR: 600443300
NAICS CD: 332213
BUSINESS TYPE: Not reported
MAIL NAME: Emerald Tool Inc
MAIL ADDR LINE1: PO Box 80312
MAIL CITY,ST,ZIP: SEATTLE, WA 98108-0312
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Emerald Tool Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 6332 6TH AVE S
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108-3436
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)767-5670
LEGAL EFFECTIVE DATE: 06/10/91
LAND ORG NAME: Not reported
LAND ORG TYPE: Private
LAND PERSON NAME: Blaine Anderson
LAND ADDR LINE1: 20245 SE 192ND ST
LAND CITY,ST,ZIP: RENTON, WA 98058-0271
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (360)432-9939
OPERATOR ORG NAME: Emerald Tool Inc
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 6332 6TH AVE S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108-3436
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206) 767-5670
OPERATOR EFFECTIVE DATE: 08/26/96
SITE CONTACT NAME: Dennis McGuire

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

EMERALD TOOL INC (Continued)

1000101621

SITE CONTACT ADDR LINE1: 6332 6TH AVE S
SITE CONTACT ZIP: SEATTLE, WA 98108-3436
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)767-5670
SITE CONTACT EMAIL: Not reported
FORM CONTACT NAME: Dennis McGuire
FORM CONTACT ADDR LINE1: 6332 6TH AVE S
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108-3436
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)767-5670
FORM CONTACT EMAIL: dennismcguire@hotmail.com
GEN STATUS CD: SQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHERS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

60
North
1/4-1/2
2377 ft.
NATIONAL TRANSFER INC
5265 UTAH AVE S
SEATTLE, WA 98134

LUST U001126269
UST N/A

Relative: LUST:
Higher FS ID: 73845797
Facility ID: 10267
Actual: Release ID: 1844
10 ft. Alternate Name: NATIONAL TRANSFER
Release Notification Date: 5/24/1990 00:00:00
Release Status Date: 5/24/1990 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.555370000000003 / -122.33534

FS ID: 73845797
Facility ID: 10267
Release ID: 1844
Alternate Name: NATIONAL TRANSFER
Release Notification Date: 5/24/1990 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.555370000000003 / -122.33534

UST:

Map ID
Direction
Distance
Distance (ft.)
Elevation



NATIONAL TRANSFER INC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001126269

Facility ID: 73845797
Site ID: 10267
Status: Removed
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 12758
Compartment ID: 12953
Decimal Latitude: 47.555370000000003
Decimal Longitude: -122.33534

61
ENE
1/4-1/2
2384 ft.
SEATTLE CITY LIGHT
7TH / FIDALGO
SEATTLE, WA 98108

ICR S105454418
N/A

Relative:
Higher

ICR:

Date Ecology Received Report: 10/31/1994
Contaminants Found at Site: PCB's
Media Contaminated: Not reported
Waste Management: Spill
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 93-41
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Actual:
14 ft.

62
NE
1/4-1/2
2390 ft.
U S BANK OF WASHINGTON
1137 S W HANFORD ST
SEATTLE, WA 98134

LUST U001778154
UST N/A

Relative:
Higher

LUST:

FS ID: 85392668
Facility ID: 102194
Release ID: 370240
Alternate Name: DONCO
Release Notification Date: 12/15/1989 00:00:00
Release Status Date: 1/25/1990 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.575470000000003 / -122.34972

Actual:
14 ft.

FS ID: 85392668
Facility ID: 102194
Release ID: 370240
Alternate Name: DONCO
Release Notification Date: 12/15/1989 00:00:00
Release Status Date: 12/15/1989 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

U S BANK OF WASHINGTON (Continued)

U001778154

Site Response Unit Code: NW
Lat/Long: 47.575470000000003 / -122.34972

UST:

Facility ID: 85392668
Site ID: 102194
Status: Removed
Tank Name: 2
Install Date: 1/1/1960 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 12535
Compartment ID: 12728
Decimal Latitude: 47.575470000000003
Decimal Longitude: -122.34972

Facility ID: 85392668
Site ID: 102194
Status: Removed
Tank Name: 1
Install Date: 1/1/1960 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 12639
Compartment ID: 12834
Decimal Latitude: 47.575470000000003
Decimal Longitude: -122.34972

63 PTL PARTNERSHIP/PENINSULA TRUCK LINES
ESE 6314 7TH S.
1/4-1/2 SEATTLE, WA 98108
2476 ft.

LUST U000585698
ICR N/A

Relative:
Higher

Actual:
13 ft.

LUST:

FS ID: 73263954
Facility ID: 25
Release ID: 1579
Alternate Name: PENINSULA TRUCK LINES
Release Notification Date: 8/29/1989 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.546239999999997 / -122.326266

FS ID: 73263954
Facility ID: 25
Release ID: 1579
Alternate Name: PENINSULA TRUCK LINES
Release Notification Date: 8/29/1989 00:00:00
Release Status Date: 7/23/2002 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PTL PARTNERSHIP/PENINSULA TRUCK LINES (Continued)

U000585698

Site Response Unit Code: NW
Lat/Long: 47.54623999999997 / -122.326266

ICR:

Date Ecology Received Report: 03/31/1993
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-49
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 12/29/1993
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 93-17
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 02/22/1995
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-05
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 01/23/1992
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-29
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 07/23/2002
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-50
County Code: 17.00000
Contact: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

PTL PARTNERSHIP/PENINSULA TRUCK LINES (Continued)

U000585698

Report Title: Environmental Conditions Summary
Date Ecology Received Report: 07/23/2002
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-50
County Code: 17.00000
Contact: Not reported
Report Title: Ground Water Investigation - June 1998

64
SE
1/4-1/2
2510 ft.

VIOX MCDOWELL SITE
551 S RIVER ST
SEATTLE, WA 98108

RCRA-SQG 1001490918
FINDS WAD988513164
CSCSL NFA
VCP

Relative:
Higher

RCRAInfo:
Owner: BURLINGTON ENVIRONMENTAL INC
EPA ID: WAD988513164

Actual:
10 ft.

Contact: PETER RESSLER
(425)227-7522

Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CSCSL NFA:

Facility/Site Id: 2260
Ecology Status: Independent Remedial Action
Program Plan Code: 4
Independent Status Code: Independent Site Assessment or Interim RA recvd
WARM Bin Number: 5
NFA Code: NFA after Assessment IRAP or VCP
NFA Date: 5/8/2002 00:00:00
Latitude: 47.54422
Longitude: -122.32723

VCP:

Facility ID: 2260
Ecology Status: Independent Remedial Action
WARM BIN #: 5
NFA Code: NFA after assessment, IRAP, or VCP

Map ID
Direction
Distance
Distance (ft.)
Elevation



VIOX MCDOWELL SITE (Continued)

Program Plan: 4

Database(s)
EDR ID Number
EPA ID Number

1001490918

R65
North
1/4-1/2
2568 ft.

DAWSON STREET LAND CO
56 S DAWSON ST
SEATTLE, WA 98134

RCRA-SQG 1001490976
FINDS WAD988520136
ICR

Relative:
Higher

Site 1 of 2 in cluster R

Actual:
10 ft.

RCRAInfo:
Owner: DAWSON STREET LAND CO
(206) 763-2700
EPA ID: WAD988520136
Contact: RICHARD RAMSEY
(206) 763-2700
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

ICR:

Date Ecology Received Report: 01/30/1992
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 92-39
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 10/13/1992
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-35
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

R66 DAWSON STREET LAND COMPANY
North 54 S DAWSON
1/4-1/2 SEATTLE, WA 98134
2581 ft.

LUST U003028137
UST N/A

Site 2 of 2 in cluster R.

Relative:
Higher

LUST:

Actual:
10 ft.

FS ID: 36716241
Facility ID: 7423
Release ID: 3568
Alternate Name: DAWSON STREET LAND CO
Release Notification Date: 6/15/1992 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.55585 / -122.33632

FS ID: 36716241
Facility ID: 7423
Release ID: 3568
Alternate Name: DAWSON STREET LAND CO
Release Notification Date: 6/15/1992 00:00:00
Release Status Date: 7/19/2000 00:00:00
Facility Status: Monitoring
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.55585 / -122.33632

UST:

Facility ID: 36716241
Site ID: 7423
Status: Removed
Tank Name: 6
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 14106
Compartment ID: 14324
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: Removed
Tank Name: 4
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 13972
Compartment ID: 14190
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

DAWSON STREET LAND COMPANY (Continued)

U003028137

Site ID: 7423
Status: **Removed**
Tank Name: 3
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 13766
Compartment ID: 13976
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: **Removed**
Tank Name: 2
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 14056
Compartment ID: 14274
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: **Closed in Place**
Tank Name: 10
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 26947
Compartment ID: 27313
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: **Removed**
Tank Name: 5
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 13933
Compartment ID: 14147
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

DAWSON STREET LAND COMPANY (Continued)

U003028137

Status: Closed in Place
Tank Name: 8
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 14014
Compartment ID: 14232
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: Closed in Place
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Used Oil/Waste Oil
Ecology Region: North Western
Tank ID: 13897
Compartment ID: 14109
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: Removed
Tank Name: 7
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Leaded Gasoline
Ecology Region: North Western
Tank ID: 13817
Compartment ID: 14028
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Facility ID: 36716241
Site ID: 7423
Status: Removed
Tank Name: 9
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 13874
Compartment ID: 14085
Decimal Latitude: 47.55585
Decimal Longitude: -122.33632

Map ID
Direction
Distance
Distance (ft.)
Elevation



67
NNE
1/4-1/2
2625 ft.

GENERAL ELECTRIC AVIATION DIV
220 S DAWSON ST
SEATTLE, WA 98108

Relative:
Higher

Database(s)
EDR ID Number
EPA ID Number

RCRA-SQG
CSCSL
FINDS
CORRACTS
INST CONTROL
ICR
US ENG CONTROLS

1000214141
WAD009278706

Actual:
12 ft.

RCRAInfo Corrective Action Summary:

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 09/07/2005

Event: Igration of Contaminated Groundwater under Control, Yes, Migration of Contaminated Groundwater Under Control has been verified. Based on a review of information contained in the EI determination, it has been determined that migration of contaminated groundwater is under control at the facility. Specifically, this determination indicates that the migration of contaminated groundwater is under control, and that monitoring will be conducted to confirm that contaminated groundwater remains within the existing area of contaminated groundwater. This determination will be re-evaluated when the Agency becomes aware of significant changes at the facility.
Event Date: 09/07/2005

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 08/05/2004

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 08/05/2004

Event: CA770GW
Event Date: 07/26/2004

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 08/27/2003

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 08/27/2003

Event: RFI Workplan Approved
Event Date: 11/13/2002

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 01/10/2002

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 01/10/2002

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 07/25/2001

Map ID
Direction
Distance
Distance (ft.)
Elevation



GENERAL ELECTRIC AVIATION DIV (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000214141

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 07/25/2001
Event: Stabilization Measures Evaluation, This facility is not amenable to stabilization activity because of a lack of technical data. An evaluation has been completed, but further data is necessary to determine stabilization measures, feasibility or appropriateness. This status should be changed when data becomes available.
Event Date: 09/14/2000
Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 06/29/2000
Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 06/29/2000
Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 02/03/1998
Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 02/03/1998
Event: Stabilization Measures Evaluation, This facility is not amenable to stabilization activity at the present time, because it appears to be technically infeasible or inappropriate.
Event Date: 01/16/1996
Event: RFA Completed
Event Date: 03/31/1995
Event: RFA Determination Of Need For An RFI, RFI is Necessary;
Event Date: 03/31/1995
Event: CA Prioritization, Facility or area was assigned a high corrective action priority.
Event Date: 03/28/1995
Event: RFA Determination Of Need For An RFI, RFI is Necessary;
Event Date: 02/07/1995
Event: RFI Imposition, Focused data collection required for stabilization evaluation.
Event Date: 07/20/1994

RCRAInfo.

Owner: GENERAL ELECTRIC SHARONVILLE
EPA ID: WAD009278706
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s)
EDR ID Number
EPA ID Number

GENERAL ELECTRIC AVIATION DIV (Continued)

1000214141

Violation Status: Violations exist

Regulation Violated: -390(2)(a-g)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -330(3)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -310(2a)(2c)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -340(4a)(4b)
Area of Violation: TSD-PREPAREDNESS/PREVENTION REQUIREMENTS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -360(1)
Area of Violation: TSD-CONTINGENCY PLAN REQUIREMENTS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -320(2)(b)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -395(1)(a)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



GENERAL ELECTRIC AVIATION DIV (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000214141

Regulation Violated: -300(5)(b)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -060(2)
Area of Violation: TSD-GENERAL STANDARDS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: -350(3e)(3f)
Area of Violation: TSD-CONTINGENCY PLAN REQUIREMENTS
Date Violation Determined: 12/06/1991
Actual Date Achieved Compliance: 05/12/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/08/1992
Penalty Type: Not reported

Regulation Violated: Not reported
Area of Violation: GENERATOR-OTHER REQUIREMENTS
Date Violation Determined: 12/12/1986
Actual Date Achieved Compliance: 02/28/1987

Regulation Violated: Not reported
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined: 12/12/1986
Actual Date Achieved Compliance: 07/04/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 03/02/1987
Penalty Type: Not reported

There are 12 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	TSD-GENERAL STANDARDS	19920512
	TSD-GENERAL STANDARDS	19920512
	TSD-GENERAL STANDARDS	19920512
	TSD-PREPAREDNESS/PREVENTION REQUIREMENTS	19920512
	TSD-CONTINGENCY PLAN REQUIREMENTS	19920512
	TSD-CONTINGENCY PLAN REQUIREMENTS	19920512
	TSD-GENERAL STANDARDS	19920512
	TSD-GENERAL STANDARDS	19920512
	TSD-GENERAL STANDARDS	19920512
	TSD-GENERAL STANDARDS	19920512
Compliance Evaluation Inspection	GENERATOR-OTHER REQUIREMENTS	19870228
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19940704

CSCSL:

Facility ID: 2522
warm_bin_n: 2
Prog plan code: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

GENERAL ELECTRIC AVIATION DIV (Continued)

1000214141

Latitude: 47.55315000
Longitude: -122.33096000
Lat/Long: 47.55315000 / -122.33096000
Lat/Long (dms): 47 33 11.3400 / 122 19 51.4600
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 3728
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Remedial Action in progress
Independent Site Status (independent cleanup): Not reported

Facility ID: 2522
warm_bin_n: 2
Prog plan code: 2
Latitude: 47.55315000
Longitude: -122.33096000
Lat/Long: 47.55315000 / -122.33096000
Lat/Long (dms): 47 33 11.3400 / 122 19 51.4600
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 3729
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

GENERAL ELECTRIC AVIATION DIV (Continued)

1000214141

Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Remedial Action in progress
Independent Site Status (independent cleanup): Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CORRACTS Data:

EPA Id: WAD009278706
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 01/10/2002
Corrective Action: CA750IN - Migration of Contaminated Groundwater under Control , More information is needed to make a determination
2002 NAICS Title: Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing

EPA Id: WAD009278706
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 01/10/2002
Corrective Action: CA725IN - Current Human Exposures Under Control , More information is needed to make a determination
2002 NAICS Title: Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing

Map ID
Direction
Distance
Distance (ft.)
Elevation



GENERAL ELECTRIC AVIATION DIV (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000214141

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing

EPA Id: WAD009278706
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 01/16/1996
Corrective Action: CA225NF - Stabilization Measures Evaluation, This facility, is not amenable to stabilization activity at the, present time, because it appears to be technically infeasible or, inappropriate
2002 NAICS Title: Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing

EPA Id: WAD009278706
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 02/03/1998
Corrective Action: CA750IN - Migration of Contaminated Groundwater under Control , More information is needed to make a determination
2002 NAICS Title: Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing

EPA Id: WAD009278706
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 02/03/1998
Corrective Action: CA725IN - Current Human Exposures Under Control , More information is needed to make a determination
2002 NAICS Title: Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical System and Instrument Manufacturing

Click this hyperlink while viewing on your computer to access
18 additional CORRACTS record(s) in the EDR Site Report.

INST CONTROL:

Facility Site ID: 2522
Nfa Code: Not reported
NFA Desc: Not reported
Nfa Date: Not reported
Decision Document Id: 370
Document Type: Agreed Order
IC Doc Type: Agreed Order
Filing Num (county): DE 02HWTRNR-4686
Filing Date: 11/13/2002 00:00:00
Inst Control Doc Id: Not reported
IC Document Type: Not reported
Status Of IC Doc Type: Not reported
IC Doc Status: Not reported
County Filing # For Individual IC Doc: Not reported
Filing Date Of Individual IC Doc: Not reported
Status Date: Not reported
IC Category Id: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



GENERAL ELECTRIC AVIATION DIV (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000214141

IC Category: Not reported
IC Category Desc: Not reported
Comments: Not reported

ICR:

Date Ecology Received Report: 11/02/1992
Contaminants Found at Site: Metals, Petroleum products, Chlorinated solvents
Media Contaminated: Groundwater, Soil
Waste Management: Not reported
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-36
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

US Engineering Control Sites:

EPA ID: WAD009278706
Site ID: Not reported
EPA Region: 10
County: KING
Event Code: CA770GW
Actual Date: 07/26/2004
Action ID: Not reported
Action Name: Not reported
Action Completion date: Not reported
Planned Completion date: Not reported
Operable Unit: Not reported
Contaminated Media: Not reported
Contam. Media num.: Not reported
Engineering Control: Not reported

S68 PNB BUILDING
ENE 707 S ORCAS ST
1/4-1/2 SEATTLE, WA 98108
2634 ft.

LUST S101150939
N/A

Site 1 of 2 in cluster S

Relative:
Higher

LUST:

Actual:
15 ft.

FS ID: 27585467
Facility ID: 200597
Release ID: 3034
Alternate Name: PNB BUILDING
Release Notification Date: 1/16/1992 00:00:00
Release Status Date: 1/16/1992 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.551029999999997 / -122.325596

FS ID: 27585467
Facility ID: 200597
Release ID: 3034
Alternate Name: PNB BUILDING
Release Notification Date: 1/16/1992 00:00:00
Release Status Date: 1/16/1992 00:00:00
Facility Status: Cleanup Started

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

PNB BUILDING (Continued)

S101150939

Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.55102999999997 / -122.325596

FS ID: 27585467
Facility ID: 200597
Release ID: 3034
Alternate Name: PNB BUILDING
Release Notification Date: 1/16/1992 00:00:00
Release Status Date: 5/21/1995 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.55102999999997 / -122.325596

FS ID: 27585467
Facility ID: 200597
Release ID: 3034
Alternate Name: PNB BUILDING
Release Notification Date: 1/16/1992 00:00:00
Release Status Date: 5/21/1995 00:00:00
Facility Status: Reported Cleaned Up
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.55102999999997 / -122.325596

S69
ENE
1/4-1/2
2634 ft.

PACIFIC NW GROUP A
707 ORCAS ST
AGATE SAY, WA 98108

UST U003665913
ICR N/A

Site 2 of 2 in cluster S

Relative:
Higher

Actual:
15 ft.

UST:
Facility ID: 9123895
Site ID: 510101
Status: Exempt
Tank Name: 3
Install Date: 1/1/1900 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Heating Fuel
Ecology Region: North Western
Tank ID: 510113
Compartment ID: 510114
Decimal Latitude: 48.755388000000004
Decimal Longitude: -122.35655300000001

Facility ID: 9123895
Site ID: 510101
Status: Unknown
Tank Name: 1
Install Date: 1/1/1900 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Unleaded Gasoline
Ecology Region: North Western
Tank ID: 510103
Compartment ID: 510104

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PACIFIC NW GROUP A (Continued)

U003665913

Decimal Latitude: 48.755388000000004
Decimal Longitude: -122.356553000000001

Facility ID: 9123895
Site ID: 510101
Status: Unknown
Tank Name: 2
Install Date: 1/1/1964 00:00:00
Capacity: Not reported
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 510108
Compartment ID: 510109
Decimal Latitude: 48.755388000000004
Decimal Longitude: -122.356553000000001

ICR:

Date Ecology Received Report: 01/16/1992
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 92-19
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

70
West
1/2-1
2724 ft.

M & T CHEMICALS INC
6000 W MARGINAL SW
SEATTLE, WA 98106

CSCSL S103083942
N/A

Relative:
Higher

CSCSL:

Actual:
18 ft.

Facility ID: 2177
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54968300
Longitude: -122.34168300
Lat/Long: 47.54968300 / -122.34168300
Lat/Long (dms): 47 32 58.8588 / 122 20 30.0588
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Suspected
Affected Media: 2800
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Suspected to be present
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

M & T CHEMICALS INC (Continued)

S103083942

Arsenic Code:	Not reported	
MTBE Code:	Not reported	
UXO Code:	Not reported	
Dioxin:	Not reported	
Non-Halogenated Solvents:		Not reported
Base/Neutral/Acid Organics:		Not reported
Halogenated Organic Compounds:		Not reported
EPA Priority Pollutants - Metals and Cyanide:		Suspected to be present
Metals - Other non-priority pollutant metals:		Suspected to be present
Polychlorinated biPhenyls (PCBs):		Not reported
Polynuclear Aromatic Hydrocarbons (PAH):		Not reported
Conventional Contaminants, Organic:		Not reported
Conventional Contaminants, Inorganic:		Not reported
Tibutyl Tin Contaminant Group:		Not reported
Bioassay/Benthic Failures Contaminant Group:		Not reported
Wood Debris Contaminant Group:		Not reported
Other Deleterious Substance Group:		Not reported
Ecology Site Status (MTCA cleanup process):		Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup):		Not reported
Facility ID:	2177	
warm_bin_n:	5	
Prog plan code:	Not reported	
Latitude:	47.54968300	
Longitude:	-122.34168300	
Lat/Long:	47.54968300 / -122.34168300	
Lat/Long (dms):	47 32 58.8588 / 122 20 30.0588	
Media ID:	4	
Media Type Desc:	Soil	
Media Status Desc:	Suspected	
Affected Media:	2801	
Affected Media Status:	S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site	
Pesticides:	Not reported	
Petroleum Products:	Not reported	
Phenolic Compounds:	Not reported	
Reactive Wastes:	Not reported	
Corrosive Wastes:	Suspected to be present	
Radioactive Wastes:	Not reported	
Asbestos:	Not reported	
Responsible Unit:	Northwest Region	
Arsenic Code:	Not reported	
MTBE Code:	Not reported	
UXO Code:	Not reported	
Dioxin:	Not reported	
Non-Halogenated Solvents:		Not reported
Base/Neutral/Acid Organics:		Not reported
Halogenated Organic Compounds:		Not reported
EPA Priority Pollutants - Metals and Cyanide:		Suspected to be present
Metals - Other non-priority pollutant metals:		Suspected to be present
Polychlorinated biPhenyls (PCBs):		Not reported
Polynuclear Aromatic Hydrocarbons (PAH):		Not reported
Conventional Contaminants, Organic:		Not reported
Conventional Contaminants, Inorganic:		Not reported
Tibutyl Tin Contaminant Group:		Not reported
Bioassay/Benthic Failures Contaminant Group:		Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

M & T CHEMICALS INC (Continued)

S103083942

Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2177
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.54968300
Longitude: -122.34168300
Lat/Long: 47.54968300 / -122.34168300
Lat/Long (dms): 47 32 58.8588 / 122 20 30.0588
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Suspected
Affected Media: 2802
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site

Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Suspected to be present
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Suspected to be present
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

71
West
1/2-1
2810 ft.

GLACIER NORTHWEST SEATTLE TERMINAL
5900 W MARGINAL WAY S
SEATTLE, WA 98106

CSCSL 1005726683
N/A

Relative:
Higher

CSCSL:
Facility ID: 23881883
warm_bin_n: 1
Prog plan code: Not reported
Latitude: 47.54938300
Longitude: -122.34438300

Actual:
17 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

GLACIER NORTHWEST SEATTLE TERMINAL (Continued)

1005726683

Lat/Long: 47.54938300 / -122.34438300
Lat/Long (dms): 47 32 57.7788 / 122 20 39.7788
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2787
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 23881883
warm_bin_n: 1
Prog plan code: Not reported
Latitude: 47.54938300
Longitude: -122.34438300
Lat/Long: 47.54938300 / -122.34438300
Lat/Long (dms): 47 32 57.7788 / 122 20 39.7788
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Confirmed
Affected Media: 2788
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

GLACIER NORTHWEST SEATTLE TERMINAL (Continued)

1005726683

UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 23881883
warm_bin_n: 1
Prog plan code: Not reported
Latitude: 47.54938300
Longitude: -122.34438300
Lat/Long: 47.54938300 / -122.34438300
Lat/Long (dms): 47 32 57.7788 / 122 20 39.7788
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2789
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



GLACIER NORTHWEST SEATTLE TERMINAL (Continued)

EDR ID Number
EPA ID Number

Database(s)

1005726683

Facility ID: 23881883
warm_bin_n: 1
Prog plan code: Not reported
Latitude: 47.54938300
Longitude: -122.34438300
Lat/Long: 47.54938300 / -122.34438300
Lat/Long (dms): 47 32 57.7788 / 122 20 39.7788
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Confirmed
Affected Media: 2790
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Suspected to be present
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

72 DUWAMISH SHIPYARD INC
WNW 5658 W MARGINAL WY SW
1/2-1 SEATTLE, WA 98106
3131 ft.

Relative:
Higher

Actual:
17 ft.

RCRA-SQG 1000149827
CSCSL WAD009244997
FINDS
WA MANIFEST
ICR

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

DUWAMISH SHIPYARD INC (Continued)

1000149827

RCRAInfo:

Owner: DUWAMISH SHIPYARD INC

(206)767-4880

EPA ID: WAD009244997

Contact: Not reported

Classification: Conditionally Exempt Small Quantity Generator

TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: 200(1)(b)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/26/1994
Actual Date Achieved Compliance: 07/22/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/19/1994
Penalty Type: Not reported

Regulation Violated: 070(3)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/26/1994
Actual Date Achieved Compliance: 07/27/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/19/1994
Penalty Type: Not reported

Regulation Violated: 201(2)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/26/1994
Actual Date Achieved Compliance: 08/10/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/19/1994
Penalty Type: Not reported

Regulation Violated: 200(1)(c)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/26/1994
Actual Date Achieved Compliance: 07/22/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/19/1994
Penalty Type: Not reported

Regulation Violated: 200(1)(d)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/26/1994
Actual Date Achieved Compliance: 07/22/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/19/1994
Penalty Type: Not reported

Regulation Violated: 060(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/26/1994
Actual Date Achieved Compliance: 08/03/1994

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/19/1994

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

DUWAMISH SHIPYARD INC (Continued)

1000149827

Penalty Type: Not reported

There are 6 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19940722
	GENERATOR-GENERAL REQUIREMENTS	19940727
	GENERATOR-GENERAL REQUIREMENTS	19940810
	GENERATOR-GENERAL REQUIREMENTS	19940722
	GENERATOR-GENERAL REQUIREMENTS	19940722
	GENERATOR-GENERAL REQUIREMENTS	19940803

CSCSL:

Facility ID: 2071
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55156600
Longitude: -122.34236600
Lat/Long: 47.55156600 / -122.34236600
Lat/Long (dms): 47 33 5.6376 / 122 20 32.5176
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Confirmed
Affected Media: 11568
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2071
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55156600

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUWAMISH SHIPYARD INC (Continued)

1000149827

Longitude: -122.34236600
Lat/Long: 47.55156600 / -122.34236600
Lat/Long (dms): 47 33 5.6376 / 122 20 32.5176
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Suspected
Affected Media: 2593
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2071
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55156600
Longitude: -122.34236600
Lat/Long: 47.55156600 / -122.34236600
Lat/Long (dms): 47 33 5.6376 / 122 20 32.5176
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2594
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site




Database(s) EDR ID Number
EPA ID Number

DUWAMISH SHIPYARD INC (Continued)

1000149827

Responsible Unit:	Northwest Region
Arsenic Code:	Not reported
MTBE Code:	Not reported
UXO Code:	Not reported
Dioxin:	Not reported
Non-Halogenated Solvents:	Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics:	Confirmed above MTCA cleanup levels
Halogenated Organic Compounds:	Not reported
EPA Priority Pollutants - Metals and Cyanide:	Treated, removed, or contained
Metals - Other non-priority pollutant metals:	Not reported
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tibutyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup):	Not reported
Facility ID:	2071
warm_bin_n:	Not reported
Prog plan code:	Not reported
Latitude:	47.55156600
Longitude:	-122.34236600
Lat/Long:	47.55156600 / -122.34236600
Lat/Long (dms):	47 33 5.6376 / 122 20 32.5176
Media ID:	5
Media Type Desc:	Sediment
Media Status Desc:	Suspected
Affected Media:	2595
Affected Media Status:	S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides:	Suspected to be present
Petroleum Products:	Suspected to be present
Phenolic Compounds:	Not reported
Reactive Wastes:	Not reported
Corrosive Wastes:	Not reported
Radioactive Wastes:	Not reported
Asbestos:	Not reported
Responsible Unit:	Northwest Region
Arsenic Code:	Not reported
MTBE Code:	Not reported
UXO Code:	Not reported
Dioxin:	Not reported
Non-Halogenated Solvents:	Suspected to be present
Base/Neutral/Acid Organics:	Suspected to be present
Halogenated Organic Compounds:	S
EPA Priority Pollutants - Metals and Cyanide:	Suspected to be present
Metals - Other non-priority pollutant metals:	Suspected to be present
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Not reported
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tibutyl Tin Contaminant Group:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

DUWAMISH SHIPYARD INC (Continued)

1000149827

Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2071
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55156600
Longitude: -122.34236600
Lat/Long: 47.55156600 / -122.34236600
Lat/Long (dms): 47 33 5.6376 / 122 20 32.5176
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2596
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site



Database(s) EDR ID Number
 EPA ID Number

DUWAMISH SHIPYARD INC (Continued)

1000149827

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

WA MANIFEST:

Facility Site ID Number:	2071
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.)":	False
Utility boiler burner:	False
Industry boiler burner:	False
Industrial Furnace:	False
Smelter defferral:	False
Universal waste - batteries - generate:	False
Universal waste - thermostats - generate:	False
Universal waste - mercury - generate:	False
Universal waste - lamps - generate:	False
Universal waste - batteries - accumulate:	False
Universal waste - thermostats - accumulate:	False
Universal waste - mercury - accumulate:	False
Universal waste - lamps - accumulate:	False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

DUWAMISH SHIPYARD INC (Continued)

1000149827

Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD009244997
Facility Address 2: Not reported
TAX REG NBR: Not reported
NAICS CD: 336611
BUSINESS TYPE: Not reported
MAIL NAME: Duwamish Shipyard Inc
MAIL ADDR LINE1: 5658 W MARGINAL WAY SW
MAIL CITY,ST,ZIP: SEATTLE, WA 98106-1520
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Duwamish Shipyard Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 5658 W MARGINAL WAY SW
LEGAL CITY,ST,ZIP: SEATTLE, WA 98106-1520
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)767-4880
LEGAL EFFECTIVE DATE: 05/02/96
LAND ORG NAME: Duwamish Shipyard Inc
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 5658 W MARGINAL WAY SW
LAND CITY,ST,ZIP: SEATTLE, WA 98106-1520
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206)767-4880
OPERATOR ORG NAME: Duwamish Shipyard Inc
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5658 W MARGINAL WAY SW
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98106-1520
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206) 767-4880
OPERATOR EFFECTIVE DATE: 08/12/96
SITE CONTACT NAME: Kyle McCleary
SITE CONTACT ADDR LINE1: 5658 West Marginal Way S.W.
SITE CONTACT ZIP: Seattle, WA 98106
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)767-4880
SITE CONTACT EMAIL: Not reported
FORM CONTACT NAME: Kyle McCleary
FORM CONTACT ADDR LINE1: 5658 West Marginal Way S.W.
FORM CONTACT CITY,ST,ZIP: Seattle, WA 98106
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)767-4880
FORM CONTACT EMAIL: kylem@duwamishshipyard.com
GEN STATUS CD: SQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False

Map ID
Direction
Distance
Distance (ft.)
Elevation



DUWAMISH SHIPYARD INC (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000149827

USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ICR:

Date Ecology Received Report: 10/11/2000
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Final cleanup report
Site Register Issue: 98-29
County Code: 17.00000
Contact: Not reported
Report Title: UST Closure

**73
SSE
1/2-1
3219 ft.**

**GREAT WESTERN CHEMICAL CO SEATTLE
6900 FOX AVE S
SEATTLE, WA 98108**

**RCRA-SQG 1000158775
CSCSL WAD008957961
FINDS
LUST
CORRACTS
CERC-NFRAP
WA MANIFEST
ICR**

**Relative:
Lower**

**Actual:
8 ft.**

RCRAInfo Corrective Action Summary:

Event: CA Responsibility Referred To A Non-RCRA Federal Authority, Corrective Action referred to another non-RCRA Federal Authority.
Event Date: 10/15/1996
Event: RFA Determination Of Need For An RFI, RFI is Necessary;
Event Date: 12/22/1992
Event: CA Prioritization, Facility or area was assigned a low corrective action priority.
Event Date: 08/14/1991

RCRAInfo:

Owner: CASCADE COLUMBIA
(206)282-6334
EPA ID: WAD008957961
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: -200(1)(e) / -350(2)(3)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/11/2001
Actual Date Achieved Compliance: 07/25/2001
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/19/2001
Penalty Type: Not reported
Regulation Violated: 630(7)

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

GREAT WESTERN CHEMICAL CO SEATTLE (Continued)

1000158775

Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 08/05/1997
Actual Date Achieved Compliance: 08/11/1997

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 09/07/1988
Penalty Type: Not reported

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/05/1997
Penalty Type: Not reported

Regulation Violated: Not reported
Area of Violation: GENERATOR-OTHER REQUIREMENTS
Date Violation Determined: 03/30/1988
Actual Date Achieved Compliance: 10/06/1988

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 09/07/1988
Penalty Type: Not reported

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 08/05/1997
Penalty Type: Not reported

Regulation Violated: Not reported
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined: 02/06/1984
Actual Date Achieved Compliance: 03/28/1984

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1984
Penalty Type: Not reported

Regulation Violated: Not reported
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined: 02/06/1984
Actual Date Achieved Compliance: 03/28/1984

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/24/1984
Penalty Type: Not reported

There are 5 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20010725
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19970811
Compliance Evaluation Inspection	GENERATOR-OTHER REQUIREMENTS	19881006
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19840328
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19840328

CSCSL:

Facility ID: 2282
warm_bin_n: 1
Prog plan code: 2
Latitude: 47.54196600
Longitude: -122.32736600
Lat/Long: 47.54196600 / -122.32736600
Lat/Long (dms): 47 32 31.0776 / 122 19 38.5176
Media ID: 1
Media Type Desc: Groundwater

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

GREAT WESTERN CHEMICAL CO SEATTLE (Continued)

1000158775

Media Status Desc: Confirmed
Affected Media: 3074
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Remedial Action in progress
Independent Site Status (independent cleanup): Not reported

Facility ID: 2282
warm_bin_n: 1
Prog plan code: 2
Latitude: 47.54196600
Longitude: -122.32736600
Lat/Long: 47.54196600 / -122.32736600
Lat/Long (dms): 47 32 31.0776 / 122 19 38.5176
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 3075
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

GREAT WESTERN CHEMICAL CO SEATTLE (Continued)

1000158775

Halogenated Organic Compounds:	C
EPA Priority Pollutants - Metals and Cyanide:	Not reported
Metals - Other non-priority pollutant metals:	Not reported
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tributyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Remedial Action in progress
Independent Site Status (independent cleanup):	Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

LUST:

FS ID:	2282
Facility ID:	3803
Release ID:	1819
Alternate Name:	GREAT WESTERN CHEMICAL CO
Release Notification Date:	5/17/1990 00:00:00
Release Status Date:	6/1/1995 00:00:00
Facility Status:	Cleanup Started
Affected Media:	Soil
Site Response Unit Code:	NW
Lat/Long:	47.541966000000002 / -122.327366

CORRACTS Data:

EPA Id:	WAD008957961
Region:	10
Area Name:	ENTIRE FACILITY
Actual Date:	08/14/1991
Corrective Action:	CA075LO - CA Prioritization, Facility or area was assigned a low corrective action priority

Map ID
Direction
Distance
Distance (ft.)
Elevation



GREAT WESTERN CHEMICAL CO SEATTLE (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000158775

2002 NAICS Title: Other Chemical and Allied Products Merchant Wholesalers

EPA Id: WAD008957961
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 10/15/1996
Corrective Action: CA210T - CA Responsibility Referred To A Non-RCRA Federal Authority, Corrective
Action referred to another non-RCRA Federal Authority

2002 NAICS Title: Other Chemical and Allied Products Merchant Wholesalers

EPA Id: WAD008957961
Region: 10
Area Name: ENTIRE FACILITY
Actual Date: 12/22/1992
Corrective Action: CA070YE - RFA Determination Of Need For An RFI, RFI is Necessary

2002 NAICS Title: Other Chemical and Allied Products Merchant Wholesalers

CERC-NFRAP:

Site ID: 1001601
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP

Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 10/01/1991
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: 04/29/1992
Date Completed: 04/29/1992
Priority Level: NFRAP (No Further Remedial Action Planned)

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 04/29/1992
Priority Level: Not reported

WA MANIFEST:

Facility Site ID Number: 2282
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter defferal: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

GREAT WESTERN CHEMICAL CO SEATTLE (Continued)

1000158775

Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD008957961
Facility Address 2: Not reported
TAX REG NBR: 601161532
NAICS CD: 42469
BUSINESS TYPE: distribution
MAIL NAME: Cascade Columbia
MAIL ADDR LINE1: PO Box 24745
MAIL CITY,ST,ZIP: SEATTLE, WA 98108-0745
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Cascade Columbia
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 6900 Fox Ave S
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)282-6334
LEGAL EFFECTIVE DATE: 07/29/96
LAND ORG NAME: Fox Ave Building LLC
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 6900 Fox Ave S
LAND CITY,ST,ZIP: SEATTLE, WA 98108
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206) 763-2350
OPERATOR ORG NAME: Cascade Columbia
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 6900 Fox Ave S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206)763-2350
OPERATOR EFFECTIVE DATE: 06/01/03
SITE CONTACT NAME: Robert Code
SITE CONTACT ADDR LINE1: PO Box 24745
SITE CONTACT ZIP: SEATTLE, WA 98108-0745
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)763-2350
SITE CONTACT EMAIL: bobc@casadecolumbia.com
FORM CONTACT NAME: Robert Code
FORM CONTACT ADDR LINE1: PO Box 24745
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108-0745
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (503)282-6334
FORM CONTACT EMAIL: bobc@casadecolumbia.com
GEN STATUS CD: LQG
MONTHLY GENERATION: False
BATCH GENERATION: True
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False

Map ID
Direction
Distance
Distance (ft.)
Elevation



GREAT WESTERN CHEMICAL CO SEATTLE (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000158775

TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ICR:

Date Ecology Received Report: 07/16/1990
Contaminants Found at Site: Halogenated organic compounds, Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 90-07
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

74
East
1/2-1
3253 ft.

Relative:
Higher

Actual:
17 ft.

SCOUGAL RUBBER CORP
6239 CORSON AVE S
SEATTLE, WA 98108

RCRA-SQG 1000424894
CSCSL WAD067159442
FINDS
LUST
UST
VCP
WA MANIFEST
ICR

RCRAInfo:

Owner: SCOUGAL RUBBER CORP
(206)767-7800
EPA ID: WAD067159442
Contact: Not reported
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: 170(1)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 07/16/1998
Actual Date Achieved Compliance: 09/23/1998

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/24/1998
Penalty Type: Not reported

Regulation Violated: 200(1)(b)&ref630(5)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 07/16/1998
Actual Date Achieved Compliance: 07/23/1998

Regulation Violated: 200(1)(d)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

SCOUGAL RUBBER CORP (Continued)

1000424894

Date Violation Determined: 07/16/1998
Actual Date Achieved Compliance: 07/23/1998
Regulation Violated: 210(2),(3)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 07/16/1998
Actual Date Achieved Compliance: 10/05/1998

There are 4 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19980923
	GENERATOR-GENERAL REQUIREMENTS	19980723
	GENERATOR-GENERAL REQUIREMENTS	19980723
	GENERATOR-GENERAL REQUIREMENTS	19981005

CSCSL:

Facility ID: 93637295
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54705000
Longitude: -122.32154000
Lat/Long: 47.54705000 / -122.32154000
Lat/Long (dms): 47 32 49.3800 / 122 19 17.5440
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 8944
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 93637295

Map ID
Direction
Distance
Distance (ft.)
Elevation



SCOUGAL RUBBER CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000424894

warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54705000
Longitude: -122.32154000
Lat/Long: 47.54705000 / -122.32154000
Lat/Long (dms): 47 32 49.3800 / 122 19 17.5440
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 8943
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

LUST:

FS ID: 93637295

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SCOUGAL RUBBER CORP (Continued)

1000424894

Facility ID: 11320
Release ID: 1689
Alternate Name: SCOUGAL RUBBER
Release Notification Date: 1/1/1990 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.54704999999999 / -122.32154

FS ID: 93637295
Facility ID: 11320
Release ID: 1689
Alternate Name: SCOUGAL RUBBER
Release Notification Date: 1/1/1990 00:00:00
Release Status Date: 6/1/1995 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.54704999999999 / -122.32154

UST:

Facility ID: 93637295
Site ID: 11320
Status: Removed
Tank Name: 1
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 32460
Compartment ID: 32930
Decimal Latitude: 47.54704999999999
Decimal Longitude: -122.32154

Facility ID: 93637295
Site ID: 11320
Status: Removed
Tank Name: 4
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 32523
Compartment ID: 32993
Decimal Latitude: 47.54704999999999
Decimal Longitude: -122.32154

Facility ID: 93637295
Site ID: 11320
Status: Removed
Tank Name: 6
Install Date: 12/31/1964 00:00:00
Capacity: Not reported
Compartment #: 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

SCOUGAL RUBBER CORP (Continued)

1000424894

Substance: Not reported
Ecology Region: North Western
Tank ID: 32661
Compartment ID: 33134
Decimal Latitude: 47.547049999999999
Decimal Longitude: -122.32154

Facility ID: 93637295
Site ID: 11320
Status: **Removed**
Tank Name: 2
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 32598
Compartment ID: 33069
Decimal Latitude: 47.547049999999999
Decimal Longitude: -122.32154

Facility ID: 93637295
Site ID: 11320
Status: **Removed**
Tank Name: 3
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 32342
Compartment ID: 32808
Decimal Latitude: 47.547049999999999
Decimal Longitude: -122.32154

Facility ID: 93637295
Site ID: 11320
Status: **Removed**
Tank Name: 5
Install Date: 12/31/1964 00:00:00
Capacity: 111 TO 1,100 Gallons
Compartment #: 1
Substance: Not reported
Ecology Region: North Western
Tank ID: 32497
Compartment ID: 32967
Decimal Latitude: 47.547049999999999
Decimal Longitude: -122.32154

VCP:

Facility ID: 93637295
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 93637295

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

SCOUGAL RUBBER CORP (Continued)

1000424894

Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

WA MANIFEST:

Facility Site ID Number: 93637295
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter defferal: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD067159442
Facility Address 2: Not reported
TAX REG NBR: 600115400
NAICS CD: 32629
BUSINESS TYPE: Rubber Products Manf
MAIL NAME: Scougal Rubber Corp
MAIL ADDR LINE1: PO Box 80226
MAIL CITY,ST,ZIP: SEATTLE, WA 98108-0226
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Scougal Rubber Corp
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: PO Box 80286
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108-0286
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)763-2650
LEGAL EFFECTIVE DATE: 06/07/96
LAND ORG NAME: Blaser Die Casting
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: PO Box C81435
LAND CITY,ST,ZIP: SEATTLE, WA 98108
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (206)767-7800
OPERATOR ORG NAME: Scougal Rubber Corp
OPERATOR ORG TYPE: Private

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

SCOUGAL RUBBER CORP (Continued)

1000424894

OPERATOR ADDR LINE1: 6239 CORSON AVE S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108-3443
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206)763-2650
OPERATOR EFFECTIVE DATE: 06/07/96
SITE CONTACT NAME: Tom R Nielsen
SITE CONTACT ADDR LINE1: 6239 CORSON AVE S
SITE CONTACT ZIP: SEATTLE, WA 98108-3443
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)763-2650
SITE CONTACT EMAIL: Not reported
FORM CONTACT NAME: Tom Nielsen
FORM CONTACT ADDR LINE1: PO Box 80226
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)763-2650
FORM CONTACT EMAIL: tomn@scougalrubber.com
GEN STATUS CD: MQG
MONTHLY GENERATION: False
BATCH GENERATION: True
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACLTY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ICR:

Date Ecology Received Report: 01/03/1994
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 94-40
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Date Ecology Received Report: 09/06/1991
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-07
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SCOUGAL RUBBER CORP (Continued)

1000424894

Date Ecology Received Report: 07/20/1992
Contaminants Found at Site: Petroleum products
Media Contaminated: Groundwater, Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 92-32
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

T75 BURLINGTON ENVIRONMENTAL INC GEORGETOWN
ENE 734 S LUCILE ST
1/2-1 SEATTLE, WA 98108
3337 ft.

Site 1 of 2 in cluster T

Relative:
Higher

Actual:
17 ft.

PADS 1000299415
FINDS WAD000812909
RCRA-LQG
RCRA-TSDF
RAATS
CORRACTS
CERC-NFRAP
WA MANIFEST
US ENG CONTROLS
US INST CONTROL
HAZNET
NY MANIFEST

FINDS:

Other Pertinent Environmental Activity Identified at Site:

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and at Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include: Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

Map ID
Direction
Distance
Distance (ft.)
Elevation



EDR ID Number
EPA ID Number
Database(s)

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

RCRAInfo Corrective Action Summary:

Event: CA770GW
Event Date: Not reported

Event: CA772PR
Event Date: Not reported

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 09/13/2005

Event: Current Human Exposures under Control, Yes, Current Human Exposures Under Control has been verified. Based on a review of information contained in the EI determination, current human exposures are expected to be under control at the facility under current and reasonably expected conditions. This determination will be re-evaluated when the Agency/State becomes aware of significant changes at the facility.
Event Date: 09/06/2005

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 04/12/2005

Event: RFI Approved
Event Date: 12/09/2004

Event: Current Human Exposures under Control, Current human exposures are NOT under control.
Event Date: 08/05/2004

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 08/05/2004

Event: CMS Workplan Approved
Event Date: 05/06/2004

Event: Current Human Exposures under Control, Current human exposures are NOT under control.
Event Date: 08/29/2003

Event: Current Human Exposures under Control, More information is needed to make a determination.
Event Date: 06/26/2002

Event: Igration of Contaminated Groundwater under Control, More information is needed to make a determination.
Event Date: 06/26/2002

Event: Stabilization Measures Evaluation, This facility is amenable to stabilization activity based on the status of corrective action work at the facility, technical factors, the degree of risk, timing considerations and administrative considerations.
Event Date: 08/31/2001

Event: Current Human Exposures under Control, Current human exposures are NOT under control.
Event Date: 03/16/1999

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Event: Igration of Contaminated Groundwater under Control, Unacceptable migration of contaminated groundwater is observed or expected.
Event Date: 03/16/1999

Event: Current Human Exposures under Control, Current human exposures are NOT under control.
Event Date: 09/30/1998

Event: Igration of Contaminated Groundwater under Control, Unacceptable migration of contaminated groundwater is observed or expected.
Event Date: 09/30/1998

Event: RFI Workplan Approved
Event Date: 06/16/1998

Event: CA Prioritization, Facility or area was assigned a high corrective action priority.
Event Date: 04/27/1998

Event: RFI Workplan Approved
Event Date: 09/30/1997

Event: RFI Workplan Approved
Event Date: 07/25/1997

Event: Stabilization Measures Evaluation, This facility is amenable to stabilization activity based on the status of corrective action work at the facility, technical factors, the degree of risk, timing considerations and administrative considerations.
Event Date: 04/12/1994

Event: Stabilization Measures Implemented, Other Activity
Event Date: 03/15/1994

Event: CA Prioritization, Facility or area was assigned a medium corrective action priority.
Event Date: 10/08/1991

Event: RFA Determination Of Need For An RFI, RFI is Necessary;
Event Date: 08/05/1991

Event: RFI Imposition
Event Date: 08/05/1991

Event: RFI Workplan Approved
Event Date: 08/05/1991

Event: RFI Approved
Event Date: 05/04/1990

Event: RFI Workplan Approved
Event Date: 06/21/1989

Event: RFI Imposition
Event Date: 09/30/1988

Event: RFA Completed
Event Date: 06/30/1988

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

RCRAInfo:

Owner: BURLINGTON ENVIRONMENTAL INC
(425)227-0311
EPA ID: WAD000812909
Contact: Not reported

Classification: Large Quantity Generator, TSDF
TSDF Activities: Not reported

BIENNIAL REPORTS:

Last Biennial Reporting Year: 2003

Waste	Quantity (Lbs)	Waste	Quantity (Lbs)
D001	247522.74	D002	72666.87
D003	25600.70	D004	225819.39
D005	327242.34	D006	343062.09
D007	354970.88	D008	331968.88
D009	154703.09	D010	2230.95
D011	11647.00	D018	2054.79
D019	417.00	D021	417.00
D022	362.79	D030	417.00
D039	780.00	F001	125366.60
F002	127535.00	F003	124199.00
F004	124199.00	F005	124199.00
F007	1601.28	U210	485.00
U226	485.00		

Violation Status: Violations exist

Regulation Violated: Permit EE
Area of Violation: TSD-TANKS REQUIREMENTS
Date Violation Determined: 01/15/2003
Actual Date Achieved Compliance: 04/04/2003

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 02/14/2003
Penalty Type: Not reported

Regulation Violated: -200(1)(b)/630(9)(c)640(10)(a)
Area of Violation: TSD-CHEMICAL/PHYSICAL/BIOLOGICAL REQUIREMENTS
Date Violation Determined: 08/29/2001
Actual Date Achieved Compliance: 03/04/2002

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 09/27/2001
Penalty Type: Not reported

Regulation Violated: Permit Cond VII.D.1
Area of Violation: TSD-GOUNDWATER MONITORING REQUIREMENTS
Date Violation Determined: 11/03/2000
Actual Date Achieved Compliance: 12/23/2003

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 11/03/2000
Penalty Type: Proposed Monetary Penalty

Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 08/06/2001
Penalty Type: Proposed Monetary Penalty

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 01/17/2002

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/14/1992
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	Permit Condition VII.B.3
Area of Violation:	TSD-GOUNDWATER MONITORING REQUIREMENTS
Date Violation Determined:	11/03/2000
Actual Date Achieved Compliance:	12/23/2003
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	11/03/2000
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	08/06/2001
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	01/17/2002
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/14/1992
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	Permit Condition VII.A.8
Area of Violation:	TSD-GOUNDWATER MONITORING REQUIREMENTS
Date Violation Determined:	11/03/2000
Actual Date Achieved Compliance:	12/23/2003
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	11/03/2000
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	08/06/2001
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	01/17/2002
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/14/1992
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	Permit Condition V.D.1
Area of Violation:	TSD-CONTAINERS REQUIREMENTS
Date Violation Determined:	11/03/2000
Actual Date Achieved Compliance:	12/23/2003
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	11/03/2000
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	08/06/2001
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	01/17/2002
Penalty Type:	Proposed Monetary Penalty

Map ID
Direction
Distance
Distance (ft.)
Elevation



BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000299415

Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	05/31/1995
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	600 & 630(5)(a)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/31/1995
Actual Date Achieved Compliance:	07/17/1995
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	11/03/2000
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	08/06/2001
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	01/17/2002
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	05/31/1995
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	600 & 630(7)(d)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/31/1995
Actual Date Achieved Compliance:	07/17/1995
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	05/31/1995
Penalty Type:	Not reported
Regulation Violated:	600(1)(2)&630(7)(d)
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/11/1994
Actual Date Achieved Compliance:	03/30/1995
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	03/18/1993
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	02/24/1995
Penalty Type:	Not reported
Regulation Violated:	630(5)(b)
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/14/1993
Actual Date Achieved Compliance:	08/31/1994
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	630(7)(d)
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/14/1993
Actual Date Achieved Compliance:	03/30/1995
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Regulation Violated:	600
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/14/1993
Actual Date Achieved Compliance:	08/31/1994
Enforcement Action:	VERBAL INFORMAL
Enforcement Action Date:	03/13/1992
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	40 CFR 268.7(a)(1)
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/14/1993
Actual Date Achieved Compliance:	08/31/1994
Enforcement Action:	VERBAL INFORMAL
Enforcement Action Date:	03/13/1992
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	350(4)(b)
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/14/1993
Actual Date Achieved Compliance:	08/31/1994
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	12/06/1990
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	630(5)
Area of Violation:	TSD-GENERAL STANDARDS
Date Violation Determined:	05/14/1993
Actual Date Achieved Compliance:	08/31/1994
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-CONTAINERS REQUIREMENTS
Date Violation Determined:	01/06/1993
Actual Date Achieved Compliance:	04/19/1993
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	03/18/1993
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	02/24/1995
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS
Date Violation Determined:	01/06/1993

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Actual Date Achieved Compliance: 05/14/1993

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 03/18/1993
Penalty Type: Not reported

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/14/1992
Penalty Type: Not reported

Regulation Violated: 810(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/15/1992
Actual Date Achieved Compliance: 08/20/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 03/18/1993
Penalty Type: Not reported

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/14/1992
Penalty Type: Not reported

Regulation Violated: 640(5)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/15/1992
Actual Date Achieved Compliance: 08/20/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 11/03/2000
Penalty Type: Proposed Monetary Penalty

Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 08/06/2001
Penalty Type: Proposed Monetary Penalty

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 01/17/2002
Penalty Type: Proposed Monetary Penalty

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/14/1992
Penalty Type: Proposed Monetary Penalty

Regulation Violated: 630
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/15/1992
Actual Date Achieved Compliance: 08/20/1992

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 11/03/2000
Penalty Type: Proposed Monetary Penalty

Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 08/06/2001
Penalty Type: Proposed Monetary Penalty

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 01/17/2002
Penalty Type: Proposed Monetary Penalty

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/14/1992
Penalty Type: Proposed Monetary Penalty

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

IMAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Regulation Violated:	510(5)(e)(i)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	04/15/1992
Actual Date Achieved Compliance:	08/20/1992
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	11/03/2000
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	08/06/2001
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	01/17/2002
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/14/1992
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	Not reported
Area of Violation:	TSD-LAND BAN REQUIREMENTS
Date Violation Determined:	03/09/1992
Actual Date Achieved Compliance:	04/16/1992
Enforcement Action:	VERBAL INFORMAL
Enforcement Action Date:	03/13/1992
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-LAND BAN REQUIREMENTS
Date Violation Determined:	03/09/1992
Actual Date Achieved Compliance:	04/16/1992
Enforcement Action:	VERBAL INFORMAL
Enforcement Action Date:	03/13/1992
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	-630(5)(C)
Area of Violation:	TSD-CONTAINERS REQUIREMENTS
Date Violation Determined:	07/15/1991
Actual Date Achieved Compliance:	08/12/1991
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	04/16/1991
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/15/1991
Penalty Type:	Not reported
Regulation Violated:	173-303-060
Area of Violation:	GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined:	07/15/1991
Actual Date Achieved Compliance:	08/12/1991

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	04/16/1991
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/15/1991
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	11/27/1990
Actual Date Achieved Compliance:	01/09/1991
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	12/06/1990
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	05/24/1990
Actual Date Achieved Compliance:	07/18/1990
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1990
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	05/24/1990
Actual Date Achieved Compliance:	07/18/1990
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1990
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS
Date Violation Determined:	04/05/1988
Actual Date Achieved Compliance:	09/29/1988
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	04/05/1988
Actual Date Achieved Compliance:	09/29/1988
Regulation Violated:	Not reported
Area of Violation:	TSD-GROUNDWATER MONITORING REQUIREMENTS
Date Violation Determined:	12/15/1987
Actual Date Achieved Compliance:	07/13/1989
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	08/03/1993
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS
Date Violation Determined:	05/05/1987
Actual Date Achieved Compliance:	07/04/1994
Enforcement Action:	WRITTEN INFORMAL

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Enforcement Action Date:	06/24/1987
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	05/05/1987
Actual Date Achieved Compliance:	07/04/1994
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/24/1987
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS
Date Violation Determined:	07/31/1986
Actual Date Achieved Compliance:	09/29/1987
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	03/06/1986
Actual Date Achieved Compliance:	09/29/1987
Enforcement Action:	EPA TO STATE ADMINISTRATIVE REFERRAL
Enforcement Action Date:	04/14/1986
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	01/30/1986
Actual Date Achieved Compliance:	07/04/1994
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/07/1986
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	01/30/1986
Actual Date Achieved Compliance:	07/04/1994
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	06/30/1986
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	12/24/1985
Actual Date Achieved Compliance:	09/29/1987
Enforcement Action:	EPA TO STATE ADMINISTRATIVE REFERRAL
Enforcement Action Date:	01/02/1986
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS
Date Violation Determined:	12/04/1985
Actual Date Achieved Compliance:	09/29/1987
Enforcement Action:	EPA TO STATE ADMINISTRATIVE REFERRAL
Enforcement Action Date:	01/02/1986
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000299415

Date Violation Determined: 12/04/1985
Actual Date Achieved Compliance: 09/29/1987
Regulation Violated: Not reported
Area of Violation: TSD-MANIFEST REQUIREMENTS
Date Violation Determined: 05/08/1985
Actual Date Achieved Compliance: 09/29/1987
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/16/1991
Penalty Type: Not reported
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/15/1991
Penalty Type: Not reported
Regulation Violated: Not reported
Area of Violation: TSD-OTHER REQUIREMENTS (OVERSIGHT)
Date Violation Determined: 05/08/1985
Actual Date Achieved Compliance: 09/29/1987
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/16/1991
Penalty Type: Not reported
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 07/15/1991
Penalty Type: Not reported

Penalty Summary:

Penalty Description	Penalty Date	Penalty Amount	Lead Agency
Final Monetary Penalty	1/17/2002	136112	EPA
Proposed Monetary Penalty	8/6/2001	773810.5	EPA

There are 42 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	TSD-TANKS REQUIREMENTS	20030404
Compliance Evaluation Inspection	TSD-CHEMICAL/PHYSICAL/BIOLOGICAL REQUIREMENTS	20020304
A Significant Non-Complier (SNC)	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-CONTAINERS REQUIREMENTS	20031223
Compliance Evaluation Inspection	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-CONTAINERS REQUIREMENTS	20031223
Compliance GW Monitoring Evaluation	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-GROUNDWATER MONITORING REQUIREMENTS	20031223
	TSD-CONTAINERS REQUIREMENTS	20031223
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19950717
	GENERATOR-GENERAL REQUIREMENTS	19950717
Compliance Evaluation Inspection	TSD-GENERAL STANDARDS	19950330
Compliance Evaluation Inspection	TSD-GENERAL STANDARDS	19940831
	TSD-GENERAL STANDARDS	19950330
	TSD-GENERAL STANDARDS	19940831
	TSD-GENERAL STANDARDS	19940831
	TSD-GENERAL STANDARDS	19940831
	TSD-GENERAL STANDARDS	19940831

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

Site	Database(s)	EDR ID Number EPA ID Number
BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)		1000299415
Compliance Evaluation Inspection	TSD-CONTAINERS REQUIREMENTS	19930419
	TSD-OTHER REQUIREMENTS	19930514
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19920820
	GENERATOR-GENERAL REQUIREMENTS	19920820
	GENERATOR-GENERAL REQUIREMENTS	19920820
	GENERATOR-GENERAL REQUIREMENTS	19920820
Compliance Evaluation Inspection	TSD-LAND BAN REQUIREMENTS	19920416
	TSD-LAND BAN REQUIREMENTS	19920416
Compliance Evaluation Inspection	TSD-CONTAINERS REQUIREMENTS	19910812
	GENERATOR-RECORDKEEPING REQUIREMENTS	19910812
Compliance Evaluation Inspection	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19910109
Compliance Evaluation Inspection	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19900718
	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19900718
Compliance Evaluation Inspection	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS	19880929
	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19880929
Non-Financial Record Review	TSD-GROUNDWATER MONITORING REQUIREMENTS	19890713
Compliance Evaluation Inspection	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS	19940704
	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19940704
Compliance Evaluation Inspection	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS	19870929
Non-Financial Record Review	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19870929
Compliance Evaluation Inspection	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19940704
	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19940704
Non-Financial Record Review	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19870929
Non-Financial Record Review	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS	19870929
	TSD-CLOSURE/POST-CLOSURE REQUIREMENTS	19870929
Compliance Evaluation Inspection	TSD-MANIFEST REQUIREMENTS	19870929
	TSD-OTHER REQUIREMENTS (OVERSIGHT)	19870929

CORRACTS Data:

EPA Id: WAD000812909
 Region: 10
 Area Name: FACILITY
 Actual Date: 03/15/1994
 Corrective Action: CA600T - Stabilization Measures Implemented , Other activity
 2002 NAICS Title: Hazardous Waste Treatment and Disposal

EPA Id: WAD000812909
 Region: 10
 Area Name: FACILITY
 Actual Date: 03/16/1999
 Corrective Action: CA750NO - Migration of Contaminated Groundwater under Control, Unacceptable migration of contaminated groundwater is observed or expected
 2002 NAICS Title: Hazardous Waste Treatment and Disposal

EPA Id: WAD000812909
 Region: 10
 Area Name: FACILITY
 Actual Date: 03/16/1999
 Corrective Action: CA725NO - Current Human Exposures Under Control, Current human exposures are NOT under control
 2002 NAICS Title: Hazardous Waste Treatment and Disposal

EPA Id: WAD000812909
 Region: 10
 Area Name: FACILITY
 Actual Date: 04/12/1994

Map ID
Direction
Distance
Distance (ft.)
Elevation



BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000299415

Corrective Action: CA225YE - Stabilization Measures Evaluation, This facility is amenable to stabilization activity based on the, status of corrective action work at the facility, technical factors, the degree of risk, timing considerations and administrative considerations

2002 NAICS Title: Hazardous Waste Treatment and Disposal

EPA Id: WAD000812909

Region: 10

Area Name: FACILITY

Actual Date: 04/12/2005

Corrective Action: CA725IN - Current Human Exposures Under Control , More information is needed to make a determination

2002 NAICS Title: Hazardous Waste Treatment and Disposal

[Click this hyperlink](#) while viewing on your computer to access 26 additional CORRACTS record(s) in the EDR Site Report.

CERC-NFRAP:

Site ID: 1000571

Federal Facility: Not a Federal Facility

NPL Status: Not on the NPL

Non NPL Status: NFRAP

CERCLIS Site Alias Name(s):

Alias Name: CHEMICAL PROCESSORS INC

Alias Address: 5501 AIRPORT WAY S
SEATTLE, WA 98108

Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY

Date Started: Not reported

Date Completed: 09/01/1979

Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT

Date Started: 04/16/1985

Date Completed: 04/29/1985

Priority Level: Low

Action: PRELIMINARY ASSESSMENT

Date Started: 05/31/1988

Date Completed: 05/31/1988

Priority Level: NFRAP (No Futher Remedial Action Planned)

Action: ARCHIVE SITE

Date Started: Not reported

Date Completed: 05/31/1988

Priority Level: Not reported

WA MANIFEST:

Facility Site ID Number: 47779679

Permit by Rule: False

Treatment by Generator: False

Mixed radioactive waste: False

Importer of hazardous waste: False

Immediate recycler: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site




Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD000812909
Facility Address 2: Not reported
TAX REG NBR: 600019753
NAICS CD: 562211
BUSINESS TYPE: Previous RCRA TSDF-
MAIL NAME: Burlington Environmental Inc
MAIL ADDR LINE1: 18000 72 Ave S. Suite 217
MAIL CITY,ST,ZIP: KENT, WA 98032
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Burlington Environmental Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 18000 72 Ave S. Suite 217
LEGAL CITY,ST,ZIP: KENT, WA 98032
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (425)227-0311
LEGAL EFFECTIVE DATE: 11/14/96
LAND ORG NAME: Burlington Environmental Inc
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 18000 72 Ave S. Suite 217
LAND CITY,ST,ZIP: KENT, WA 98032
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (425)227-0311
OPERATOR ORG NAME: Burlington Environmental Inc
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 18000 72 Ave. S Suite 217
OPERATOR CITY,ST,ZIP: KENT, WA 98032
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (425)227-0311
OPERATOR EFFECTIVE DATE: 11/14/96
SITE CONTACT NAME: Greg Garman
SITE CONTACT ADDR LINE1: 18000 72 Ave. S Suite 217
SITE CONTACT ZIP: KENT, WA 98032
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (425)227-0311
SITE CONTACT EMAIL: Gregg@contactpsc.com
FORM CONTACT NAME: Greg Garman

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

FORM CONTACT ADDR LINE1: 18000 72 Ave. S Suite 217
FORM CONTACT CITY,ST,ZIP: Kent, WA 98032
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (425)227-0311
FORM CONTACT EMAIL: Gregg@contactpsc.com
GEN STATUS CD: XQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

US Engineering Control Sites:

EPA ID: WAD000812909
Site ID: Not reported
EPA Region: 10
County: KING
Event Code: CA770GW
Actual Date: / /

Action ID: Not reported
Action Name: Not reported
Action Completion date: Not reported
Planned Completion date: Not reported
Operable Unit: Not reported
Contaminated Media: Not reported
Contam. Media num.: Not reported
Engineering Control: Not reported

US INST CONTROL:

EPA ID: WAD000812909
Name: BURLINGTON ENVIRONMENTAL INC GEORGE
Address: 734 S LUCILE ST
SEATTLE, WA 98108
County: KING
Region: 10
Event Code: Not reported
Actual Dt: Not reported

HAZNET.

Gepaid: WAD000812909
TSD EPA ID: CAD008364432
Gen County: 99
Tsd County: Los Angeles
Tons: .1251
Facility Address 2: Not reported
Waste Category:
Disposal Method: Recycler

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Contact: Not reported
Telephone: (000) 000-0000
Mailing Name: Not reported
Mailing Address: 734 S LUCILE ST
SEATTLE, WA 98108 - 2631
County 99
Gepaid: WAD000812909
TSD EPA ID: CAD088504881
Gen County: 99
Tsd County: Orange
Tons: 1.5010
Facility Address 2: Not reported
Waste Category:
Disposal Method: Transfer Station
Contact: Not reported
Telephone: (000) 000-0000
Mailing Name: Not reported
Mailing Address: 734 S LUCILE ST
SEATTLE, WA 98108 - 2631
County 99
Gepaid: WAD000812909
TSD EPA ID: CAD008364422
Gen County: 99
Tsd County: 0
Tons: 2.9815
Facility Address 2: Not reported
Waste Category: Halogenated solvents (chloroform, methyl chloride, perchloroethylene, etc.)
Disposal Method: Not reported
Contact: Not reported
Telephone: (000) 000-0000
Mailing Name: Not reported
Mailing Address: 734 S LUCILE ST
SEATTLE, WA 98108 - 2631
County 99
Gepaid: WAD000812909
TSD EPA ID: CAD088504881
Gen County: 99
Tsd County: Orange
Tons: 6.8605
Facility Address 2: Not reported
Waste Category: Alkaline solution (pH <UN-> 12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc)
Disposal Method: Transfer Station
Contact: Not reported
Telephone: (000) 000-0000
Mailing Name: Not reported
Mailing Address: 734 S LUCILE ST
SEATTLE, WA 98108 - 2631
County 99

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415


Gepaid: WAD000812909
TSD EPA ID: CAD088504881
Gen County: 99
Tsd County: Orange
Tons: .2500
Facility Address 2: Not reported
Waste Category: Other inorganic solid waste
Disposal Method: Transfer Station
Contact: Not reported
Telephone: (000) 000-0000
Mailing Name: Not reported
Mailing Address: 734 S LUCILE ST
SEATTLE, WA 98108 - 2631
County: 99

[Click this hyperlink](#) while viewing on your computer to access
64 additional CA HAZNET record(s) in the EDR Site Report.

NY MANIFEST.

Document ID: NYB7935219
Manifest Status: K
Trans1 State ID: T388KFOH
Trans2 State ID: Not reported
Generator Ship Date: 951031
Trans1 Recv Date: 951031
Trans2 Recv Date: Not reported
TSD Site Recv Date: 951120
Part A Recv Date: 951113
Part B Recv Date: 951211
Generator EPA ID: WAD000812909
Trans1 EPA ID: OHD009865825
Trans2 EPA ID: Not reported
TSDF ID: NYD048148175
Waste Code: D009 - MERCURY 0.2 MG/L TCLP
Quantity: 00659
Units: P - Pounds
Number of Containers: 001
Container Type: CW - Wooden boxes
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 08503
Units: P - Pounds
Number of Containers: 020
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00561
Units: P - Pounds
Number of Containers: 001
Container Type: CM - Metal boxes, cases, roll-offs
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 01045
Units: P - Pounds

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

1000299415

Number of Containers: 004
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 95
Facility Type: Generator
EPA ID: WAD000812909
Facility Name: CHEMICAL PROCESSORS INCORPORATED
Facility Address: 734 SOUTH LUCILE STREET
Facility City: SEATTLE
Facility Zip 4: Not reported
Country: Not reported
County: Not reported
Mailing Name: CHEMICAL PROCESSORS INCORPORATED
Mailing Contact: Not reported
Mailing Address: 734 SOUTH LUCILE STREET
Mailing City: SEATTLE
Mailing State: WA
Mailing Zip: 98108
Mailing Zip4: Not reported
Mailing Country: Not reported
Mailing Phone: 206-762-3362

Click this hyperlink while viewing on your computer to access
36 additional NY MANIFEST: record(s) in the EDR Site Report.

T76
ENE
1/2-1
3337 ft.

BURLINGTON ENVIRONMENTAL INC GEORGETOWN
734 S LUCILE ST
SEATTLE, WA 98108

CSCSL S104917964
N/A

Site 2 of 2 in cluster T

Relative:
Higher

Actual:
17 ft.

CSCSL:
Facility ID: 47779679
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55416700
Longitude: -122.32166700
Lat/Long: 47.55416700 / -122.32166700
Lat/Long (dms): 47 33 15.0012 / 122 19 18.0012
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2680
Affected Media Status: C
Pesticides: Below MTCA cleanup levels
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Below MTCA cleanup levels
Corrosive Wastes: Below MTCA cleanup levels
Radioactive Wastes: Below MTCA cleanup levels
Asbestos: Below MTCA cleanup levels
Responsible Unit: Northwest Region
Arsenic Code: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
MTBE Code: B
UXO Code: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

S104917964

Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Suspected to be present
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Remedial Action in progress
Independent Site Status (independent cleanup): Not reported

Facility ID: 47779679
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55416700
Longitude: -122.32166700
Lat/Long: 47.55416700 / -122.32166700
Lat/Long (dms): 47 33 15.0012 / 122 19 18.0012
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2681
Affected Media Status: C
Pesticides: Below MTCA cleanup levels
Petroleum Products: Suspected to be present
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Below MTCA cleanup levels
Corrosive Wastes: Below MTCA cleanup levels
Radioactive Wastes: Below MTCA cleanup levels
Asbestos: Below MTCA cleanup levels
Responsible Unit: Northwest Region
Arsenic Code: C
MTBE Code: B
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Confirmed above MTCA cleanup levels
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Remedial Action in progress
Independent Site Status (independent cleanup): Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BURLINGTON ENVIRONMENTAL INC GEORGETOWN (Continued)

S104917964

Facility ID: 47779679
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.55416700
Longitude: -122.32166700
Lat/Long: 47.55416700 / -122.32166700
Lat/Long (dms): 47 33 15.0012 / 122 19 18.0012
Media ID: 3
Media Type Desc: Air
Media Status Desc: Confirmed
Affected Media: 10387
Affected Media Status: C
Pesticides: Below MTCA cleanup levels
Petroleum Products: Suspected to be present
Phenolic Compounds: Below MTCA cleanup levels
Reactive Wastes: Below MTCA cleanup levels
Corrosive Wastes: Below MTCA cleanup levels
Radioactive Wastes: Below MTCA cleanup levels
Asbestos: Below MTCA cleanup levels
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: B
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Below MTCA cleanup levels
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Below MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Below MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Below MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Remedial Action in progress
Independent Site Status (independent cleanup): Not reported

77 INDUSTRIAL CONTAINER SERVICES WA LLC
South 7152 1ST AVE S
1/2-1 SEATTLE, WA 98108
3581 ft.
Relative:
Higher
Actual:
14 ft.

RCRA-SQG 1000411054
CSCSL WAD000066084
FINDS
RAATS
CERC-NFRAP
BROWNFIELDS
WA MANIFEST

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

RCRAInfo:

Owner: A CABUCO SR
 (206)763-2345
EPA ID: WAD000066084
Contact: Not reported

Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: -170(1)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/10/2002
Actual Date Achieved Compliance: 05/29/2002

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/18/2002
Penalty Type: Not reported

Regulation Violated: -515(6)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 04/10/2002
Actual Date Achieved Compliance: 05/03/2002

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 04/18/2002
Penalty Type: Not reported

Regulation Violated: 160(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 06/14/1993
Actual Date Achieved Compliance: 08/30/1993

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 06/06/1989
Penalty Type: Proposed Monetary Penalty

Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 09/09/1988
Penalty Type: Proposed Monetary Penalty

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/14/1993
Penalty Type: Proposed Monetary Penalty

Regulation Violated: 200(1)(e) & REF 330(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 06/14/1993
Actual Date Achieved Compliance: 08/30/1993

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 06/06/1989
Penalty Type: Proposed Monetary Penalty

Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 09/09/1988
Penalty Type: Proposed Monetary Penalty

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/14/1993
Penalty Type: Proposed Monetary Penalty

Regulation Violated: 200(1)(a)

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	06/14/1993
Actual Date Achieved Compliance:	08/30/1993
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1993
Penalty Type:	Not reported
Regulation Violated:	200
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	06/14/1993
Actual Date Achieved Compliance:	08/30/1993
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1993
Penalty Type:	Not reported
Regulation Violated:	200(1)(b) & REF 630(b)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	06/14/1993
Actual Date Achieved Compliance:	08/30/1993
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1993
Penalty Type:	Not reported
Regulation Violated:	220(1)(a)(b)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	06/14/1993
Actual Date Achieved Compliance:	08/30/1993
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1993
Penalty Type:	Not reported
Regulation Violated:	060(2)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	06/14/1993
Actual Date Achieved Compliance:	08/30/1993
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1993
Penalty Type:	Not reported
Regulation Violated:	Not reported
Area of Violation:	GENERATOR-OTHER REQUIREMENTS
Date Violation Determined:	04/06/1988
Actual Date Achieved Compliance:	07/06/1989
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	06/06/1989
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	09/09/1988
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/14/1993
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	Not reported
Area of Violation:	GENERATOR-OTHER REQUIREMENTS
Date Violation Determined:	04/06/1988

Map ID
Direction
Distance
Distance (ft)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

Actual Date Achieved Compliance: 06/06/1988
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/14/1993
Penalty Type: Not reported
Regulation Violated: Not reported
Area of Violation: GENERATOR-MANIFEST REQUIREMENTS
Date Violation Determined: 04/06/1988
Actual Date Achieved Compliance: 06/06/1988
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/14/1993
Penalty Type: Not reported
Regulation Violated: Not reported
Area of Violation: GENERATOR-LAND BAN REQUIREMENTS
Date Violation Determined: 04/06/1988
Actual Date Achieved Compliance: 07/06/1989
Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 06/06/1989
Penalty Type: Proposed Monetary Penalty
Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date: 09/09/1988
Penalty Type: Proposed Monetary Penalty
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/14/1993
Penalty Type: Proposed Monetary Penalty

There are 13 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20020529
	GENERATOR-GENERAL REQUIREMENTS	20020503
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19930830
	GENERATOR-GENERAL REQUIREMENTS	19930830
	GENERATOR-GENERAL REQUIREMENTS	19930830
	GENERATOR-GENERAL REQUIREMENTS	19930830
	GENERATOR-GENERAL REQUIREMENTS	19930830
	GENERATOR-GENERAL REQUIREMENTS	19930830
	GENERATOR-GENERAL REQUIREMENTS	19930830
Compliance Evaluation Inspection	GENERATOR-OTHER REQUIREMENTS	19890706
	GENERATOR-LAND BAN REQUIREMENTS	19890706
	GENERATOR-MANIFEST REQUIREMENTS	19880606
	GENERATOR-OTHER REQUIREMENTS	19880606

CSCSL:

Facility ID: 2154
warm_bin_n: 4
Prog plan code: Not reported
Latitude: 47.60982000
Longitude: -122.33124000
Lat/Long: 47.60982000 / -122.33124000
Lat/Long (dms): 47 36 35.3500 / 122 19 52.4600
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2758

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

Affected Media Status: C
Pesticides: Confirmed above MTCA cleanup levels
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2154
warm_bin_n: 4
Prog plan code: Not reported
Latitude: 47.60982000
Longitude: -122.33124000
Lat/Long: 47.60982000 / -122.33124000
Lat/Long (dms): 47 36 35.3500 / 122 19 52.4600
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Confirmed
Affected Media: 2759
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

Metals - Other non-priority pollutant metals: Suspected to be present
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2154
warm_bin_n: 4
Prog plan code: Not reported
Latitude: 47.60982000
Longitude: -122.33124000
Lat/Long: 47.60982000 / -122.33124000
Lat/Long (dms): 47 36 35.3500 / 122 19 52.4600
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2760
Affected Media Status: C
Pesticides: Confirmed above MTCA cleanup levels
Petroleum Products: Not reported
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Confirmed above MTCA cleanup levels
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Confirmed above MTCA cleanup levels
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2154
warm_bin_n: 4
Prog plan code: Not reported
Latitude: 47.60982000
Longitude: -122.33124000

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

Lat/Long: 47.60982000 / -122.33124000
Lat/Long (dms): 47 36 35.3500 / 122 19 52.4600
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Confirmed
Affected Media: 2761
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Confirmed above MTCA cleanup levels
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Confirmed above MTCA cleanup levels
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CERC-NFRAP:

Site ID: 1000552
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP

Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 03/22/1985
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: 10/25/1985
Date Completed: 10/29/1985
Priority Level: High

Action: SITE INSPECTION
Date Started: 02/04/1986
Date Completed: 05/05/1986
Priority Level: NFRAP (No Further Remedial Action Planned)

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 05/19/1994
Priority Level: Not reported

BROWNFIELDS:

Facility ID: 2154
Site Stat Code: 2

Facility ID: 2154
Site Stat Code: 2

Facility ID: 2154
Site Stat Code: 2

Facility ID: 2154

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

Site Stat Code: 2

WA MANIFEST:

Facility Site ID Number: 2154
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter defferat: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD000066084
Facility Address 2: Not reported
TAX REG NBR: 601880727
NAICS CD: 81131
BUSINESS TYPE: Steel Drum Reconditioning
MAIL NAME: Industrial Container Services WA LLC
MAIL ADDR LINE1: 7152 1st Ave S
MAIL CITY,ST,ZIP: SEATTLE, WA 98108
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Industrial Container Services WA LLC
LEGAL ORG TYPE: Tribal
LEGAL ADDR LINE1: 7152 1st Ave S
LEGAL CITY,ST,ZIP: SEATTLE, WA 98108
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (206)763-2345
LEGAL EFFECTIVE DATE: 06/03/02
LAND ORG NAME: Not reported
LAND ORG TYPE: Private
LAND PERSON NAME: Herman Trotsky
LAND ADDR LINE1: 2818 140TH AVE NE
LAND CITY,ST,ZIP: BELLEVUE, WA 98005-1827
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (425)881-8126
OPERATOR ORG NAME: Industrial Container Services - WA,LLC
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 7152 1st Ave S
OPERATOR CITY,ST,ZIP: Seattle, WA 98108
OPERATOR COUNTRY: UNITED STATES

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

INDUSTRIAL CONTAINER SERVICES WA LLC (Continued)

1000411054

OPERATOR PHONE NBR: (206)763-2345
OPERATOR EFFECTIVE DATE: 02/20/97
SITE CONTACT NAME: Anthony R Cabuco Sr
SITE CONTACT ADDR LINE1: 7152 1st Ave S
SITE CONTACT ZIP: Seattle, WA 98108
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)763-2345
SITE CONTACT EMAIL: rick.cabuco@iconserv.com
FORM CONTACT NAME: Anthony R Cabuco Sr
FORM CONTACT ADDR LINE1: 7152 1st Ave S
FORM CONTACT CITY,ST,ZIP: Seattle, WA 98108
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (206)763-2345
FORM CONTACT EMAIL: rick.cabuco@iconserv.com
GEN STATUS CD: SQG
MONTHLY GENERATION: False
BATCH GENERATION: False
ONE TIME GENERATION: True
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACLTY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

78
ENE
1/2-1
3746 ft.

PIONEER ENAMEL MANUFACTURE
5531 AIRPORT WAY S
SEATTLE, WA 98108

RCRA-SQG 1000312457
CSCSL WAD009277518
FINDS
CERC-NFRAP
BROWNFIELDS

Relative:
Higher


Actual:
19 ft.

RCRAInfo:
Owner: PIONEER PORCELAIN ENAMEL CO
EPA ID: WAD009277518
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

CSCSL:
Facility ID: 2161
warm_bin_n: 4
Prog plan code: Not reported
Latitude: 47.55305000
Longitude: -122.32069000
Lat/Long: 47.55305000 / -122.32069000
Lat/Long (dms): 47 33 10.9800 / 122 19 14.4800
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

PIONEER ENAMEL MANUFACTURE (Continued)

1000312457

Affected Media: 2775
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2161
warm_bin_n: 4
Prog plan code: Not reported
Latitude: 47.55305000
Longitude: -122.32069000
Lat/Long: 47.55305000 / -122.32069000
Lat/Long (dms): 47 33 10.9800 / 122 19 14.4800
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Suspected
Affected Media: 2776
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



EDR ID Number
EPA ID Number
Database(s)

PIONEER ENAMEL MANUFACTURE (Continued)

1000312457

Base/Neutral/Acid Organics:	Not reported
Halogenated Organic Compounds:	Not reported
EPA Priority Pollutants - Metals and Cyanide:	Suspected to be present
Metals - Other non-priority pollutant metals:	Not reported
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Not reported
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tributyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup):	Not reported
Facility ID:	2161
warm_bin_n:	4
Prog plan code:	Not reported
Latitude:	47.55305000
Longitude:	-122.32069000
Lat/Long:	47.55305000 / -122.32069000
Lat/Long (dms):	47 33 10.9800 / 122 19 14.4800
Media ID:	2
Media Type Desc:	Surface Water
Media Status Desc:	Suspected
Affected Media:	2777
Affected Media Status:	S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides:	Not reported
Petroleum Products:	Not reported
Phenolic Compounds:	Not reported
Reactive Wastes:	Not reported
Corrosive Wastes:	Not reported
Radioactive Wastes:	Not reported
Asbestos:	Not reported
Responsible Unit:	Northwest Region
Arsenic Code:	Not reported
MTBE Code:	Not reported
UXO Code:	Not reported
Dioxin:	Not reported
Non-Halogenated Solvents:	Not reported
Base/Neutral/Acid Organics:	Not reported
Halogenated Organic Compounds:	Not reported
EPA Priority Pollutants - Metals and Cyanide:	Suspected to be present
Metals - Other non-priority pollutant metals:	Not reported
Polychlorinated biPhenyls (PCBs):	Not reported
Polynuclear Aromatic Hydrocarbons (PAH):	Not reported
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tributyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup):	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

PIONEER ENAMEL MANUFACTURE (Continued)

1000312457

FINDS:

Other Pertinent Environmental Activity Identified at Site:

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

CERC-NFRAP:

Site ID: 1000652
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP

Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 06/01/1981
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: 12/05/1984
Date Completed: 03/21/1985
Priority Level: NFRAP (No Further Remedial Action Planned)

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 03/21/1985
Priority Level: Not reported

BROWNFIELDS:

Facility ID: 2161
Site Stat Code: 2

Facility ID: 2161
Site Stat Code: 2

Facility ID: 2161
Site Stat Code: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation



79
SSW
1/2-1
3817 ft.

WASTE MANAGEMENT OF SEATTLE
7201 W MARGINAL WAY SW
SEATTLE, WA 98106

Database(s)
EDR ID Number
EPA ID Number

RCRA-SQG 1004613533
CSCSL WAD041333576
FINDS
BROWNFIELDS
WA MANIFEST

Relative:
Higher

Actual:
19 ft.

RCRAInfo:
Owner: WASTE MANAGEMENT OF SEATTLE INC
EPA ID: WAD041333576
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

CSCSL:

Facility ID: 2425
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.53850000
Longitude: -122.33917000
Lat/Long: 47.53850000 / -122.33917000
Lat/Long (dms): 47 32 18.0000 / 122 20 21.0000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 3522
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2425
warm_bin_n: 5

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

WASTE MANAGEMENT OF SEATTLE (Continued)

1004613533

Prog plan code: Not reported
Latitude: 47.53850000
Longitude: -122.33917000
Lat/Long: 47.53850000 / -122.33917000
Lat/Long (dms): 47 32 18.0000 / 122 20 21.0000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Suspected
Affected Media: 3523
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2425
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.53850000
Longitude: -122.33917000
Lat/Long: 47.53850000 / -122.33917000
Lat/Long (dms): 47 32 18.0000 / 122 20 21.0000
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Suspected
Affected Media: 3524
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

WASTE MANAGEMENT OF SEATTLE (Continued)

1004613533

Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2425
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.53850000
Longitude: -122.33917000
Lat/Long: 47.53850000 / -122.33917000
Lat/Long (dms): 47 32 18.0000 / 122 20 21.0000
Media ID: 5
Media Type Desc: Sediment
Media Status Desc: Suspected
Affected Media: 3525
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site

Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

WASTE MANAGEMENT OF SEATTLE (Continued)

1004613633

Polynuclear Aromatic Hydrocarbons (PAH):	Not reported
Conventional Contaminants, Organic:	Not reported
Conventional Contaminants, Inorganic:	Not reported
Tributyl Tin Contaminant Group:	Not reported
Bioassay/Benthic Failures Contaminant Group:	Not reported
Wood Debris Contaminant Group:	Not reported
Other Deleterious Substance Group:	Not reported
Ecology Site Status (MTCA cleanup process):	Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup):	Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site:

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

BROWNFIELDS:

Facility ID: 2425
Site Stat Code: 2

Facility ID: 2425
Site Stat Code: 2

Facility ID: 2425
Site Stat Code: 2

Facility ID: 2425
Site Stat Code: 2

WA MANIFEST:

Facility Site ID Number:	2425
Permit by Rule:	False
Treatment by Generator:	False
Mixed radioactive waste:	False
Importer of hazardous waste:	False
Immediate recycler:	False
Treatment/Storage/Disposal/Recycling Facility:	False
Generator of dangerous fuel waste:	False
Generator marketing to burner:	False
"Other marketers (i.e., blender, distributor, etc.)":	False
Utility boiler burner:	False
Industry boiler burner:	False
Industrial Furnace:	False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

WASTE MANAGEMENT OF SEATTLE (Continued)

1004613533

Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD041333576
Facility Address 2: Not reported
TAX REG NBR: 601415286
NAICS CD: 562111
BUSINESS TYPE: Not reported
MAIL NAME: Eastmont Transfer Station
MAIL ADDR LINE1: 7201 W MARGINAL WAY SW
MAIL CITY,ST,ZIP: SEATTLE, WA 98106-1995
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Waste Management of Washington Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 1001 FANNIN STE 4000
LEGAL CITY,ST,ZIP: HOUSTON, TX 77002
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (713)512-6200
LEGAL EFFECTIVE DATE: 01/13/98
LAND ORG NAME: Waste Management of Washington Inc
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 1001 FANNIN STE 4000
LAND CITY,ST,ZIP: HOUSTON, TX 77002
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (713)512-6200
OPERATOR ORG NAME: WASTE MANAGEMENT OF SEATTLE INC
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 7901 1st Ave S
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108-4201
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 000-000-0000
OPERATOR EFFECTIVE DATE: 01/01/97
SITE CONTACT NAME: John Rasmussen
SITE CONTACT ADDR LINE1: 7201 W MARGINAL WAY SW
SITE CONTACT ZIP: SEATTLE, WA 98106-1912
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: (206)762-1152
SITE CONTACT EMAIL: Not reported
FORM CONTACT NAME: Tamara Gordy
FORM CONTACT ADDR LINE1: 13225 NE 126th Pl
FORM CONTACT CITY,ST,ZIP: KIRKLAND, WA 98034
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: (425)814-7834
FORM CONTACT EMAIL: tgordy@wm.com
GEN STATUS CD: XQG
MONTHLY GENERATION: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

WASTE MANAGEMENT OF SEATTLE (Continued)

1004613533

BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACLTY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

80
East
1/2-1
3923 ft.

UNOCAL SS 0907 ENSR INTNTL
1121 S BAILEY ST
SEATTLE, WA 98108

CSCSL S106878998
LUST N/A

Relative:
Higher

Actual:
19 ft.

CSCSL:

Facility ID: 2825755
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.54756600
Longitude: -122.31826200
Lat/Long: 47.54756600 / -122.31826200
Lat/Long (dms): 47 32 51.2376 / 122 19 5.7432
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 10993
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

UNOCAL SS 0907 ENSR INTNTL (Continued)

S106878998

Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

LUST:

FS ID: 2825755
Facility ID: 619093
Release ID: 591909
Alternate Name: UNOCAL SS 0907 (former) (x-ref: Tacoma Screw Products)
Release Notification Date: 12/29/2004 00:00:00
Release Status Date: 3/21/2002 00:00:00
Facility Status: Cleanup Started
Affected Media: Ground Water
Site Response Unit Code: NW
Lat/Long: 47.54756600000003 / -122.318262

FS ID: 2825755
Facility ID: 619093
Release ID: 591909
Alternate Name: UNOCAL SS 0907 (former) (x-ref: Tacoma Screw Products)
Release Notification Date: 12/29/2004 00:00:00
Release Status Date: 3/21/2002 00:00:00
Facility Status: Cleanup Started
Affected Media: Soil
Site Response Unit Code: NW
Lat/Long: 47.54756600000003 / -122.318262

81 MYRTLE STREET PROPERTY
SSE 606 S MYRTLE ST
1/2-1 SEATTLE, WA 98108
4028 ft.

CSCSL S104971231
N/A

Relative: CSCSL:
Equal Facility ID: 12153465
warm_bin_n: Not reported
Actual: Prog plan code: 4
9 ft. Latitude: 47.53911900
Longitude: -122.32564100
Lat/Long: 47.53911900 / -122.32564100
Lat/Long (dms): 47 32 20.8300 / 122 19 32.3100
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 7858
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

MYRTLE STREET PROPERTY (Continued)

S104971231

Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Facility ID: 12153465
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.53911900
Longitude: -122.32564100
Lat/Long: 47.53911900 / -122.32564100
Lat/Long (dms): 47 32 20.8300 / 122 19 32.3100
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 7857
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Independent Site Assessment of Interim Remedial Action Report received

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

82 KELLY MOORE PRESERVATIVE PAINT COMPANY
East 6101 AIRPORT WAY SOUTH
1/2-1 SEATTLE, WA 98108
4378 ft.

Relative:
Higher

Actual:
21 ft.

Database(s) EDR ID Number
EPA ID Number

CSCSL 1000380485
FINDS 98108PRSRV54
RCRA-LQG
TRIS
CERC-NFRAP
BROWNFIELDS
WA MANIFEST
ICR

CSCSL:

Facility ID: 2163
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.55347000
Longitude: -122.32240600
Lat/Long: 47.55347000 / -122.32240600
Lat/Long (dms): 47 33 12.4900 / 122 19 20.6600
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2778
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2163
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.55347000
Longitude: -122.32240600
Lat/Long: 47.55347000 / -122.32240600
Lat/Long (dms): 47 33 12.4900 / 122 19 20.6600
Media ID: 4
Media Type Desc: Soil

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s)
EDR ID Number
EPA ID Number

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

Media Status Desc:	Confirmed	
Affected Media:	2779	
Affected Media Status:	C	
Pesticides:	Not reported	
Petroleum Products:	Suspected to be present	
Phenolic Compounds:	Not reported	
Reactive Wastes:	Not reported	
Corrosive Wastes:	Not reported	
Radioactive Wastes:	Not reported	
Asbestos:	Not reported	
Responsible Unit:	Northwest Region	
Arsenic Code:	Not reported	
MTBE Code:	Not reported	
UXO Code:	Not reported	
Dioxin:	Not reported	
Non-Halogenated Solvents:	Confirmed above MTCA cleanup levels	
Base/Neutral/Acid Organics:	Not reported	
Halogenated Organic Compounds:	S	
EPA Priority Pollutants - Metals and Cyanide:	Suspected to be present	
Metals - Other non-priority pollutant metals:	Not reported	
Polychlorinated biPhenyls (PCBs):	Not reported	
Polynuclear Aromatic Hydrocarbons (PAH):	Not reported	
Conventional Contaminants, Organic:	Not reported	
Conventional Contaminants, Inorganic:	Not reported	
Tibutyl Tin Contaminant Group:	Not reported	
Bioassay/Benthic Failures Contaminant Group:	Not reported	
Wood Debris Contaminant Group:	Not reported	
Other Deleterious Substance Group:	Not reported	
Ecology Site Status (MTCA cleanup process):	Ranked, Awaiting Remedial Action (RA)	
Independent Site Status (independent cleanup):	Not reported	

FINDS:

Other Pertinent Environmental Activity Identified at Site:

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

RCRAInfo:

Owner: KELLY MOORE PAINT CO INC
(650)592-8337
EPA ID: WAD059315069
Contact: Not reported
Classification: Large Quantity Generator
TSDF Activities: Not reported

BIENNIAL REPORTS:

Last Biennial Reporting Year: 2003

<u>Waste</u>	<u>Quantity (Lbs)</u>	<u>Waste</u>	<u>Quantity (Lbs)</u>
D001	55424.19	D007	49764.19
D008	49764.19	D035	49764.19
F003	55424.19	F005	55424.19

Violation Status: Violations exist

Regulation Violated: -200(2)(a) / -170(2)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 12/10/2002
Actual Date Achieved Compliance: 03/11/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 01/17/2003
Penalty Type: Not reported

Regulation Violated: -630(5)(a) / -200(1)(b)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 12/10/2002
Actual Date Achieved Compliance: 03/11/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 01/17/2003
Penalty Type: Not reported

Regulation Violated: -060(5) / -170(2) / -220(1)
Area of Violation: GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined: 12/10/2002
Actual Date Achieved Compliance: 03/11/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 01/17/2003
Penalty Type: Not reported

Regulation Violated: -170(1)(a)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 12/10/2002
Actual Date Achieved Compliance: 03/11/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 01/17/2003
Penalty Type: Not reported

Regulation Violated: -630(3) / -200(1)(b)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 12/10/2002
Actual Date Achieved Compliance: 03/11/2003
Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 01/17/2003
Penalty Type: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

Regulation Violated:	-200(1)(b) / -630(5)(a)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/23/2001
Actual Date Achieved Compliance:	08/27/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/27/2001
Penalty Type:	Not reported
Regulation Violated:	-640(4)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/23/2001
Actual Date Achieved Compliance:	08/27/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/27/2001
Penalty Type:	Not reported
Regulation Violated:	-200(1)(c)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/23/2001
Actual Date Achieved Compliance:	08/27/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/27/2001
Penalty Type:	Not reported
Regulation Violated:	-200(1)(b) / -640(2-10)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/23/2001
Actual Date Achieved Compliance:	08/27/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/27/2001
Penalty Type:	Not reported
Regulation Violated:	-200(1)(d)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/23/2001
Actual Date Achieved Compliance:	08/27/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/27/2001
Penalty Type:	Not reported
Regulation Violated:	-630(7)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	05/23/2001
Actual Date Achieved Compliance:	08/27/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	07/27/2001
Penalty Type:	Not reported
Regulation Violated:	200(1)(c)(d)
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined:	06/18/1997
Actual Date Achieved Compliance:	06/19/1997
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	06/18/1997
Penalty Type:	Not reported
Regulation Violated:	630(7)

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 06/18/1997
Actual Date Achieved Compliance: 06/30/1997

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/18/1997
Penalty Type: Not reported

Regulation Violated: 630(6)
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 06/18/1997
Actual Date Achieved Compliance: 06/19/1997

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/18/1997
Penalty Type: Not reported

Regulation Violated: 330
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Date Violation Determined: 06/18/1997
Actual Date Achieved Compliance: 06/27/1997

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 06/18/1997
Penalty Type: Not reported

There are 15 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20030311
	GENERATOR-GENERAL REQUIREMENTS	20030311
	GENERATOR-GENERAL REQUIREMENTS	20030311
	GENERATOR-RECORDKEEPING REQUIREMENTS	20030311
	GENERATOR-GENERAL REQUIREMENTS	20030311
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	20010827
	GENERATOR-GENERAL REQUIREMENTS	20010827
	GENERATOR-GENERAL REQUIREMENTS	20010827
	GENERATOR-GENERAL REQUIREMENTS	20010827
	GENERATOR-GENERAL REQUIREMENTS	20010827
	GENERATOR-GENERAL REQUIREMENTS	20010827
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19970619
	GENERATOR-GENERAL REQUIREMENTS	19970630
	GENERATOR-GENERAL REQUIREMENTS	19970619
	GENERATOR-GENERAL REQUIREMENTS	19970627

CERC-NFRAP:

Site ID: 1000761
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP

CERCLIS Site Alias Name(s):

Alias Name: PRESERVATION PAINT COMPANY
Alias Address: 5400 ARPT WAY S
SEATTLE, WA 98108
Site Description: Not reported

CERCLIS Assessment History:

Action: DISCOVERY
Date Started: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

Date Completed: 09/01/1980
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: 05/21/1985
Date Completed: 06/06/1985
Priority Level: High

Action: SITE INSPECTION
Date Started: 10/20/1986
Date Completed: 11/18/1986
Priority Level: NFRAP (No Further Remedial Action Planned)

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 11/18/1986
Priority Level: Not reported

BROWNFIELDS:

Facility ID: 2163
Site Stat Code: 2

Facility ID: 2163
Site Stat Code: 2

WA MANIFEST:

Facility Site ID Number: 2163
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter defferal: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False
Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAD059315069
Facility Address 2: Not reported
TAX REG NBR: 178000204
NAICS CD: 44412

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

BUSINESS TYPE: Paint Manufacturer
MAIL NAME: Kelly Moore Paint Company
MAIL ADDR LINE1: 5400 Airport Way S
MAIL CITY,ST,ZIP: SEATTLE, WA 98108-1726
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Kelly Moore Paint Co Inc
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 1015 Commercial St
LEGAL CITY,ST,ZIP: SAN CARLOS, CA 94070
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: (650)592-8337
LEGAL EFFECTIVE DATE: 08/01/94
LAND ORG NAME: Kelly Moore Paint Co Inc
LAND ORG TYPE: Private
LAND PERSON NAME: Not reported
LAND ADDR LINE1: 1015 Commercial St
LAND CITY,ST,ZIP: SAN CARLOS, CA 94070
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: (650)592-8337
OPERATOR ORG NAME: Kelly-Moore Paint Company
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 5400 Airport Way South
OPERATOR CITY,ST,ZIP: SEATTLE, WA 98108-1726
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: (206) 763-0300,ext 264
OPERATOR EFFECTIVE DATE: 11/21/94
SITE CONTACT NAME: Kevin C Hudson
SITE CONTACT ADDR LINE1: 5400 AIRPORT WAY S
SITE CONTACT ZIP: SEATTLE, WA 98108-1726
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: 206763-0300,ext 264
SITE CONTACT EMAIL: khudson@kellymoore.com
FORM CONTACT NAME: Kevin C Hudson
FORM CONTACT ADDR LINE1: 5400 AIRPORT WAY S
FORM CONTACT CITY,ST,ZIP: SEATTLE, WA 98108-1726
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: 206763-0300,ext 264
FORM CONTACT EMAIL: khudson@kellymoore.com
GEN STATUS CD: LQG
MONTHLY GENERATION: True
BATCH GENERATION: False
ONE TIME GENERATION: False
TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: True
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACLT: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ICR:
Date Ecology Received Report: 06/26/1998

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KELLY MOORE PRESERVATIVE PAINT COMPANY (Continued)

1000380485

Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Interim cleanup report
Site Register Issue: 98-05
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

83
North
1/2-1
4438 ft.

BLOCH STEEL INDUSTRIES
4580 COLORADO AVE S
SEATTLE, WA 98134

RCRA-SQG 1000993050
CSCSL WAR000000745
FINDS
SPILLS
VCP

Relative:
Higher

RCRAInfo:

Actual:
12 ft.

Owner: LEO BLOCH
(206) 763-0200
EPA ID: WAR000000745
Contact: Not reported
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

CSCSL:

Facility ID: 57747142
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56063000
Longitude: -122.33678000
Lat/Long: 47.56063000 / -122.33678000
Lat/Long (dms): 47 33 38.0000 / 122 20 12.0000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 11059
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

BLOCH STEEL INDUSTRIES (Continued)

1000993050

Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 57747142
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56063000
Longitude: -122.33678000
Lat/Long: 47.56063000 / -122.33678000
Lat/Long (dms): 47 33 38.0000 / 122 20 12.0000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 7047
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 57747142
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56063000
Longitude: -122.33678000
Lat/Long: 47.56063000 / -122.33678000
Lat/Long (dms): 47 33 38.0000 / 122 20 12.0000

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

BLOCH STEEL INDUSTRIES (Continued)

1000993050

Media ID: 4
Media Type Desc: Soil
Media Status Desc: Remediated
Affected Media: 7048
Affected Media Status: R (Remediated) - Contaminants have been treated, removed, or contained to meet cleanup levels established for the site. (This status determination may only be made by Ecology)
Pesticides: Not reported
Petroleum Products: Treated, removed, or contained
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

SPILLS:

Facility ID: 526272
Medium: SOIL
Material Desc: TRANSFORMER OIL
Material Qty: 100
Material Units: GALLON
Date Received: 2002-05-06 00:00:00
Contact Name: Not reported
Company Name: PUGET SOUND ENERGY - PSE

Map ID
Direction
Distance
Distance (ft.)
Elevation



BLOCH STEEL INDUSTRIES (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000993050

VCP:

Facility ID: 57747142
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 57747142
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 57747142
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

84
SSW
1/2-1
4517 ft.

LAIDLAW
7739 1ST AVE S
SEATTLE, WA 98108

RCRA-SQG 1000189945
CSCSL WAD980836001
FINDS
HSL
VCP
ICR

Relative:
Higher

Actual:
19 ft.

RCRAInfo:

Owner: LAIDLAW TRANSIT INC
EPA ID: WAD980836001
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

CSCSL:

Facility ID: 2320
warm_bin_n: 4
Prog plan code: 4
Latitude: 47.53152000
Longitude: -122.33521000
Lat/Long: 47.53152000 / -122.33521000
Lat/Long (dms): 47 31 53.4700 / 122 20 6.7600
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Remediated
Affected Media: 3202
Affected Media Status: R (Remediated) - Contaminants have been treated, removed, or contained to meet cleanup levels established for the site. (This status determination may only be made by Ecology)
Pesticides: Not reported
Petroleum Products: Treated, removed, or contained
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

LAIDLAW (Continued)

1000189945

Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: R
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 2320
warm_bin_n: 4
Prog plan code: 4
Latitude: 47.53152000
Longitude: -122.33521000
Lat/Long: 47.53152000 / -122.33521000
Lat/Long (dms): 47 31 53.4700 / 122 20 6.7600
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 3203
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: C
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)

EDR ID Number
EPA ID Number

LIDLAW (Continued)

1000189945

Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

HSL:

Rank: 4
Facility Status: Independent RA
Facility Type: Hazardous Sites List
FSID Number: 2320

VCP:

Facility ID: 2320
Ecology Status: Independent Remedial Action
WARM BIN #: 4
NFA Code: Not reported
Program Plan: 4

Facility ID: 2320
Ecology Status: Independent Remedial Action
WARM BIN #: 4
NFA Code: Not reported
Program Plan: 4

ICR:

Date Ecology Received Report: 08/16/1999
Contaminants Found at Site: Petroleum products
Media Contaminated: Soil
Waste Management: Tank
Region: North Western
Type of Report Ecology Received: Not reported
Site Register Issue: 98-17
County Code: 17.00000
Contact: Not reported
Report Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation



Site

Database(s)

EDR ID Number
EPA ID Number

85 US GENERAL SERVICES ADMIN SEATTLE
NNW 4735 E MARGINAL WAY S
1/2-1 SEATTLE, WA 98124
4630 ft.

CSCSL 1007076215
FINDS 110015528678
VCP

Relative:
Higher

Actual:
10 ft.

CSCSL:

Facility ID: 10233917
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.55960000
Longitude: -122.34001000
Lat/Long: 47.55960000 / -122.34001000
Lat/Long (dms): 47 33 34.0000 / 122 20 24.0000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 9840
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 10233917
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.55960000
Longitude: -122.34001000
Lat/Long: 47.55960000 / -122.34001000
Lat/Long (dms): 47 33 34.0000 / 122 20 24.0000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 9839
Affected Media Status: C
Pesticides: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

US GENERAL SERVICES ADMIN SEATTLE (Continued)

1007076215

Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

VCP:

Facility ID: 10233917
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 10233917
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

86 ALASKA STREET PROPERTY
NNE 615 S ALASKA ST
1/2-1 SEATTLE, WA 98108
4966 ft.

CSCSL S105831619
N/A

Relative:
Higher

Actual:
17 ft.

CSCSL:

Facility ID: 8112883
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56063900
Longitude: -122.32650000
Lat/Long: 47.56063900 / -122.32650000
Lat/Long (dms): 47 33 38.3000 / 122 19 35.4000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 9492
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Confirmed above MTCA cleanup levels
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 8112883
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56063900
Longitude: -122.32650000
Lat/Long: 47.56063900 / -122.32650000
Lat/Long (dms): 47 33 38.3000 / 122 19 35.4000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 9491
Affected Media Status: C
Pesticides: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

ALASKA STREET PROPERTY (Continued)

S105831619

Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Confirmed above MTCA cleanup levels
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

U87
SE
1/2-1
5015 ft.

**BOEING NORTH FIELD JP4 TANKS
ELLIS AVE / E MARGINAL WAY
SEATTLE, WA 98108**

**CSCSL S102258021
N/A**

Relative:
Equal

Site 1 of 2 in cluster U

Actual:
9 ft.

CSCSL:
Facility ID: 2053
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.53882000
Longitude: -122.32053000
Lat/Long: 47.53882000 / -122.32053000
Lat/Long (dms): 47 32 19.7500 / 122 19 13.9100
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2536
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

BOEING NORTH FIELD JP4 TANKS (Continued)

S102258021

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2053
warm_bin_n: Not reported
Prog plan code: Not reported
Latitude: 47.53882000
Longitude: -122.32053000
Lat/Long: 47.53882000 / -122.32053000
Lat/Long (dms): 47 32 19.7500 / 122 19 13.9100
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2537
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant medals: Not reported
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Awaiting Site Hazard Assessment (SHA)
Independent Site Status (independent cleanup): Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

U88 STERNOFF METALS
SE 7201 E MARGINAL WY S
1/2-1 SEATTLE, WA 98108
5015 ft.

CSCSL S104320391
N/A

Site 2 of 2 in cluster U

Relative:
Equal

Actual:
9 ft.

CSCSL:

Facility ID: 2057
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.53874400
Longitude: -122.32203900
Lat/Long: 47.53874400 / -122.32203900
Lat/Long (dms): 47 32 19.4784 / 122 19 19.3404
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed
Affected Media: 2548
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (Independent cleanup): Not reported

Facility ID: 2057
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.53874400
Longitude: -122.32203900
Lat/Long: 47.53874400 / -122.32203900
Lat/Long (dms): 47 32 19.4784 / 122 19 19.3404
Media ID: 2
Media Type Desc: Surface Water
Media Status Desc: Suspected
Affected Media: 2549
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

STERNOFF METALS (Continued)

S104320391

operations or manufacturing processes, certain contaminants are suspected to be present at the site

Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Suspected to be present
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Not reported

Facility ID: 2057
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.53874400
Longitude: -122.32203900
Lat/Long: 47.53874400 / -122.32203900
Lat/Long (dms): 47 32 19.4784 / 122 19 19.3404
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2550
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Not reported
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

STERNOFF METALS (Continued)

S104320391

EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Not reported
Polychlorinated biPhenyls (PCBs): Confirmed above MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Not reported

V89 SAMIS LAND CO SITE
NNE 647 S ALASKA ST
1/2-1 SEATTLE, WA 98108
5027 ft.

CSCSL S101703229
N/A

Relative: Site 1 of 2 in cluster V

Higher CSCSL:
Facility ID: 2229
Actual: warm_bin_n: 5
18 ft. Prog plan code: Not reported
Latitude: 47.56093800
Longitude: -122.32516600
Lat/Long: 47.56093800 / -122.32516600
Lat/Long (dms): 47 33 39.3800 / 122 19 30.6000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 2922
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported

Non-Halogenated Solvents: Confirmed above MTCA cleanup levels
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Suspected to be present
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Suspected to be present
Conventional Contaminants, Inorganic: Suspected to be present
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



EDR ID Number
EPA ID Number
Database(s)

SAMIS LAND CO SITE (Continued)

S101703229

Independent Site Status (independent cleanup): Not reported

Facility ID: 2229
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.56093800
Longitude: -122.32516600
Lat/Long: 47.56093800 / -122.32516600
Lat/Long (dms): 47 33 39.3800 / 122 19 30.6000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Suspected
Affected Media: 2923
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Suspected to be present
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Suspected to be present
Conventional Contaminants, Inorganic: Suspected to be present
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

Facility ID: 2229
warm_bin_n: 5
Prog plan code: Not reported
Latitude: 47.56093800
Longitude: -122.32516600
Lat/Long: 47.56093800 / -122.32516600
Lat/Long (dms): 47 33 39.3800 / 122 19 30.6000
Media ID: 3
Media Type Desc: Air
Media Status Desc: Suspected
Affected Media: 2924
Affected Media Status: S (Suspected) - Due to preliminary investigations or the nature of business operations or manufacturing processes, certain contaminants are suspected to be

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site



Database(s)
EDR ID Number
EPA ID Number

SAMIS LAND CO SITE (Continued)

S101703229

present at the site
Pesticides: Not reported
Petroleum Products: Suspected to be present
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Suspected to be present
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: S
EPA Priority Pollutants - Metals and Cyanide: Suspected to be present
Metals - Other non-priority pollutant metals: Suspected to be present
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Suspected to be present
Conventional Contaminants, Inorganic: Suspected to be present
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Ranked, Awaiting Remedial Action (RA)
Independent Site Status (independent cleanup): Not reported

V90
NNE
1/2-1
5035 ft.

**FEDEX EXPRESS - BFIA
651 S ALASKA ST
SEATTLE, WA 98108**

RCRA-SQG 1005445442
CSCSL WAH000017137
FINDS
VCP
WA MANIFEST

Relative:
Higher

Actual:
18 ft.

RCRAInfo:

Owner: FEDERAL EXPRESS CORP BFIA
000-000-0000
EPA ID: WAH000017137
Contact: CLARK MILLER
206332-7272

Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

CSCSL:

Facility ID: 73876963
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56061100
Longitude: -122.32380400
Lat/Long: 47.56061100 / -122.32380400
Lat/Long (dms): 47 33 38.2000 / 122 19 25.7000
Media ID: 1
Media Type Desc: Groundwater
Media Status Desc: Confirmed

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

FEDEX EXPRESS - BFIA (Continued)

1006445442

Affected Media: 8337
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Below MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported
EPA Priority Pollutants - Metals and Cyanide: Confirmed above MTCA cleanup levels
Metals - Other non-priority pollutant metals: Confirmed above MTCA cleanup levels
Polychlorinated biPhenyls (PCBs): Not reported
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tributyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

Facility ID: 73876963
warm_bin_n: Not reported
Prog plan code: 4
Latitude: 47.56061100
Longitude: -122.32380400
Lat/Long: 47.56061100 / -122.32380400
Lat/Long (dms): 47 33 38.2000 / 122 19 25.7000
Media ID: 4
Media Type Desc: Soil
Media Status Desc: Confirmed
Affected Media: 8336
Affected Media Status: C
Pesticides: Not reported
Petroleum Products: Confirmed above MTCA cleanup levels
Phenolic Compounds: Not reported
Reactive Wastes: Not reported
Corrosive Wastes: Not reported
Radioactive Wastes: Not reported
Asbestos: Not reported
Responsible Unit: Northwest Region
Arsenic Code: Not reported
MTBE Code: Not reported
UXO Code: Not reported
Dioxin: Not reported
Non-Halogenated Solvents: Not reported
Base/Neutral/Acid Organics: Not reported
Halogenated Organic Compounds: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s)
EDR ID Number
EPA ID Number

FEDEX EXPRESS - BFIA (Continued)

1005445442

EPA Priority Pollutants - Metals and Cyanide: Not reported
Metals - Other non-priority pollutant metals: Confirmed above MTCA cleanup levels
Polychlorinated biPhenyls (PCBs): Below MTCA cleanup levels
Polynuclear Aromatic Hydrocarbons (PAH): Not reported
Conventional Contaminants, Organic: Not reported
Conventional Contaminants, Inorganic: Not reported
Tibutyl Tin Contaminant Group: Not reported
Bioassay/Benthic Failures Contaminant Group: Not reported
Wood Debris Contaminant Group: Not reported
Other Deleterious Substance Group: Not reported
Ecology Site Status (MTCA cleanup process): Independent Remedial Action
Independent Site Status (independent cleanup): Final Independent Remedial Action Report received

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

WA-DOEFSIS (Washington - Department Of Ecology Facility / Site Identification System) is the Department of Ecology's Facility/Site identification system that provides a means to query and display data maintained by the Department of Ecology. This system contains key information for each facility/site that is currently, or has been, of interest to the departments Air Quality, Dam Safety, Hazardous Waste, Toxics Cleanup, and Water Quality Programs.

VCP:


Facility ID: 73876963
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

Facility ID: 73876963
Ecology Status: Independent Remedial Action
WARM BIN #: Not reported
NFA Code: Not reported
Program Plan: 4

WA MANIFEST:

Facility Site ID Number: 73876963
Permit by Rule: False
Treatment by Generator: False
Mixed radioactive waste: False
Importer of hazardous waste: False
Immediate recycler: False
Treatment/Storage/Disposal/Recycling Facility: False
Generator of dangerous fuel waste: False
Generator marketing to burner: False
"Other marketers (i.e., blender, distributor, etc.)": False
Utility boiler burner: False
Industry boiler burner: False
Industrial Furnace: False
Smelter deferral: False
Universal waste - batteries - generate: False
Universal waste - thermostats - generate: False
Universal waste - mercury - generate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site



Database(s) EDR ID Number
EPA ID Number

FEDEX EXPRESS - BFIA (Continued)

1005445442

Universal waste - lamps - generate: False
Universal waste - batteries - accumulate: False
Universal waste - thermostats - accumulate: False
Universal waste - mercury - accumulate: False
Universal waste - lamps - accumulate: False
Destination Facility for Universal Waste: False
Off-specification used oil burner - utility boiler: False
Off-specification used oil burner - industrial boiler: False
Off-specification used oil burner - industrial furnace: False
EPA ID: WAH000017137
Facility Address 2: Not reported
TAX REG NBR: 602034776
NAICS CD: 481112
BUSINESS TYPE: Air Courier Service
MAIL NAME: FedEx Express - BFIA
MAIL ADDR LINE1: 651 S ALASKA ST
MAIL CITY,ST,ZIP: SEATTLE, WA 98108
MAIL COUNTRY: UNITED STATES
LEGAL ORG NAME: Federal Express Corporation
LEGAL ORG TYPE: Private
LEGAL ADDR LINE1: 3620 Hacks Cross Rd
LEGAL ADDR LINE2: Bldg b, 2nd Flr
LEGAL CITY,ST,ZIP: Memphis, TN 38125-7113
LEGAL COUNTRY: UNITED STATES
LEGAL PHONE NBR: 901/434-8460
LEGAL EFFECTIVE DATE: 01/23/02
LAND ORG NAME: Samis Foundation
LAND ORG TYPE: Private
LAND PERSON NAME: Adam Hasson
LAND ADDR LINE1: 208 James St
LAND CITY,ST,ZIP: SEATTLE, WA 98104-2220
LAND COUNTRY: UNITED STATES
LAND PHONE NBR: 000-000-0000
OPERATOR ORG NAME: FedEx Express - BFIA
OPERATOR ORG TYPE: Private
OPERATOR ADDR LINE1: 651 S. Alaska Street
OPERATOR CITY,ST,ZIP: Seattle, WA 98108
OPERATOR COUNTRY: UNITED STATES
OPERATOR PHONE NBR: 206/332-7272
OPERATOR EFFECTIVE DATE: / /
SITE CONTACT NAME: Clark A Miller
SITE CONTACT ADDR LINE1: 651 S ALASKA ST
SITE CONTACT ZIP: SEATTLE, WA 98108
SITE CONTACT COUNTRY: UNITED STATES
SITE CONTACT PHONE NBR: 206332-7272
SITE CONTACT EMAIL: camiller@fedex.com
FORM CONTACT NAME: Barbara Hodick
FORM CONTACT ADDR LINE1: 3620 Hacks Cross Road
FORM CONTACT ADDR LINE2: Building B, Second Floor
FORM CONTACT CITY,ST,ZIP: Memphis, TN 38125-7113
FORM CONTACT COUNTRY: UNITED STATES
FORM CONTACT PHONE NBR: 901-434-8460
FORM CONTACT EMAIL: bhodick@fedex.com
GEN STATUS CD: SQG
MONTHLY GENERATION: True
BATCH GENERATION: False
ONE TIME GENERATION: False

Map ID
Direction
Distance
Distance (ft.)
Elevation



FEDEX EXPRESS - BFIA (Continued)

EDR ID Number
EPA ID Number

Database(s)

1005445442

TRANSPORTS OWN WASTE: False
TRANSPORTS OTHRS WASTE: False
RECYCLER ONSITE: False
TRANSFER FACILITY: False
OTHER EXEMPTION: Not reported
UW BATTERY GEN: False
USED OIL TRANSPORTER: False
USED OIL TRANSFER FACILITY: False
USED OIL PROCESSOR: False
USED OIL REREFINER: False
USED OIL FUEL MRKTR DIRECTS SHPMNTS: False
USED OIL FUEL MRKTR MEETS SPECS: False

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
KING COUNTY	S105806018	FACTORIA PIT (SUNSET RAVINE PARK)	NORTHWEST OF 135TH AVE S.E. AN		SWF&F
SEATTLE	1001490840	SEATTLE CITY ENG DEPT 12TH AVE S	12TH AVE S BETWEEN S LN & S CH	98134	RCRA-SQG, FINDS
SEATTLE	1005445484	SEATTLE PUBLIC UTILITIES HBR. ISL.	13TH AVE SW & SW FLORIDA 300 F	98134	RCRA-SQG, FINDS, WA MANIFEST
SEATTLE	1007070336	RICCHIAZZI INDUSTRIAL PROPERTY	4424 & 4500 4TH AVE S	98108	FINDS, VCP, INST CONTROL
SEATTLE	1007265450	WA DOT BRG 099530E	SR 09 1ST AVE S BRG MP 26.27 T	98108	RCRA-SQG, WA MANIFEST
SEATTLE	S107872236	SEATTLE CITY DOT AIRPORT WAY ARGO	AIRPORT WAY S BETWEEN SUMMERVI	98108	WA MANIFEST
SEATTLE	1001490824	SEATTLE CITY ENG DEPT AIRPORT WAY	AIRPORT WAY S & DAWSON ST S	98108	RCRA-SQG, FINDS
SEATTLE	U003353849	CITY OF SEATTLE WATER DEPARTMENT	2700 AIRPORT WAY S	98134	UST
SEATTLE	1005445149	SEATTLE CITY AIRPORT WAY PAINT SHO	2203 AIRPORT WAY S BLDG 800 ST	98134	RCRA-SQG, FINDS
SEATTLE	S105430774	SEATTLE CITY LIGHT STEAMPLANT GEOR	6700 13TH AVE S	98108	CSCSL
SEATTLE	1007077645	SEATTLE CITY LIGHT STEAMPLANT GEOR	6700 13TH AVE S	98108	FINDS, BROWNFIELDS
SEATTLE	U003353907	METRO TRANSIT	2255 4TH AVE S	98134	UST
SEATTLE	1008388160	KING RESIDENCE	6518 16TH AVE SW	98106	CSCSL, FINDS
SEATTLE	1007079199	PACIFIC EXPRESS	3215 4TH AVE S	98134	CSCSL, FINDS, VCP
SEATTLE	1007080611	FIRST AVE BRIDGE LANDFILL	7700 BLOCK OF 2ND AVE SW	98106	FINDS, BROWNFIELDS
SEATTLE	1000878933	1ST AVE S S MICHIGA	NW COR OF 1ST AVE S & S MICHIG	98108	RCRA-SQG, FINDS
SEATTLE	1001491008	1ST AVE BRG BBC2	NE COR S MICHIGAN ST & 1ST AVE	98108	RCRA-SQG, FINDS
SEATTLE	S107565999	PROLANCE INTERNATIONAL INC	115 S DAWSON ST	98108	CSCSL, VCP
SEATTLE	1003880504	BOEING COMPANY N FIELD SEATTLE CY	ELLIS AV & WILLOW ST INTERSECT	98108	CERC-NFRAP
SEATTLE	1003880499	SEATTLE, CY OF, 1ST AV BRG LDPL	E MARGINAL WY S & FIDALGO ST	98108	CERC-NFRAP
SEATTLE	U004040891	LONGVIEW FIBRE COMPANY	5901 E MARGINAL WAY S	98134	UST
SEATTLE	U004020761	SEATTLE STEEL INC INDUSTRIAL FSTNR	3900 W MARGINAL WAY SWC 3827	98106	UST
SEATTLE	1000366528	METRO TERM 117	W MARGINAL WAY S TERM 117	98106	RCRA-SQG, FINDS
SEATTLE	1008410612	PAINTING BUSINESS/CENTRAL PAINTING	WEST MARGINAL WAY SOUTH	98106	US BROWNFIELDS
SEATTLE	U004021342	VACANT	4842 MARGINAL WAY S W	98106	UST
SEATTLE	U003353817	JAMES HARDIE GYPSUM	5931 E MARGINAL WAY SO	98134	UST
SEATTLE	S107566013	SONN PROPERTY	950 S NEBRASKA ST	98108	CSCSL
SEATTLE	S105805989	GENESEE LANDFILL	NORTH OF SOUTH ALASKA STREET T		SWF&F
SEATTLE	S107672208	UPS SEATTLE IMPORT	9130 15TH PL S STE E	98108	WA MANIFEST

EPA Waste Codes Addendum

Code	Description
D001	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
D002	A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
D003	A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
D004	ARSENIC
D005	BARIUM
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D009	MERCURY
D010	SELENIUM
D011	SILVER
D018	BENZENE
D019	CARBON TETRACHLORIDE
D021	CHLOROBENZENE
D022	CHLOROFORM
D030	2,4-DINITROTOLUENE
D035	METHYL ETHYL KETONE
D039	TETRACHLOROETHYLENE

EPA Waste Codes Addendum

Code	Description
F001	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F002	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F003	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F004	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: CRESOLS AND CRESYLIC ACID, AND NITROBENZENE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F005	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F007	SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS
U210	ETHENE, TETRACHLORO-
U210	TETRACHLOROETHYLENE
U226	ETHANE, 1,1,1-TRICHLORO-
U226	METHYL CHLOROFORM

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

FEDERAL RECORDS

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 07/05/2006	Source: EPA
Date Data Arrived at EDR: 08/02/2006	Telephone: N/A
Date Made Active in Reports: 09/12/2006	Last EDR Contact: 08/02/2006
Number of Days to Update: 41	Next Scheduled EDR Contact: 10/30/2006
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

Date of Government Version: 07/05/2006	Source: EPA
Date Data Arrived at EDR: 08/02/2006	Telephone: N/A
Date Made Active in Reports: 09/12/2006	Last EDR Contact: 08/02/2006
Number of Days to Update: 41	Next Scheduled EDR Contact: 10/30/2006
	Data Release Frequency: Quarterly

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 07/05/2006	Source: EPA
Date Data Arrived at EDR: 08/02/2006	Telephone: N/A
Date Made Active in Reports: 09/12/2006	Last EDR Contact: 08/02/2006
Number of Days to Update: 41	Next Scheduled EDR Contact: 10/30/2006
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED/ DATA CURRENCY TRACKING

NPL RECOVERY: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/21/2006
Next Scheduled EDR Contact: 11/20/2006
Data Release Frequency: No Update Planned

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 06/19/2006
Date Data Arrived at EDR: 06/22/2006
Date Made Active in Reports: 08/23/2006
Number of Days to Update: 52

Source: EPA
Telephone: 703-413-0223
Last EDR Contact: 06/22/2006
Next Scheduled EDR Contact: 09/18/2006
Data Release Frequency: Quarterly

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 07/17/2006
Date Data Arrived at EDR: 08/02/2006
Date Made Active in Reports: 09/12/2006
Number of Days to Update: 41

Source: EPA
Telephone: 703-413-0223
Last EDR Contact: 06/23/2006
Next Scheduled EDR Contact: 09/18/2006
Data Release Frequency: Quarterly

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/15/2006
Date Data Arrived at EDR: 03/17/2006
Date Made Active in Reports: 04/13/2006
Number of Days to Update: 27

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 09/05/2006
Next Scheduled EDR Contact: 12/04/2006
Data Release Frequency: Quarterly

RCRA: Resource Conservation and Recovery Act Information

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. *Transporters are individuals or entities that move hazardous waste from the generator off-site to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.*

Date of Government Version: 06/13/2006	Source: EPA
Date Data Arrived at EDR: 06/28/2006	Telephone: 800-424-9346
Date Made Active in Reports: 08/23/2006	Last EDR Contact: 08/22/2006
Number of Days to Update: 56	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/2005	Source: National Response Center, United States Coast Guard
Date Data Arrived at EDR: 01/12/2006	Telephone: 202-260-2342
Date Made Active in Reports: 02/21/2006	Last EDR Contact: 07/25/2006
Number of Days to Update: 40	Next Scheduled EDR Contact: 10/23/2006
	Data Release Frequency: Annually

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 07/03/2006	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 07/19/2006	Telephone: 202-366-4555
Date Made Active in Reports: 08/23/2006	Last EDR Contact: 07/19/2006
Number of Days to Update: 35	Next Scheduled EDR Contact: 10/16/2006
	Data Release Frequency: Annually

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 03/21/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/27/2006	Telephone: 703-603-8905
Date Made Active in Reports: 05/22/2006	Last EDR Contact: 09/07/2006
Number of Days to Update: 56	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 03/21/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/27/2006	Telephone: 703-603-8905
Date Made Active in Reports: 05/22/2006	Last EDR Contact: 09/07/2006
Number of Days to Update: 56	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2004	Source: USGS
Date Data Arrived at EDR: 02/08/2005	Telephone: 703-692-8801
Date Made Active in Reports: 08/04/2005	Last EDR Contact: 08/11/2006
Number of Days to Update: 177	Next Scheduled EDR Contact: 11/06/2006
	Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/05/2005	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 01/19/2006	Telephone: 202-528-4285
Date Made Active in Reports: 02/21/2006	Last EDR Contact: 07/17/2006
Number of Days to Update: 33	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Varies

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities—especially those without EPA Brownfields Assessment Demonstration Pilots—minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients—States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 07/10/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/13/2006	Telephone: 202-566-2777
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 09/11/2006
Number of Days to Update: 55	Next Scheduled EDR Contact: 12/11/2006
	Data Release Frequency: Semi-Annually

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/14/2004	Source: Department of Justice, Consent Decree Library
Date Data Arrived at EDR: 02/15/2005	Telephone: Varies
Date Made Active in Reports: 04/25/2005	Last EDR Contact: 07/24/2006
Number of Days to Update: 69	Next Scheduled EDR Contact: 10/23/2006
	Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 07/10/2006	Source: EPA
Date Data Arrived at EDR: 07/21/2006	Telephone: 703-416-0223
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 07/06/2006
Number of Days to Update: 47	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 11/04/2005	Source: Department of Energy
Date Data Arrived at EDR: 11/28/2005	Telephone: 505-845-0011
Date Made Active in Reports: 01/30/2006	Last EDR Contact: 09/05/2006
Number of Days to Update: 63	Next Scheduled EDR Contact: 12/18/2006
	Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/09/2004	Telephone: 800-424-9346
Date Made Active in Reports: 09/17/2004	Last EDR Contact: 06/09/2004
Number of Days to Update: 39	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 07/20/2006	Source: EPA
Date Data Arrived at EDR: 07/21/2006	Telephone: 202-564-6064
Date Made Active in Reports: 08/22/2006	Last EDR Contact: 07/06/2006
Number of Days to Update: 32	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Quarterly

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2004	Source: EPA
Date Data Arrived at EDR: 06/22/2006	Telephone: 202-566-0250
Date Made Active in Reports: 08/23/2006	Last EDR Contact: 06/22/2006
Number of Days to Update: 62	Next Scheduled EDR Contact: 09/18/2006
	Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2002	Source: EPA
Date Data Arrived at EDR: 04/14/2006	Telephone: 202-260-5521
Date Made Active in Reports: 05/30/2006	Last EDR Contact: 07/17/2006
Number of Days to Update: 46	Next Scheduled EDR Contact: 10/16/2006
	Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/14/2006	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 07/18/2006	Telephone: 202-566-1667
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 06/19/2006
Number of Days to Update: 50	Next Scheduled EDR Contact: 09/18/2006
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Date of Government Version: 07/14/2006	Source: EPA
Date Data Arrived at EDR: 07/18/2006	Telephone: 202-566-1667
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 06/19/2006
Number of Days to Update: 50	Next Scheduled EDR Contact: 09/18/2006
	Data Release Frequency: Quarterly

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2004	Source: EPA
Date Data Arrived at EDR: 05/11/2006	Telephone: 202-564-4203
Date Made Active in Reports: 05/22/2006	Last EDR Contact: 07/17/2006
Number of Days to Update: 11	Next Scheduled EDR Contact: 10/16/2006
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 02/13/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 04/21/2006	Telephone: 202-564-5088
Date Made Active in Reports: 05/11/2006	Last EDR Contact: 07/17/2006
Number of Days to Update: 20	Next Scheduled EDR Contact: 10/16/2006
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 07/07/2006	Source: EPA
Date Data Arrived at EDR: 08/09/2006	Telephone: 202-566-0500
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 08/09/2006
Number of Days to Update: 28	Next Scheduled EDR Contact: 11/06/2006
	Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/10/2006	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 07/20/2006	Telephone: 301-415-7169
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 07/03/2006
Number of Days to Update: 48	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Quarterly

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 05/16/2006	Source: Department of Labor, Mine Safety and Health Administration
Date Data Arrived at EDR: 06/28/2006	Telephone: 303-231-5959
Date Made Active in Reports: 08/23/2006	Last EDR Contact: 06/28/2006
Number of Days to Update: 56	Next Scheduled EDR Contact: 09/25/2006
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/21/2006

Source: EPA

Date Data Arrived at EDR: 07/25/2006

Telephone: N/A

Date Made Active in Reports: 09/06/2006

Last EDR Contact: 04/03/2006

Number of Days to Update: 43

Next Scheduled EDR Contact: 07/03/2006

Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995

Source: EPA

Date Data Arrived at EDR: 07/03/1995

Telephone: 202-564-4104

Date Made Active in Reports: 08/07/1995

Last EDR Contact: 09/05/2006

Number of Days to Update: 35

Next Scheduled EDR Contact: 12/04/2006

Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2003

Source: EPA/NTIS

Date Data Arrived at EDR: 06/17/2005

Telephone: 800-424-9346

Date Made Active in Reports: 08/04/2005

Last EDR Contact: 07/21/2006

Number of Days to Update: 48

Next Scheduled EDR Contact: 09/11/2006

Data Release Frequency: Biennially

STATE AND LOCAL RECORDS

CSCSL: Confirmed & Suspected Contaminated Sites List

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 08/17/2006

Source: Department of Ecology

Date Data Arrived at EDR: 08/29/2006

Telephone: 360-407-7200

Date Made Active in Reports: 09/05/2006

Last EDR Contact: 08/29/2006

Number of Days to Update: 7

Next Scheduled EDR Contact: 11/13/2006

Data Release Frequency: Semi-Annually

HSL: Hazardous Sites List

The Hazardous Sites List is a subset of the CSCSL Report. It includes sites which have been assessed and ranked using the Washington Ranking Method (WARM).

Date of Government Version: 02/22/2006

Source: Department of Ecology

Date Data Arrived at EDR: 03/27/2006

Telephone: 360-407-7200

Date Made Active in Reports: 04/13/2006

Last EDR Contact: 09/06/2006

Number of Days to Update: 17

Next Scheduled EDR Contact: 12/04/2006

Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CSCSL NFA: Confirmed & Contaminated Sites - No Further Action

The data set contains information about sites previously on the Confirmed and Suspected Contaminated Sites list that have received a No Further Action (NFA) determination. Because it is necessary to maintain historical records of sites that have been investigated and cleaned up, sites are not deleted from the database when cleanup activities are completed. Instead, a No Further Action code is entered based upon the type of NFA determination the site received.

Date of Government Version: 08/17/2006	Source: Department of Ecology
Date Data Arrived at EDR: 08/29/2006	Telephone: 360-407-7170
Date Made Active in Reports: 09/05/2006	Last EDR Contact: 08/29/2006
Number of Days to Update: 7	Next Scheduled EDR Contact: 11/13/2006
	Data Release Frequency: Semi-Annually

SWF/LF: Solid Waste Facility Database

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 10/01/2004	Source: Department of Ecology
Date Data Arrived at EDR: 01/06/2005	Telephone: 360-407-6132
Date Made Active in Reports: 02/02/2005	Last EDR Contact: 07/07/2006
Number of Days to Update: 27	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Annually

SWTIRE: Solid Waste Tire Facilities

This study identified sites statewide with unauthorized accumulations of scrap tires.

Date of Government Version: 11/01/2005	Source: Department of Ecology
Date Data Arrived at EDR: 03/16/2006	Telephone: N/A
Date Made Active in Reports: 04/13/2006	Last EDR Contact: 07/07/2006
Number of Days to Update: 28	Next Scheduled EDR Contact: 10/02/2006
	Data Release Frequency: Varies

LUST: Leaking Underground Storage Tanks Site List

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 06/08/2006	Source: Department of Ecology
Date Data Arrived at EDR: 06/14/2006	Telephone: 360-407-7200
Date Made Active in Reports: 07/27/2006	Last EDR Contact: 06/14/2006
Number of Days to Update: 43	Next Scheduled EDR Contact: 09/11/2006
	Data Release Frequency: Quarterly

UST: Underground Storage Tank Database

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 06/08/2006	Source: Department of Ecology
Date Data Arrived at EDR: 06/14/2006	Telephone: 360-407-7170
Date Made Active in Reports: 07/27/2006	Last EDR Contact: 06/14/2006
Number of Days to Update: 43	Next Scheduled EDR Contact: 09/11/2006
	Data Release Frequency: Quarterly

AST: Aboveground Storage Tank Locations

A listing of aboveground storage tank locations regulated by the Department of Ecology's Spill Prevention, Preparedness and Response Program.

GOVERNMENT RECORDS SEARCHED//DATA CURRENCY TRACKING

Date of Government Version: 12/13/2005
Date Data Arrived at EDR: 12/14/2005
Date Made Active in Reports: 01/16/2006
Number of Days to Update: 33

Source: Department of Ecology
Telephone: 360-407-7562
Last EDR Contact: 08/29/2006
Next Scheduled EDR Contact: 11/27/2006
Data Release Frequency: Varies

MANIFEST: Hazardous Waste Manifest Data Hazardous waste manifest information.

Date of Government Version: 12/31/2004
Date Data Arrived at EDR: 04/24/2006
Date Made Active in Reports: 05/31/2006
Number of Days to Update: 37

Source: Department of Ecology
Telephone: N/A
Last EDR Contact: 08/15/2006
Next Scheduled EDR Contact: 11/13/2006
Data Release Frequency: Annually

SPILLS: Reported Spills

Spills reported to the Spill Prevention, Preparedness and Response Division.

Date of Government Version: 07/31/2006
Date Data Arrived at EDR: 08/01/2006
Date Made Active in Reports: 09/05/2006
Number of Days to Update: 35

Source: Department of Ecology
Telephone: 360-407-7450
Last EDR Contact: 07/31/2006
Next Scheduled EDR Contact: 10/02/2006
Data Release Frequency: Semi-Annually

INST CONTROL: Institutional Control Site List Sites that have institutional controls.

Date of Government Version: 06/06/2006
Date Data Arrived at EDR: 06/06/2006
Date Made Active in Reports: 06/27/2006
Number of Days to Update: 21

Source: Department of Ecology
Telephone: 360-407-7170
Last EDR Contact: 09/05/2006
Next Scheduled EDR Contact: 12/04/2006
Data Release Frequency: Varies

VCP: Voluntary Cleanup Program Sites

Sites that have entered either the Voluntary Cleanup Program or its predecessor Independent Remedial Action Program.

Date of Government Version: 08/17/2006
Date Data Arrived at EDR: 08/29/2006
Date Made Active in Reports: 09/05/2006
Number of Days to Update: 7

Source: Department of Ecology
Telephone: 360-407-7200
Last EDR Contact: 08/29/2006
Next Scheduled EDR Contact: 11/13/2006
Data Release Frequency: Varies

ICR: Independent Cleanup Reports

These are remedial action reports Ecology has received from either the owner or operator of the sites. These actions have been conducted without department oversight or approval and are not under an order or decree. This database is no longer updated by the Department of Ecology.

Date of Government Version: 12/01/2002
Date Data Arrived at EDR: 01/03/2003
Date Made Active in Reports: 01/22/2003
Number of Days to Update: 19

Source: Department of Ecology
Telephone: 360-407-7200
Last EDR Contact: 08/15/2006
Next Scheduled EDR Contact: 11/13/2006
Data Release Frequency: No Update Planned

DRYCLEANERS: Drycleaner List

A listing of registered drycleaners who registered with the Department of Ecology (using the SIC code of 7215 and 7216) as hazardous waste generators.

Date of Government Version: 01/12/2006
Date Data Arrived at EDR: 03/23/2006
Date Made Active in Reports: 04/13/2006
Number of Days to Update: 21

Source: Department of Ecology
Telephone: 360-407-6732
Last EDR Contact: 08/15/2006
Next Scheduled EDR Contact: 11/13/2006
Data Release Frequency: Varies

BROWNFIELDS: Brownfields Sites Listing

A listing of brownfields sites included in the Confirmed & Suspected Sites Listing. Brownfields are abandoned, idle or underused commercial or industrial properties, where the expansion or redevelopment is hindered by real or perceived contamination. Brownfields vary in size, location, age, and past use -- they can be anything from a five-hundred acre automobile assembly plant to a small, abandoned corner gas station.

Date of Government Version: 08/10/2006	Source: Department of Ecology
Date Data Arrived at EDR: 08/17/2006	Telephone: 360-725-4030
Date Made Active in Reports: 09/05/2006	Last EDR Contact: 08/17/2006
Number of Days to Update: 19	Next Scheduled EDR Contact: 11/13/2006
	Data Release Frequency: Varies

CDL: Clandestine Drug Lab Contaminated Site List

Illegal methamphetamine labs use hazardous chemicals that create public health hazards. Chemicals and residues can cause burns, respiratory and neurological damage, and death. Biological hazards associated with intravenous needles, feces, and blood also pose health risks.

Date of Government Version: 05/23/2006	Source: Department of Health
Date Data Arrived at EDR: 06/07/2006	Telephone: 360-236-3380
Date Made Active in Reports: 06/27/2006	Last EDR Contact: 09/07/2006
Number of Days to Update: 20	Next Scheduled EDR Contact: 12/04/2006
	Data Release Frequency: Varies

NPDES: Water Quality Permit System Data

A listing of permitted wastewater facilities.

Date of Government Version: 08/16/2006	Source: Department of Ecology
Date Data Arrived at EDR: 08/17/2006	Telephone: 360-407-6073
Date Made Active in Reports: 09/05/2006	Last EDR Contact: 08/17/2006
Number of Days to Update: 19	Next Scheduled EDR Contact: 11/13/2006
	Data Release Frequency: Quarterly

EMI: Washington Emissions Data System

Date of Government Version: 12/31/2004	Source: Department of Ecology
Date Data Arrived at EDR: 03/16/2006	Telephone: 360-407-6040
Date Made Active in Reports: 04/13/2006	Last EDR Contact: 07/17/2006
Number of Days to Update: 28	Next Scheduled EDR Contact: 10/16/2006
	Data Release Frequency: Annually

INACTIVE DRYCLEANERS: Inactive Drycleaners

A listing of inactive drycleaner facility locations.

Date of Government Version: 01/12/2006	Source: Department of Ecology
Date Data Arrived at EDR: 03/23/2006	Telephone: 360-407-6732
Date Made Active in Reports: 04/13/2006	Last EDR Contact: 08/15/2006
Number of Days to Update: 21	Next Scheduled EDR Contact: 11/13/2006
	Data Release Frequency: Annually

TRIBAL RECORDS

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2004	Source: USGS
Date Data Arrived at EDR: 02/08/2005	Telephone: 202-208-3710
Date Made Active in Reports: 08/04/2005	Last EDR Contact: 08/11/2006
Number of Days to Update: 177	Next Scheduled EDR Contact: 11/06/2006
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 06/08/2006	Source: EPA Region 1
Date Data Arrived at EDR: 06/09/2006	Telephone: 617-918-1313
Date Made Active in Reports: 06/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 19	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 01/04/2005	Source: EPA Region 6
Date Data Arrived at EDR: 01/21/2005	Telephone: 214-665-6597
Date Made Active in Reports: 02/28/2005	Last EDR Contact: 08/21/2006
Number of Days to Update: 38	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 06/06/2006	Source: EPA Region 8
Date Data Arrived at EDR: 06/09/2006	Telephone: 303-312-6271
Date Made Active in Reports: 07/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 06/08/2006	Source: EPA Region 10
Date Data Arrived at EDR: 06/09/2006	Telephone: 206-553-2857
Date Made Active in Reports: 07/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 06/01/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/23/2006	Telephone: 415-972-3372
Date Made Active in Reports: 08/02/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 40	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 06/01/2006	Source: EPA Region 7
Date Data Arrived at EDR: 07/10/2006	Telephone: 913-551-7003
Date Made Active in Reports: 09/12/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 64	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

Date of Government Version: 06/08/2006	Source: EPA Region 10
Date Data Arrived at EDR: 06/09/2006	Telephone: 206-553-2857
Date Made Active in Reports: 07/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R5: Underground Storage Tanks on Indian Land

Date of Government Version: 12/02/2004	Source: EPA Region 5
Date Data Arrived at EDR: 12/29/2004	Telephone: 312-886-6136
Date Made Active in Reports: 02/04/2005	Last EDR Contact: 08/21/2006
Number of Days to Update: 37	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

Date of Government Version: 06/06/2006	Source: EPA Region 8
Date Data Arrived at EDR: 06/09/2006	Telephone: 303-312-6137
Date Made Active in Reports: 07/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

INDIAN UST R6: Underground Storage Tanks on Indian Land

Date of Government Version: 06/30/2006	Source: EPA Region 6
Date Data Arrived at EDR: 07/03/2006	Telephone: 214-665-7591
Date Made Active in Reports: 09/06/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 65	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Semi-Annually

INDIAN UST R1: Underground Storage Tanks on Indian Land A listing of underground storage tank locations on Indian Land.

Date of Government Version: 06/08/2006	Source: EPA, Region 1
Date Data Arrived at EDR: 06/09/2006	Telephone: 617-918-1313
Date Made Active in Reports: 06/30/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 21	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

Date of Government Version: 06/01/2006	Source: EPA Region 7
Date Data Arrived at EDR: 07/10/2006	Telephone: 913-551-7003
Date Made Active in Reports: 09/12/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 64	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

Date of Government Version: 06/01/2006	Source: EPA Region 9
Date Data Arrived at EDR: 06/23/2006	Telephone: 415-972-3368
Date Made Active in Reports: 08/02/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 40	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

EDR PROPRIETARY RECORDS

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

COUNTY RECORDS

KING COUNTY:

Abandoned Landfill Study in King County

The King County Abandoned Landfill Survey was conducted from October through December 1984 by the Health Department's Environmental Health Division at the request of the King County Council. The primary objective of the survey was to determine if any public health problems existed at the predetermined 24 sites.

Date of Government Version: 04/30/1985
Date Data Arrived at EDR: 11/07/1994
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: Seattle-King County Department of Public Health
Telephone: 206-296-4785
Last EDR Contact: 10/21/1994
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

KITSAP COUNTY:

Water Wells in Kitsap County

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: N/A
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

SEATTLE COUNTY:

Abandoned Landfill Study in the City of Seattle

The Seattle Abandoned Landfill Survey was conducted in June and July of 1984 by the Health Department's Environmental Health Division at the request of the Mayor's Office. The primary objective of the survey was to determine if any public health problems existed at the predetermined 12 sites.

Date of Government Version: 07/30/1984
Date Data Arrived at EDR: 11/07/1994
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: Seattle - King County Department of Public Health
Telephone: 206-296-4785
Last EDR Contact: 10/21/1994
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SEATTLE/KING COUNTY:

Seattle - King County Abandoned Landfill Toxicity / Hazard Assessment Project

This report presents the Seattle-King County Health Department's follow-up investigation of two city owned and four county owned abandoned landfills which was conducted from February to December 1986.

Date of Government Version: 12/31/1986
Date Data Arrived at EDR: 08/18/1995
Date Made Active in Reports: 09/20/1995
Number of Days to Update: 33

Source: Department of Public Health
Telephone: 206-296-4785
Last EDR Contact: 08/14/1995
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SNOHOMISH COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Solid Waste Sites of Record at Snohomish Health District

Date of Government Version: 01/26/2006	Source: Snohomish Health District
Date Data Arrived at EDR: 05/01/2006	Telephone: 206-339-5250
Date Made Active in Reports: 05/31/2006	Last EDR Contact: 07/19/2006
Number of Days to Update: 30	Next Scheduled EDR Contact: 10/16/2006
	Data Release Frequency: Semi-Annually

TACOMA/PIERCE COUNTY:

Closed Landfill Survey

Following numerous requests for information about closed dumpsites and landfills in Pierce County, the Tacoma-Pierce County Health Department decided to conduct a study on the matter. The aim of the study was to evaluate public health risks associated with the closed dumpsites and landfills, and to determine the need, if any, for further investigations of a more detailed nature. The sites represent all of the known dumpsites and landfills closed after 1950.

Date of Government Version: 09/01/2002	Source: Tacoma-Pierce County Health Department
Date Data Arrived at EDR: 03/24/2003	Telephone: 206-591-6500
Date Made Active in Reports: 05/14/2003	Last EDR Contact: 03/19/2003
Number of Days to Update: 51	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2004	Source: Department of Environmental Protection
Date Data Arrived at EDR: 02/17/2006	Telephone: 860-424-3375
Date Made Active in Reports: 04/07/2006	Last EDR Contact: 09/11/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 12/11/2006
	Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 05/02/2006	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 05/31/2006	Telephone: 518-402-8651
Date Made Active in Reports: 06/27/2006	Last EDR Contact: 08/30/2006
Number of Days to Update: 27	Next Scheduled EDR Contact: 11/27/2006
	Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2005	Source: Department of Environmental Protection
Date Data Arrived at EDR: 05/04/2006	Telephone: N/A
Date Made Active in Reports: 06/06/2006	Last EDR Contact: 09/11/2006
Number of Days to Update: 33	Next Scheduled EDR Contact: 12/11/2006
	Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2005

Date Data Arrived at EDR: 03/17/2006

Date Made Active in Reports: 05/02/2006

Number of Days to Update: 46

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 07/25/2006

Next Scheduled EDR Contact: 10/09/2006

Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: PennWell Corporation

Telephone: (800) 823-6277

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Daycare Center Listing

Source: Department of Social & Health Services

Telephone: 253-383-1735

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

STREET AND ADDRESS INFORMATION

© 2006 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.



EDR® Environmental Data Resources Inc



netr

Real Estate Research
& Information

The EDR Environmental Lien Search Report

**LONGVIEW FIBRE PAPER AND PACKAGING,
INC.
5901 EAST MARGINAL WAY SOUTH
SEATTLE, WASHINGTON**

Friday, October 06, 2006

Project Number: L06-6503

The Standard In Environmental Risk Management Information

**440 Wheelers Farm Road
Milford, Connecticut 06460**

Nationwide Customer Service

**Telephone: 1-800-352-0050
Fax: 1-800-231-6802**

ENVIRONMENTAL LIEN REPORT

The EDR Environmental Lien Search Report is intended to assist in the search for environmental liens filed in land title records.

TARGET PROPERTY INFORMATION

ADDRESS

LONGVIEW FIBRE PAPER AND PACKAGING, INC.
5901 EAST MARGINAL WAY SOUTH
SEATTLE, WASHINGTON

DEED INFORMATION

Type of Deed: SPECIAL WARRANTY DEED ☒ QCD ☐ Other ☐ DEED

Title is vested in: Longview Fibre Paper and Packaging, Inc., a Washington Corporation

Title received from: Longview Fibre Company, a Washington Corporation

Deed Dated: 12-31-2005

Deed Recorded: 01-06-2006

Instrument: 20060106002260

LEGAL DESCRIPTION

Description: All that certain piece or parcel of land being a portion of Government Lot 4 in Section 19, Township 24 North, Range 4 East, lying and situate in the City of Seattle, County of King, State of Washington.

Assessor's Parcel Number: 1924049091

ENVIRONMENTAL LIEN

Environmental Lien: Found ☐ Not Found ☒

1st Party:

2nd Party:

Recorded:

Book:

Page:

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found ☐ Not Found ☒

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This report was prepared for the use of Environmental Data Resources, Inc., and ENSR Consulting and Engineering, exclusively. This report is neither a guarantee of title, a commitment to insure, nor a policy of title insurance. **NO WARRANTY, EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT.** Environmental Data Resources, Inc. (EDR) and Nationwide Environmental Title Research (NETR) specifically disclaim the making of any such warranties, including without limitation, merchantability or fitness for a particular use or purpose. The information contained in this report is retrieved as it is recorded from the various agencies that make it available. The total liability is limited to the fee paid for this report.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Appendix C

Historical Research Documentation

COMMITMENT FOR TITLE INSURANCE

Seattle, WA
Clabaugh

CHICAGO TITLE INSURANCE COMPANY

CHICAGO TITLE INSURANCE COMPANY, a Missouri corporation, herein called the Company, for a valuable consideration, hereby commits to issue its policy or policies of title insurance, as identified in Schedule A, in favor of the proposed Insured named in Schedule A, as owner or mortgagee of the estate or interest covered hereby in the land described or referred to in Schedule A, upon payment of the premiums and charges therefore; all subject to the provisions of Schedules A and B and to the Exclusions from Coverage (appearing herein) and to the Conditions and Stipulations hereof.

This Commitment shall be effective only when the identity of the proposed Insured and the amount of the policy or policies committed for have been inserted in Schedule A hereof by the Company, either at the time of the issuance of this Commitment or by subsequent endorsement.

This Commitment is preliminary to the issuance of such policy or policies of title insurance and all liability and obligations hereunder shall cease and terminate six months after the effective date hereof or when the policy or policies committed for shall issue, whichever first occurs, provided that the failure to issue such policy or policies is not the fault of the Company.

In Witness Whereof, CHICAGO TITLE INSURANCE COMPANY has caused this commitment to be signed and sealed as of the date of policy shown in Schedule A, the policy to become valid when countersigned by an authorized signatory.

Issued by:
CHICAGO TITLE INSURANCE COMPANY
3400 BANK OF AMERICA TOWER
701 5TH AVENUE
SEATTLE, WA 98104
(206) 628-5666

CHICAGO TITLE INSURANCE COMPANY

By:

Alma M. P. L.

President

ATTEST:

John C. J.

Secretary



CHICAGO TITLE INSURANCE COMPANY

701 FIFTH AVENUE, #3400, SEATTLE, WA 98104

ALTA COMMITMENT SCHEDULE A

Order No.: 1175199

Customer Number: LONGVIEW FIBRE/MARGINAL WAY S.

Buyer(s):

Title Unit: U-06

Phone: (206)628-5610

Fax: (206)628-9717

Officer: SAVIDIS/WAGNER/CAMPBELL/MINOR

Commitment Effective Date: OCTOBER 24, 2005 at 8:00 A.M.

1. Policy or Policies to be issued:

ALTA Owner's Policy

Amount: \$0.00

1992 STANDARD

Premium:

COMMERCIAL OWNERS STANDARD RATE

Tax:

Proposed Insured:

Policy or Policies to be issued:

ALTA Loan Policy

Amount: \$0.00

Premium:

Tax:

Proposed Insured:

Policy or Policies to be issued:

ALTA Loan Policy

Amount: \$0.00

Premium:

Tax:

Proposed Insured:

2. The estate or interest in the land which is covered by this Commitment is:

FEE SIMPLE

3. Title to the estate or interest in the land is at the effective date hereof vested in:

LONGVIEW FIBRE COMPANY, A DELAWARE CORPORATION

4. The land referred to in this Commitment is described as follows:

SEE ATTACHED LEGAL DESCRIPTION EXHIBIT

COMMA804/2

LFC000302

CHICAGO TITLE INSURANCE COMPANY
A.L.T.A. COMMITMENT
SCHEDULE A
(Continued)

Order No.: 1175199
Your No.:

LEGAL DESCRIPTION EXHIBIT
(Paragraph 4 of Schedule A continuation)

THAT PORTION OF GOVERNMENT LOT 4 IN SECTION 19, TOWNSHIP 24 NORTH, RANGE 4 EAST, WILLAMETTE MERIDIAN, IN KING COUNTY, WASHINGTON, DESCRIBED AS FOLLOWS:

BEGINNING AT THE INTERSECTION OF THE SOUTHERLY MARGIN OF WEST FIDALGO STREET AS SAID STREET WAS CONDEMNED IN KING COUNTY SUPERIOR COURT CAUSE NUMBER 178890 UNDER ORDINANCE NUMBER 46352 OF THE CITY OF SEATTLE WITH THE WESTERLY MARGIN OF EAST MARGINAL WAY AS ESTABLISHED UNDER ORDINANCE NUMBER 32881 OF THE CITY OF SEATTLE, AND RUNNING THENCE SOUTH 19°36'23" EAST, ALONG THE WESTERLY MARGIN OF SAID EAST MARGINAL WAY, 148.91 FEET TO THE POINT OF INTERSECTION OF THE SOUTHERLY MARGIN OF WEST FIDALGO STREET AS RELOCATED AND ESTABLISHED UNDER ORDINANCE NUMBER 80645 OF THE CITY OF SEATTLE WITH THE WESTERLY MARGIN OF SAID EAST MARGINAL WAY, WHICH POINT OF INTERSECTION IS THE TRUE POINT OF BEGINNING OF THE TRACT HEREIN DESCRIBED;
THENCE SOUTH 19°36'23" EAST, ALONG THE WESTERLY MARGIN OF SAID EAST MARGINAL WAY, 154.09 FEET;
THENCE SOUTH 70°23'37" WEST 655 FEET;
THENCE NORTH 19°36'23" WEST 312.14 FEET TO THE SOUTHERLY MARGIN OF SAID WEST FIDALGO STREET AS RELOCATED UNDER SAID ORDINANCE NUMBER 80645;
THENCE NORTH 83°57'35" EAST, ALONG SAID SOUTHERLY MARGIN, 673.80 FEET TO THE TRUE POINT OF BEGINNING.

CLTAC446/RDA/J07/9

LFC000303

CHICAGO TITLE INSURANCE COMPANY

ALTA COMMITMENT
SCHEDULE B

Order No.: 1175199
Your No.:

Schedule B of the policy or policies to be issued will contain exceptions to the following matters unless the same are disposed of to the satisfaction of the Company.

GENERAL EXCEPTIONS

- A. Rights or claims of parties in possession not shown by the public records.
- B. Encroachments, overlaps, boundary line disputes, or other matters which would be disclosed by an accurate survey and inspection of the premises.
- C. Easements, or claims of easements, not shown by the public records.
- D. Any lien, or right to a lien, for contributions to employee benefit funds, or for state workers' compensation, or for services, labor, or material heretofore or hereafter furnished, all as imposed by law, and not shown by the public records.
- E. Taxes or special assessments which are not shown as existing liens by the public records.
- F. Any service, installation, connection, maintenance, tap, capacity or construction charges for sewer, water, electricity, other utilities, or garbage collection and disposal.
- G. Reservations or exceptions in patents or in Acts authorizing the issuance thereof;
Indian tribal codes or regulations, Indian treaty or aboriginal rights, including easements or equitable servitudes.
- H. Water rights, claims, or title to water.
- I. Defects, liens, encumbrances, adverse claims or other matters, if any, created, first appearing in the public records, or attaching subsequent to the effective date hereof but prior to the date the proposed insured acquires of record for value the estate or interest or mortgage thereon covered by this Commitment.

SPECIAL EXCEPTIONS FOLLOW

WLTACOMB/UDA/0999

LFC000304

CHICAGO TITLE INSURANCE COMPANY
A.L.T.A. COMMITMENT
SCHEDULE B
(Continued)

Order No.: 001175199
Your No.:

SPECIAL EXCEPTIONS

A 1. EASEMENT AND THE TERMS AND CONDITIONS THEREOF:

PURPOSE: INGRESS AND EGRESS FOR AUTOMOBILE
ROADWAYS AND FOR SPUR TRACKS
AREA AFFECTED: PORTION OF SAID PREMISES
RECORDED: SEPTEMBER 14, 1951
RECORDING NUMBER: 4169674

B 2. EASEMENT AND THE TERMS AND CONDITIONS THEREOF:

PURPOSE: PRIVATE ROADWAY
AREA AFFECTED: THE SOUTHERLY 6 FEET OF SAID
PREMISES; AND OTHER PROPERTY
RECORDED: JULY 29, 1954
RECORDING NUMBER: 4470012

C SAID INSTRUMENT CONTAINS PROVISIONS FOR BEARING THE COST OF
MAINTENANCE, REPAIR OR RECONSTRUCTION OF THE ROADWAY BY THE USERS.

**c 3. AN EASEMENT FOR SIDE SEWER AFFECTING THE PORTION OF SAID PREMISES
STATED HEREIN AND CONTAINING A PROVISION FOR BEARING EQUAL COSTS OF
MAINTENANCE, REPAIR OR RECONSTRUCTION OF SAID COMMON SEWER BY THE
USERS:**

WIDTH: 6 FEET
LOCATION: PORTION OF SAID PREMISES AND OTHER
PROPERTY, AS CONSTRUCTED
RECORDED: NOVEMBER 6, 1959
RECORDING NUMBER: 6585382

R 4. RELEASE OF DAMAGE AGREEMENT AND THE TERMS AND CONDITIONS THEREOF:

BETWEEN: KAISER GYPSUM COMPANY, INC.
AND: CITY OF SEATTLE
RECORDED: JANUARY 28, 1954
RECORDING NUMBER: 4414751

RELEASING CITY OF SEATTLE FROM ALL FUTURE CLAIMS FOR DAMAGES
RESULTING FROM:

CLTACMB1/RDA/9/9

CHICAGO TITLE INSURANCE COMPANY
A.L.T.A. COMMITMENT
SCHEDULE B
(Continued)

Order No.: 1175199
Your No.:

SPECIAL EXCEPTIONS

PERMISSION TO CONSTRUCT A SIDE SEWER TO CONNECT THE PREMISES AT A GRADE LESS THAN THE MINIMUM GRADE OF TWO PER CENT (2%) REQUIRED BY ORDINANCE NUMBER 82321 OF THE CITY OF SEATTLE.

5. RELEASE OF DAMAGE AGREEMENT AND THE TERMS AND CONDITIONS THEREOF:

BETWEEN: LONGVIEW FIBRE CO.
AND: CITY OF SEATTLE
RECORDED: SEPTEMBER 21, 1954
RECORDING NUMBER: 4488215

RELEASING CITY OF SEATTLE FROM ALL FUTURE CLAIMS FOR DAMAGES RESULTING FROM:

PERMISSION TO CONSTRUCT A SIDE SEWER TO CONNECT THESE PREMISES AT A GRADE LESS THAN THE MINIMUM GRADE OF 2% REQUIRED BY ORDINANCE NUMBER 82321.

6. AGREEMENT AND THE TERMS AND CONDITIONS THEREOF:

BETWEEN: OREGON-WASHINGTON RAILROAD &
NAVIGATION COMPANY, AN OREGON
CORPORATION, AND ITS LESSEE UNION
PACIFIC RAILROAD COMPANY, A UTAH
CORPORATION, NORTHERN PACIFIC
RAILWAY COMPANY, A WISCONSIN
CORPORATION, GREAT NORTHERN RAILWAY
COMPANY, A MINNESOTA CORPORATION,
AND CHICAGO, MILWAUKEE, ST. PAUL AND
PACIFIC RAILROAD COMPANY, A
WISCONSIN CORPORATION
AND: LONGVIEW FIBRE COMPANY, A DELAWARE
CORPORATION
RECORDED: SEPTEMBER 23, 1957
RECORDING NUMBER: 4835287
REGARDING: INSTALLATION AND MAINTENANCE OF
PLANKING BETWEEN THE RAILS OF
RAILROADS' TRACKS IN EAST MARGINAL
WAY

CUTACMBE/RDA/000

CHICAGO TITLE INSURANCE COMPANY
A.L.T.A. COMMITMENT
SCHEDULE B
(Continued)

Order No.: 1175199
Your No.:

SPECIAL EXCEPTIONS

7. RELEASE OF DAMAGE AGREEMENT AND THE TERMS AND CONDITIONS THEREOF:

BETWEEN: LONGVIEW FIBRE COMPANY
AND: CITY OF SEATTLE
RECORDED: NOVEMBER 6, 1969
RECORDING NUMBER: 6585381

RELEASING CITY OF SEATTLE FROM ALL FUTURE CLAIMS FOR DAMAGES RESULTING FROM:

PERMISSION TO CONSTRUCT A SIDE SEWER TO CONNECT THESE PREMISES IN SUCH MANNER THAT MORE THAN ONE MULTIPLE RESIDENCE BUILDING IS CONNECTED TO ONE SIDE SEWER, NOT CONFORMING TO THE REQUIREMENT OF CITY ORDINANCE.

8. MATTERS DISCLOSED BY SURVEY RECORDED UNDER RECORDING NUMBER 7803109004, AS FOLLOWS:

ENCROACHMENT OF BUILDING ON EASEMENT RIGHT OF WAY.

NOTE: AN AFFIDAVIT OF CORRECTION OF SURVEY WAS RECORDED UNDER RECORDING NUMBER 7804260750.

9. PAYMENT OF THE REAL ESTATE EXCISE TAX, IF REQUIRED.

THE PROPERTY DESCRIBED HEREIN IS SITUATED WITHIN THE BOUNDARIES OF LOCAL TAXING AUTHORITY OF CITY OF SEATTLE. PRESENT RATE IS 1.78%.

ANY CONVEYANCE DOCUMENT MUST BE ACCOMPANIED BY THE OFFICIAL WASHINGTON STATE EXCISE TAX AFFIDAVIT. THE APPLICABLE EXCISE TAX MUST BE PAID AND THE AFFIDAVIT APPROVED AT THE TIME OF THE RECORDING OF THE CONVEYANCE DOCUMENTS.

10. GENERAL AND SPECIAL TAXES AND CHARGES, PAYABLE FEBRUARY 15, DELINQUENT IF FIRST HALF UNPAID ON MAY 1, SECOND HALF DELINQUENT IF UNPAID ON NOVEMBER 1 OF THE TAX YEAR (AMOUNTS DO NOT INCLUDE INTEREST AND PENALTIES):

YEAR: 2005
TAX ACCOUNT NUMBER: 192404-9091-08

CLTACM82/RDA/10549

CHICAGO TITLE INSURANCE COMPANY
A.L.T.A. COMMITMENT
SCHEDULE B
(Continued)

Order No.: 1175199
Your No.:

SPECIAL EXCEPTIONS

LEVY CODE:	0010
ASSESSED VALUE-LAND:	\$ 2,411,400.00
ASSESSED VALUE-IMPROVEMENTS:	\$ 1,691,800.00
GENERAL & SPECIAL TAXES:	BILLED: \$ 46,001.78
	PAID: \$ 23,000.89
	UNPAID: \$ 23,000.89

- s 11. FEDERAL JUDGMENT ENTERED IN UNITED STATES DISTRICT COURT AT SEATTLE, WASHINGTON:

DATED:	OCTOBER 18, 1995
CAUSE NUMBER:	C9333
AGAINST:	LONGVIEW FIBRE

DETAILS WILL FOLLOW BY SUPPLEMENT COMMITMENT.

- L 12. THE PROPOSED CONVEYANCE MUST BE AUTHORIZED BY RESOLUTION OF THE DIRECTORS OF THE FOLLOWING NAMED CORPORATION AND A COPY SUBMITTED:

LONGVIEW FIBRE COMPANY

- r 13. IT WILL BE NECESSARY TO FURNISH EVIDENCE SATISFACTORY TO THE COMPANY THAT LONGVIEW FIBRE COMPANY IS A(AN) DELAWARE CORPORATION IN GOOD STANDING.

- N 14. TITLE IS TO BE VESTED IN PERSONS NOT YET REVEALED AND WHEN SO VESTED WILL BE SUBJECT TO MATTERS DISCLOSED BY A SEARCH OF THE RECORDS AGAINST THEIR NAMES.

- N 15. THE LEGAL DESCRIPTION IN THIS COMMITMENT IS BASED ON INFORMATION PROVIDED WITH THE APPLICATION AND THE PUBLIC RECORDS AS DEFINED IN THE POLICY TO ISSUE. THE PARTIES TO THE FORTHCOMING TRANSACTION MUST NOTIFY THE TITLE INSURANCE COMPANY PRIOR TO CLOSING IF THE DESCRIPTION DOES NOT CONFORM TO THEIR EXPECTATIONS.

- o NOTE 1:

CLTACMB2/RDA/10/99

CHICAGO TITLE INSURANCE COMPANY
A.L.T.A. COMMITMENT
SCHEDULE B
(Continued)

Order No.: 1175199
Your No.:

SPECIAL EXCEPTIONS

EFFECTIVE JANUARY 1, 1997, DOCUMENT FORMAT AND CONTENT REQUIREMENTS HAVE BEEN IMPOSED BY WASHINGTON LAW. FAILURE TO COMPLY WITH THE FOLLOWING REQUIREMENTS MAY RESULT IN REJECTION OF THE DOCUMENT BY THE COUNTY RECORDER OR IMPOSITION OF A \$50.00 SURCHARGE.

FOR DETAILS OF THESE STATEWIDE REQUIREMENTS PLEASE VISIT THE KING COUNTY RECORDER'S OFFICE WEBSITE AT WWW.METROKC.GOV/RECELEC/RECORDS AND SELECT ONLINE FORMS AND DOCUMENT STANDARDS.

THE FOLLOWING MAY BE USED AS AN ABBREVIATED LEGAL DESCRIPTION ON THE DOCUMENTS TO BE RECORDED TO COMPLY WITH THE REQUIREMENTS OF RCW 65.04. SAID ABBREVIATED LEGAL DESCRIPTION IS NOT A SUBSTITUTE FOR A COMPLETE LEGAL DESCRIPTION WHICH MUST ALSO APPEAR IN THE BODY OF THE DOCUMENT:


PORTION OF GOVERNMENT LOT 4 IN THE SOUTHEAST QUARTER OF SECTION 19-24-4.

END OF SCHEDULE B

CLTACMR2/RDA/0999

IMPORTANT: This is not a Survey. It is furnished as a convenience to locate the land indicated hereon with reference to streets and other land. No liability is assumed by reason of reliance hereon.

PTN. OF GL 4 IN THE SE ¼ OF SECTION 19-24-4

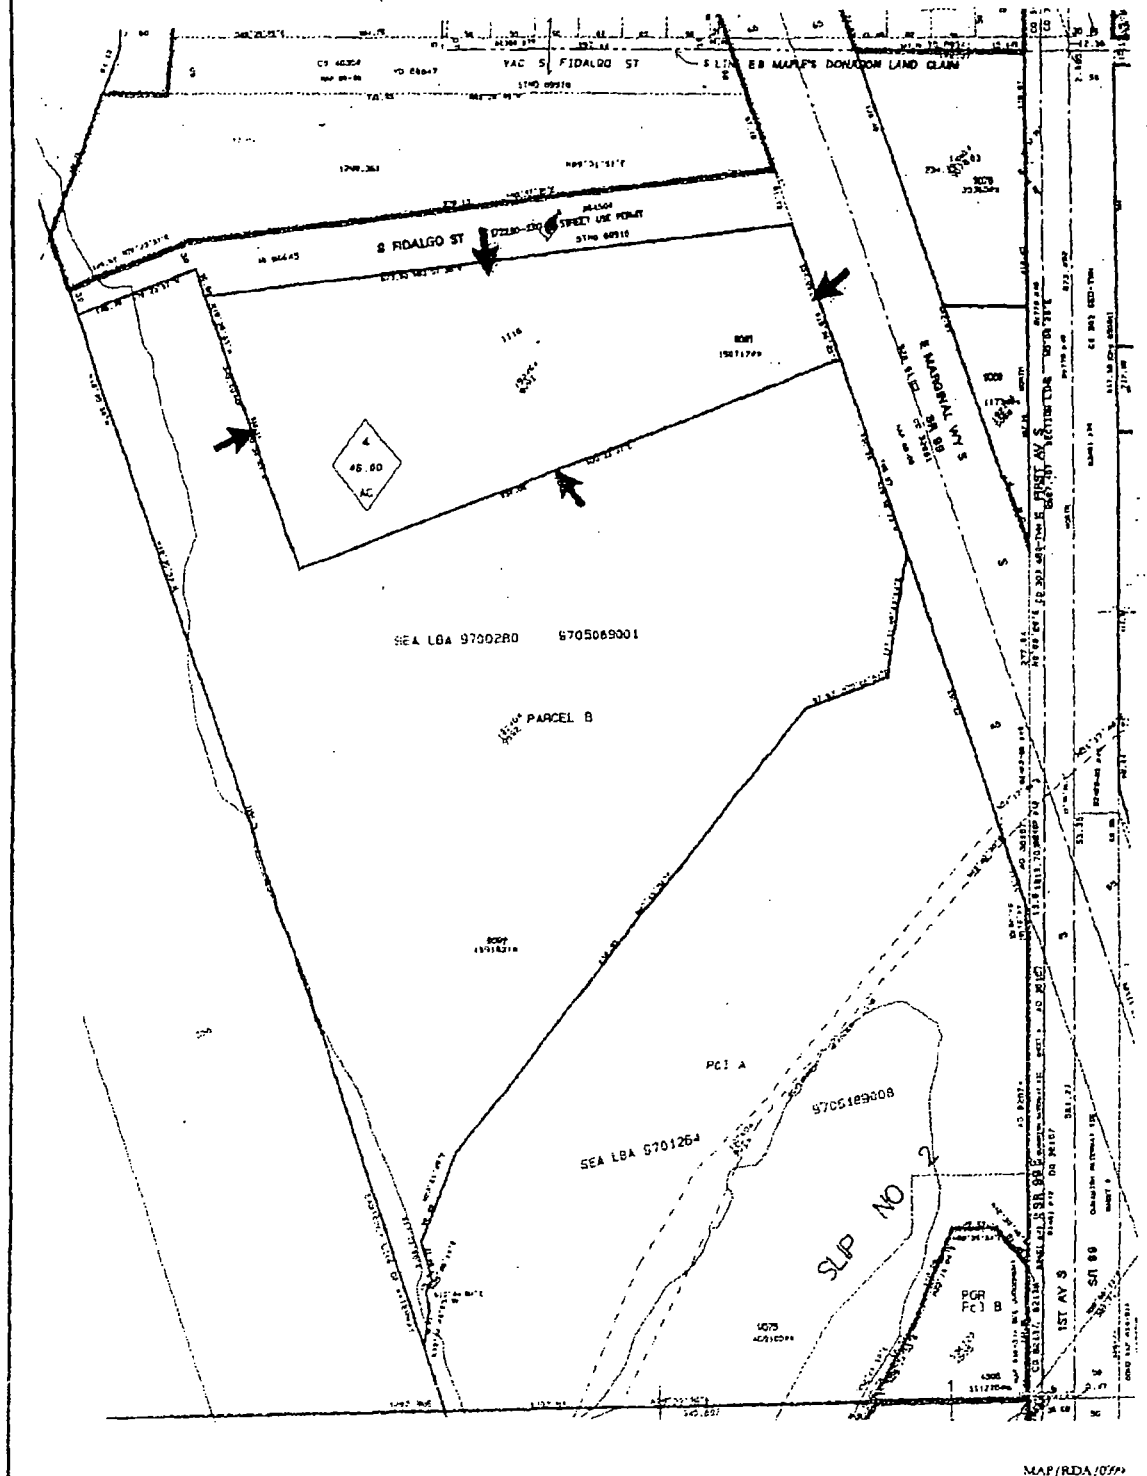

EXCLUSIONS (Cont'd.)

4. Any claim, which arises out of the transaction vesting in the Insured the estate or interest insured by this policy, by reason of the operation of federal bankruptcy, state insolvency, or similar creditors' rights laws, that is based on:
 - (i) the transaction creating the estate or interest insured by this policy being deemed a fraudulent conveyance or fraudulent transfer; or
 - (ii) the transaction creating the estate or interest insured by this policy being deemed a preferential transfer except where the preferential transfer results from the failure:
 - (a) to timely record the instrument of transfer; or
 - (b) of such recordation to impart notice to a purchaser for value or a judgment or lien creditor.

ALTA LOAN POLICY FORM (10-17-92)

The following matters are expressly excluded from the coverage of this policy and the Company will not pay loss or damage, costs, attorneys' fees or expenses which arise by reason of:

1. (a) Any law, ordinance or governmental regulation (including but not limited to building and zoning laws, ordinances, or regulations) restricting, regulating, prohibiting or relating to (i) the occupancy, use, or enjoyment of the land; (ii) the character, dimensions or location of any improvement now or hereafter erected on the land; (iii) a separation in ownership or a change in the dimensions or area of the land or any parcel of which the land is or was a part; or (iv) environmental protection, or the effect of any violation of these laws, ordinances or governmental regulations, except to the extent that a notice of the enforcement thereof or a notice of a defect, lien or encumbrance resulting from a violation or alleged violation affecting the land has been recorded in the public records at Date of Policy.
- (b) Any governmental police power not excluded by (a) above, except to the extent that a notice of the exercise thereof or a notice of a defect, lien or encumbrance resulting from a violation or alleged violation affecting the land has been recorded in the public records at Date of Policy.
2. Rights of eminent domain unless notice of the exercise thereof has been recorded in the public records at Date of Policy, but not excluding from coverage any taking which has occurred prior to Date of Policy which would be binding on the rights of a purchaser for value without knowledge.
3. Defects, liens, encumbrances, adverse claims or other matters:
 - (a) created, suffered, assumed or agreed to by the insured claimant;
 - (b) not known to the Company, not recorded in the public records at Date of Policy, but known to the insured claimant and not disclosed in writing to the Company by the insured claimant prior to the date the insured claimant became an insured under this policy;
 - (c) resulting in no loss or damage to the insured claimant;
 - (d) attaching or created subsequent to Date of Policy (except to the extent that this policy insures the priority of the lien of the insured mortgage over any statutory lien for services, labor or material); or
 - (e) resulting in loss or damage which would not have been sustained if the insured claimant had paid value for the insured mortgage.
4. Unenforceability of the lien of the insured mortgage because of the inability or failure of the insured at Date of Policy, or the inability or failure of any subsequent owner of the indebtedness, to comply with applicable doing business laws of the state in which the land is situated.
5. Invalidity or unenforceability of the lien of the insured mortgage, or claim thereof, which arises out of the transaction evidenced by the insured mortgage and is based upon usury or any consumer credit protection or truth in lending law.
6. Any statutory lien for services, labor or materials (or the claim or priority of any statutory lien for services, labor or materials over the lien of the insured mortgage) arising from an improvement or work related to the land which is contracted for and commenced subsequent to Date of Policy and is not financed in whole or in part by proceeds of the indebtedness secured by the insured mortgage which at Date of Policy the insured has advanced or is obligated to advance.
7. Any claim, which arises out of the transaction creating the interest of the mortgagee insured by this policy, by reason of the operation of federal bankruptcy, state insolvency, or similar creditors' rights laws, that is based on:
 - (i) the transaction creating the interest of the insured mortgagee being deemed a fraudulent conveyance or fraudulent transfer; or
 - (ii) the subordination of the interest of the insured mortgagee as a result of the application of the doctrine of equitable subordination; or
 - (iii) the transaction creating the interest of the insured mortgagee being deemed a preferential transfer except where the preferential transfer results from the failure:
 - (a) to timely record the instrument of transfer; or
 - (b) of such recordation to impart notice to a purchaser for value or a judgment or lien creditor.

The EDR Aerial Photo Decade Package

**Longview Fibre Seattle
5901 E Marginal Way S
Seattle, WA 98108**

Inquiry Number: 1763065.3

September 27, 2006



**EDR® Environmental
Data Resources Inc**

The Standard in Environmental Risk Management Information

**440 Wheelers Farms Road
Milford, Connecticut 06461**

Nationwide Customer Service

**Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com**

EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDRs professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:

Aerial Photography September 27, 2006

Target Property:

5901 E Marginal Way S


Seattle, WA 98108

<u>Year</u>	<u>Scale</u>	<u>Details</u>	<u>Source</u>
1956	Aerial Photograph. Scale: 1"=750'	Panel #: 2447122-E3/Flight Date: August 07, 1956	EDR
1965	Aerial Photograph. Scale: 1"=750'	Panel #: 2447122-E3/Flight Date: June 30, 1965	EDR
1977	Aerial Photograph. Scale: 1"=750'	Panel #: 2447122-E3/Flight Date: September 05, 1977	EDR
1985	Aerial Photograph. Scale: 1"=750'	Panel #: 2447122-E3/Flight Date: May 21, 1985	EDR
1990	Aerial Photograph. Scale: 1"=833'	Panel #: 2447122-E3/Flight Date: July 10, 1990	EDR

1763065.3

2

LFC000314

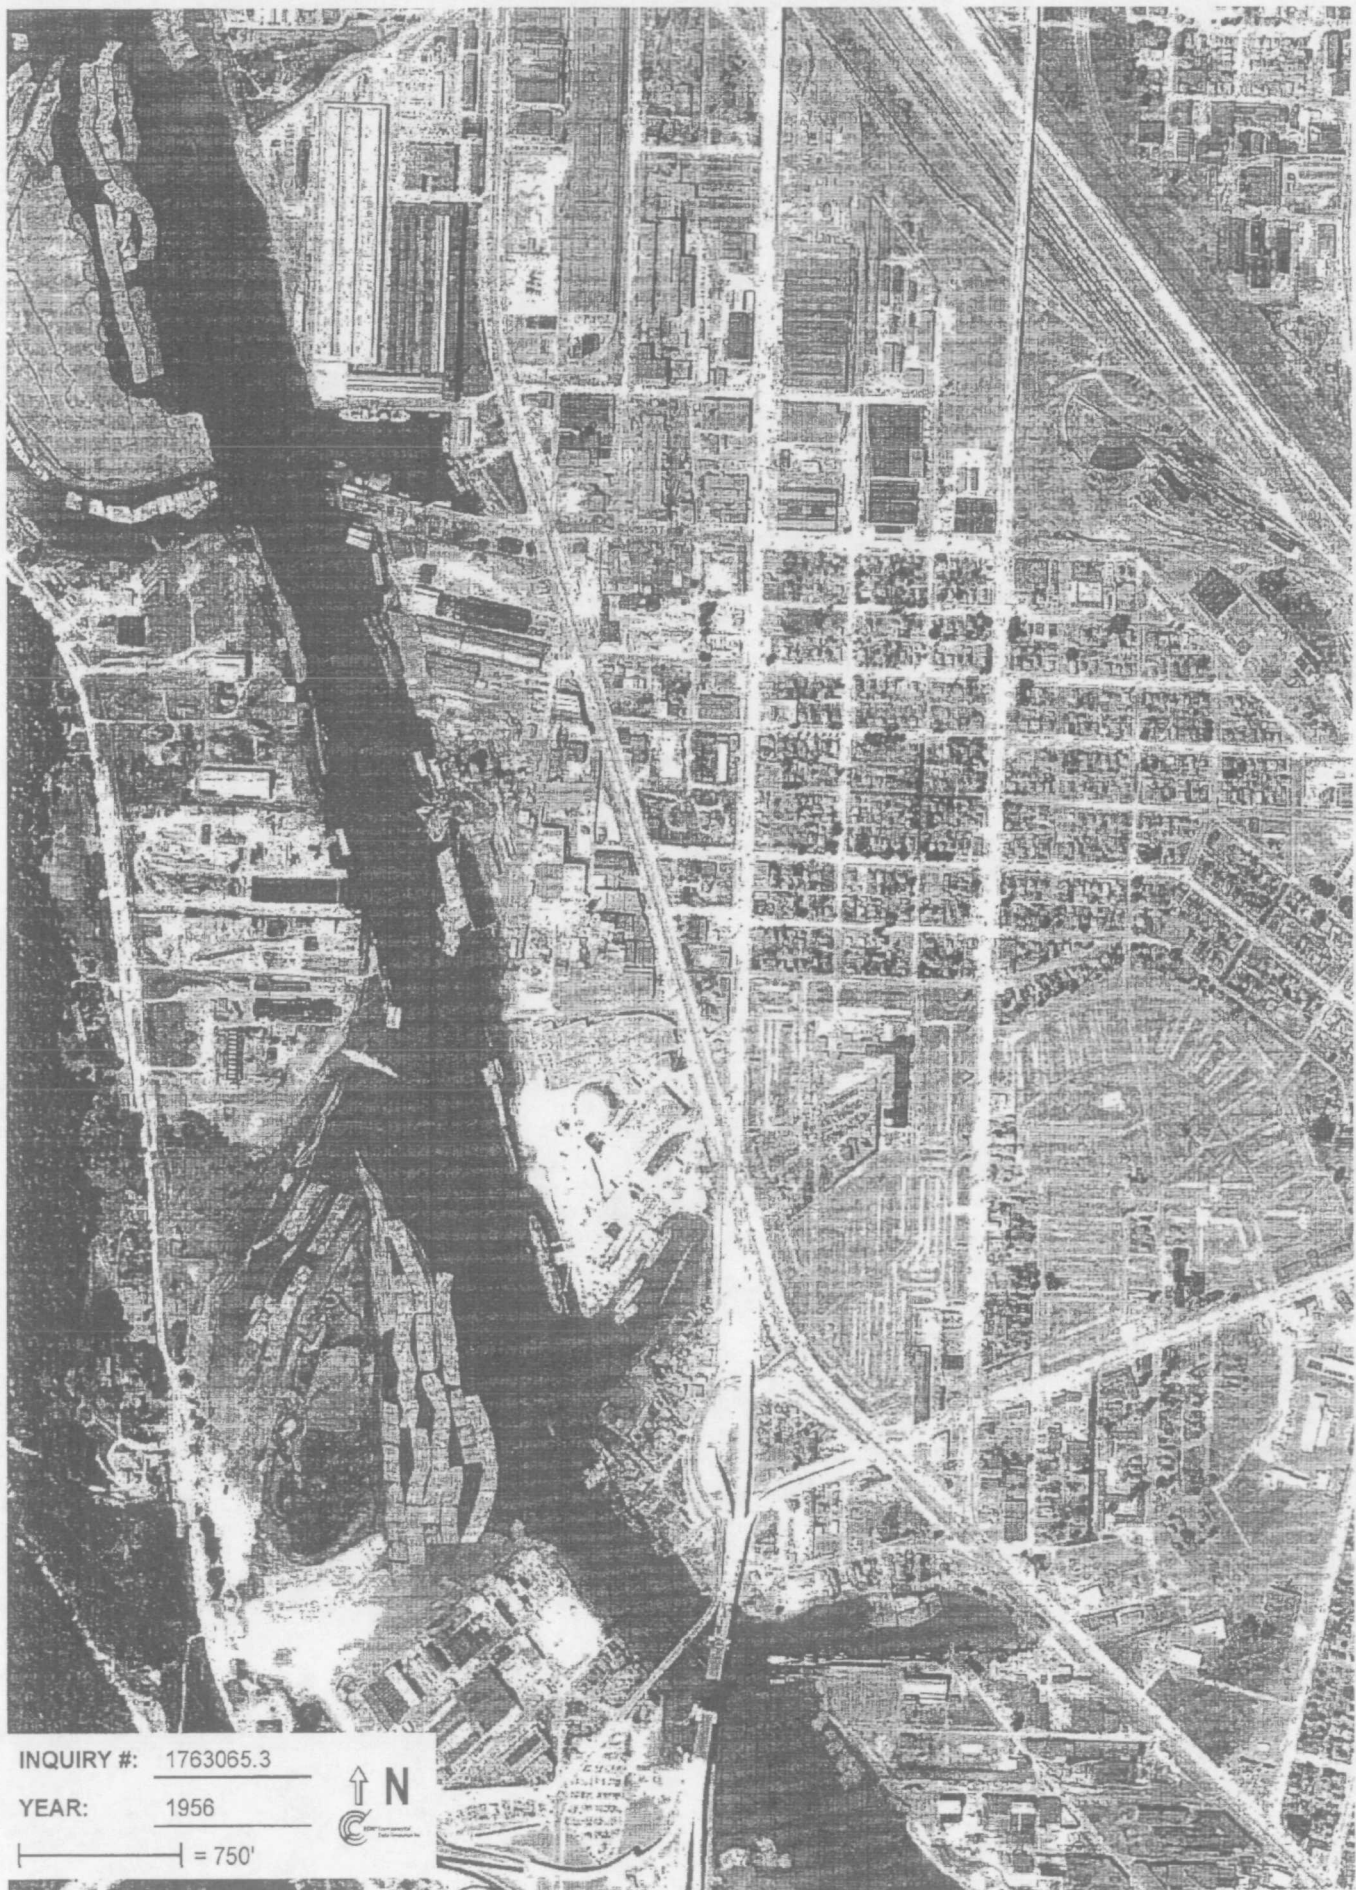


INQUIRY #: 1763065.3

YEAR: 1956


| = 750'



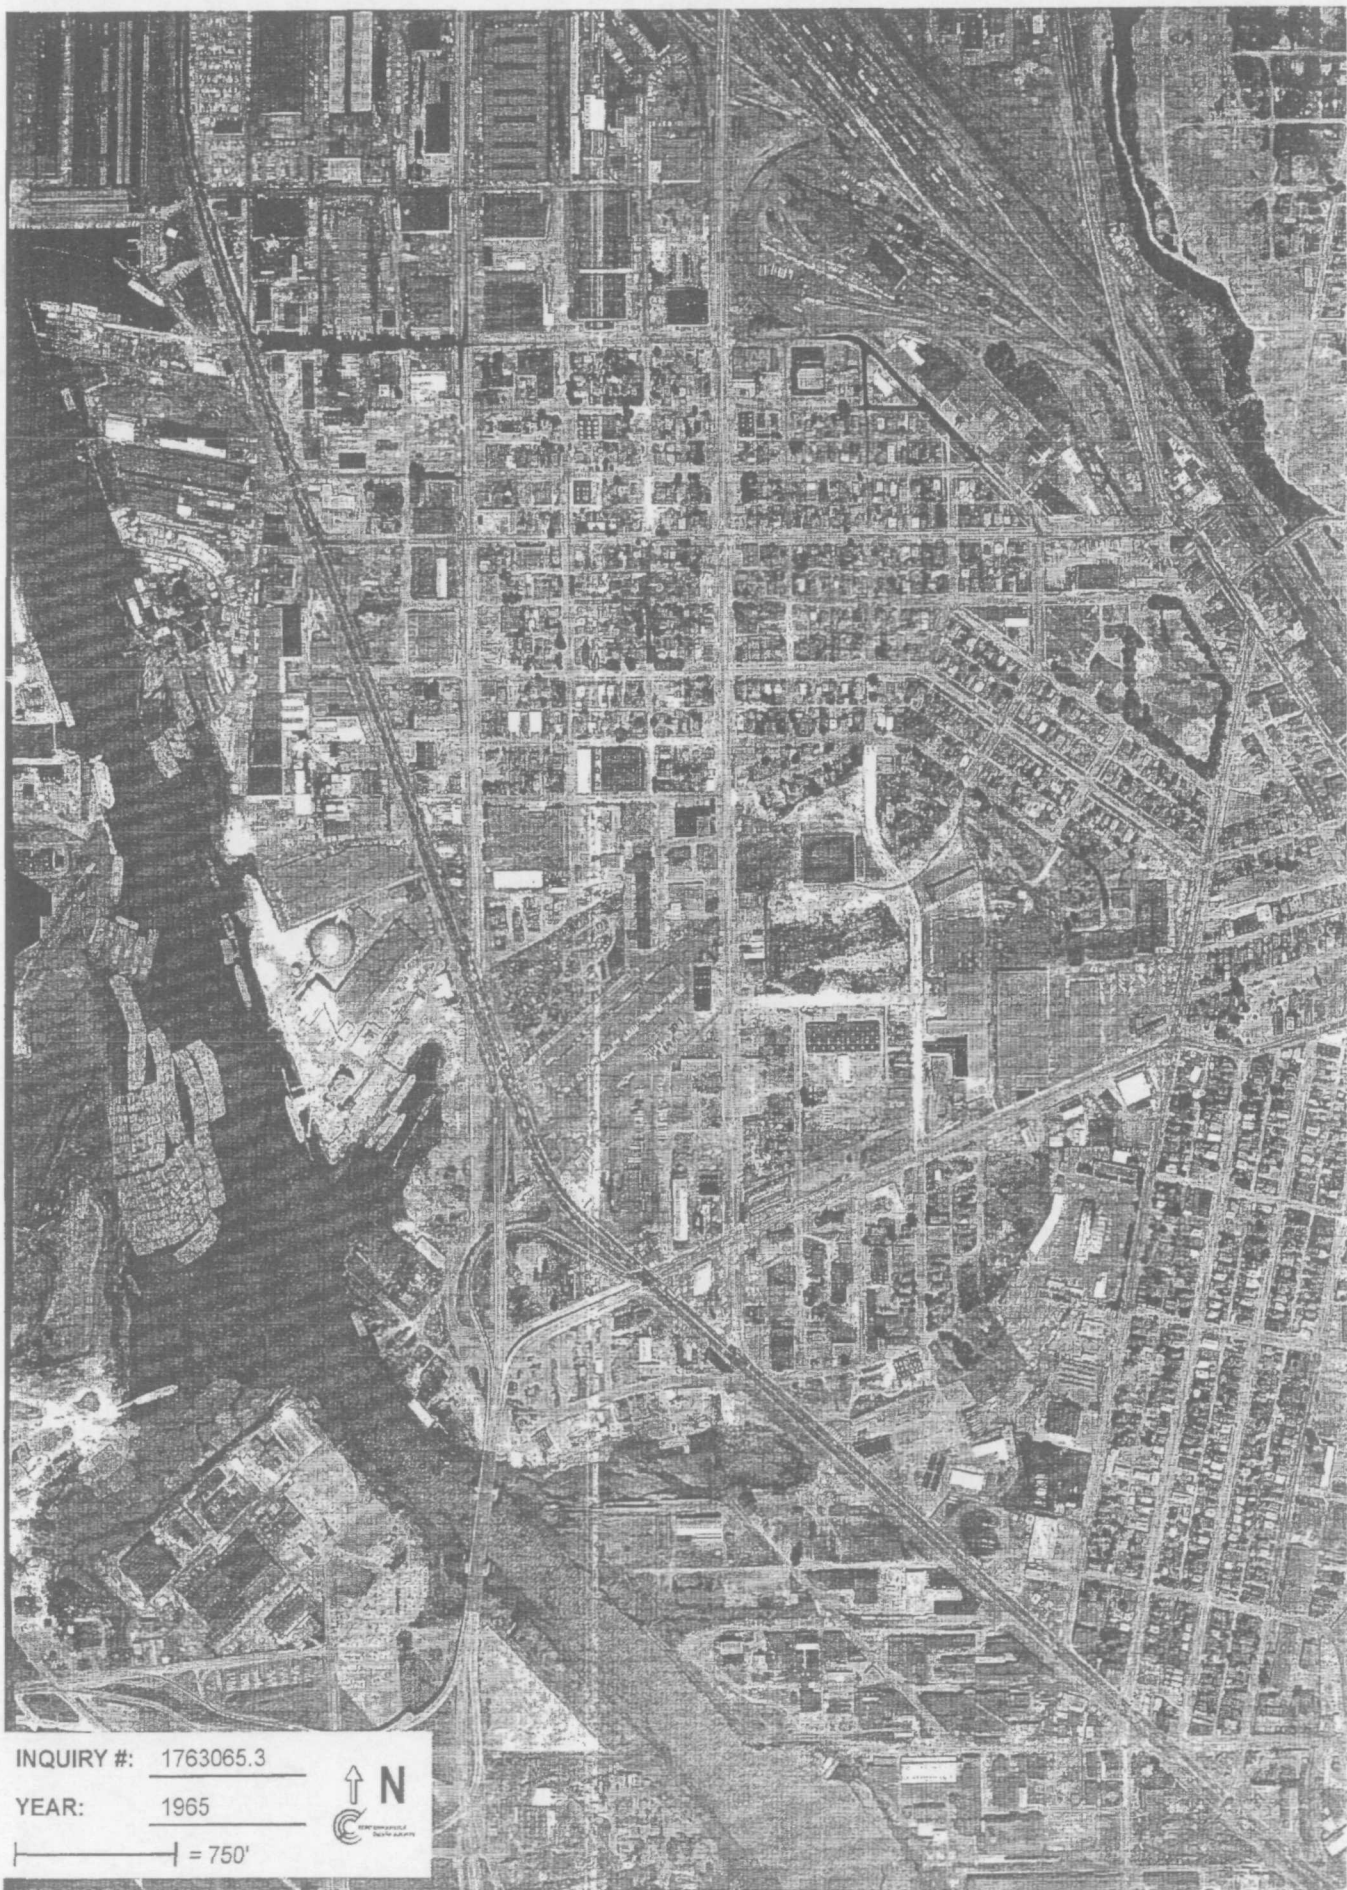


INQUIRY #: 1763065.3
YEAR: 1965
= 750'



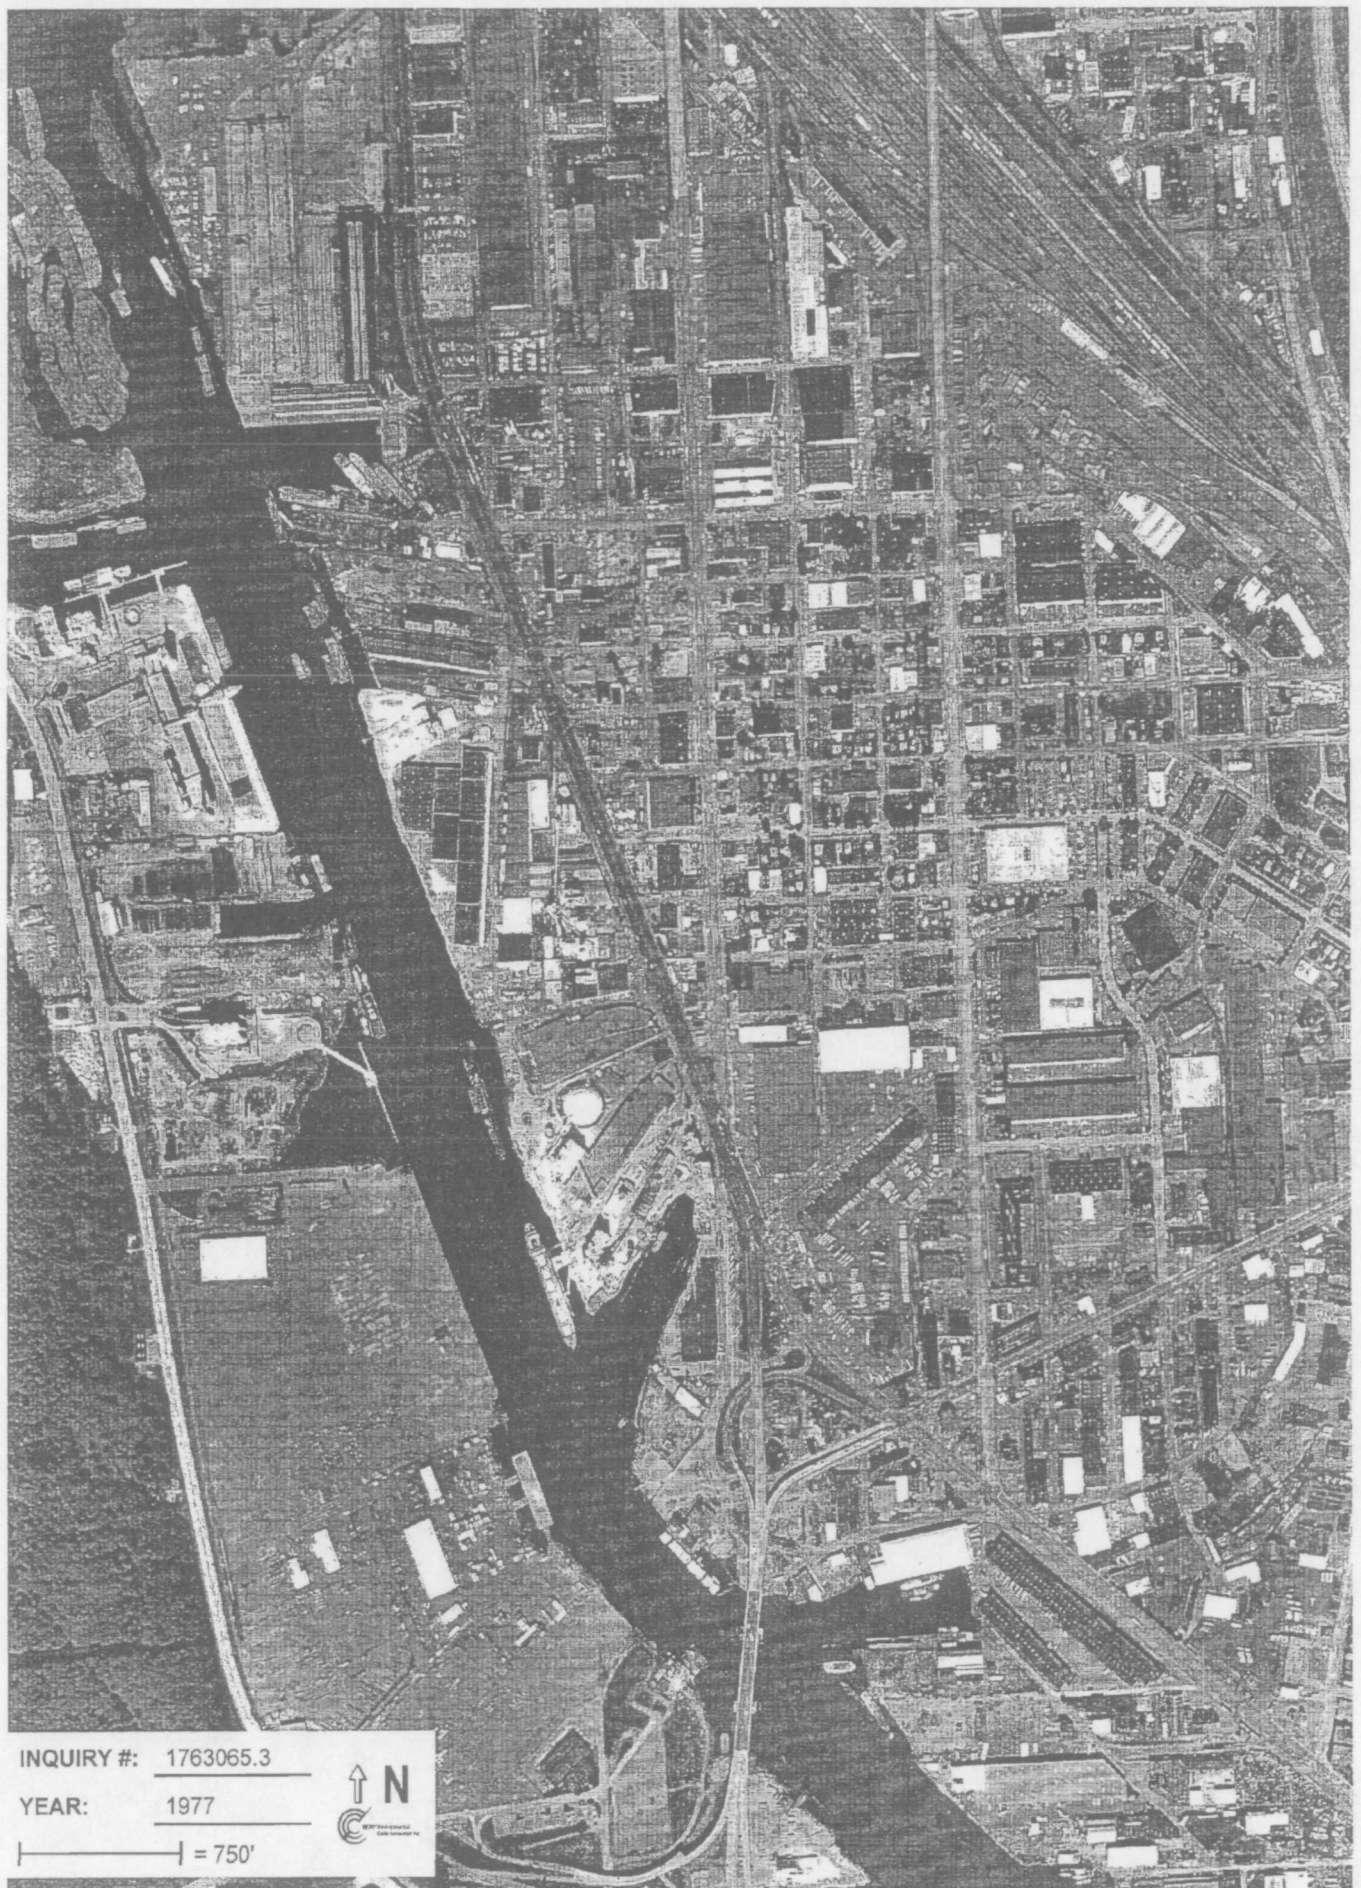

INQUIRY #: 1763065.3
YEAR: 1977
| = 750'



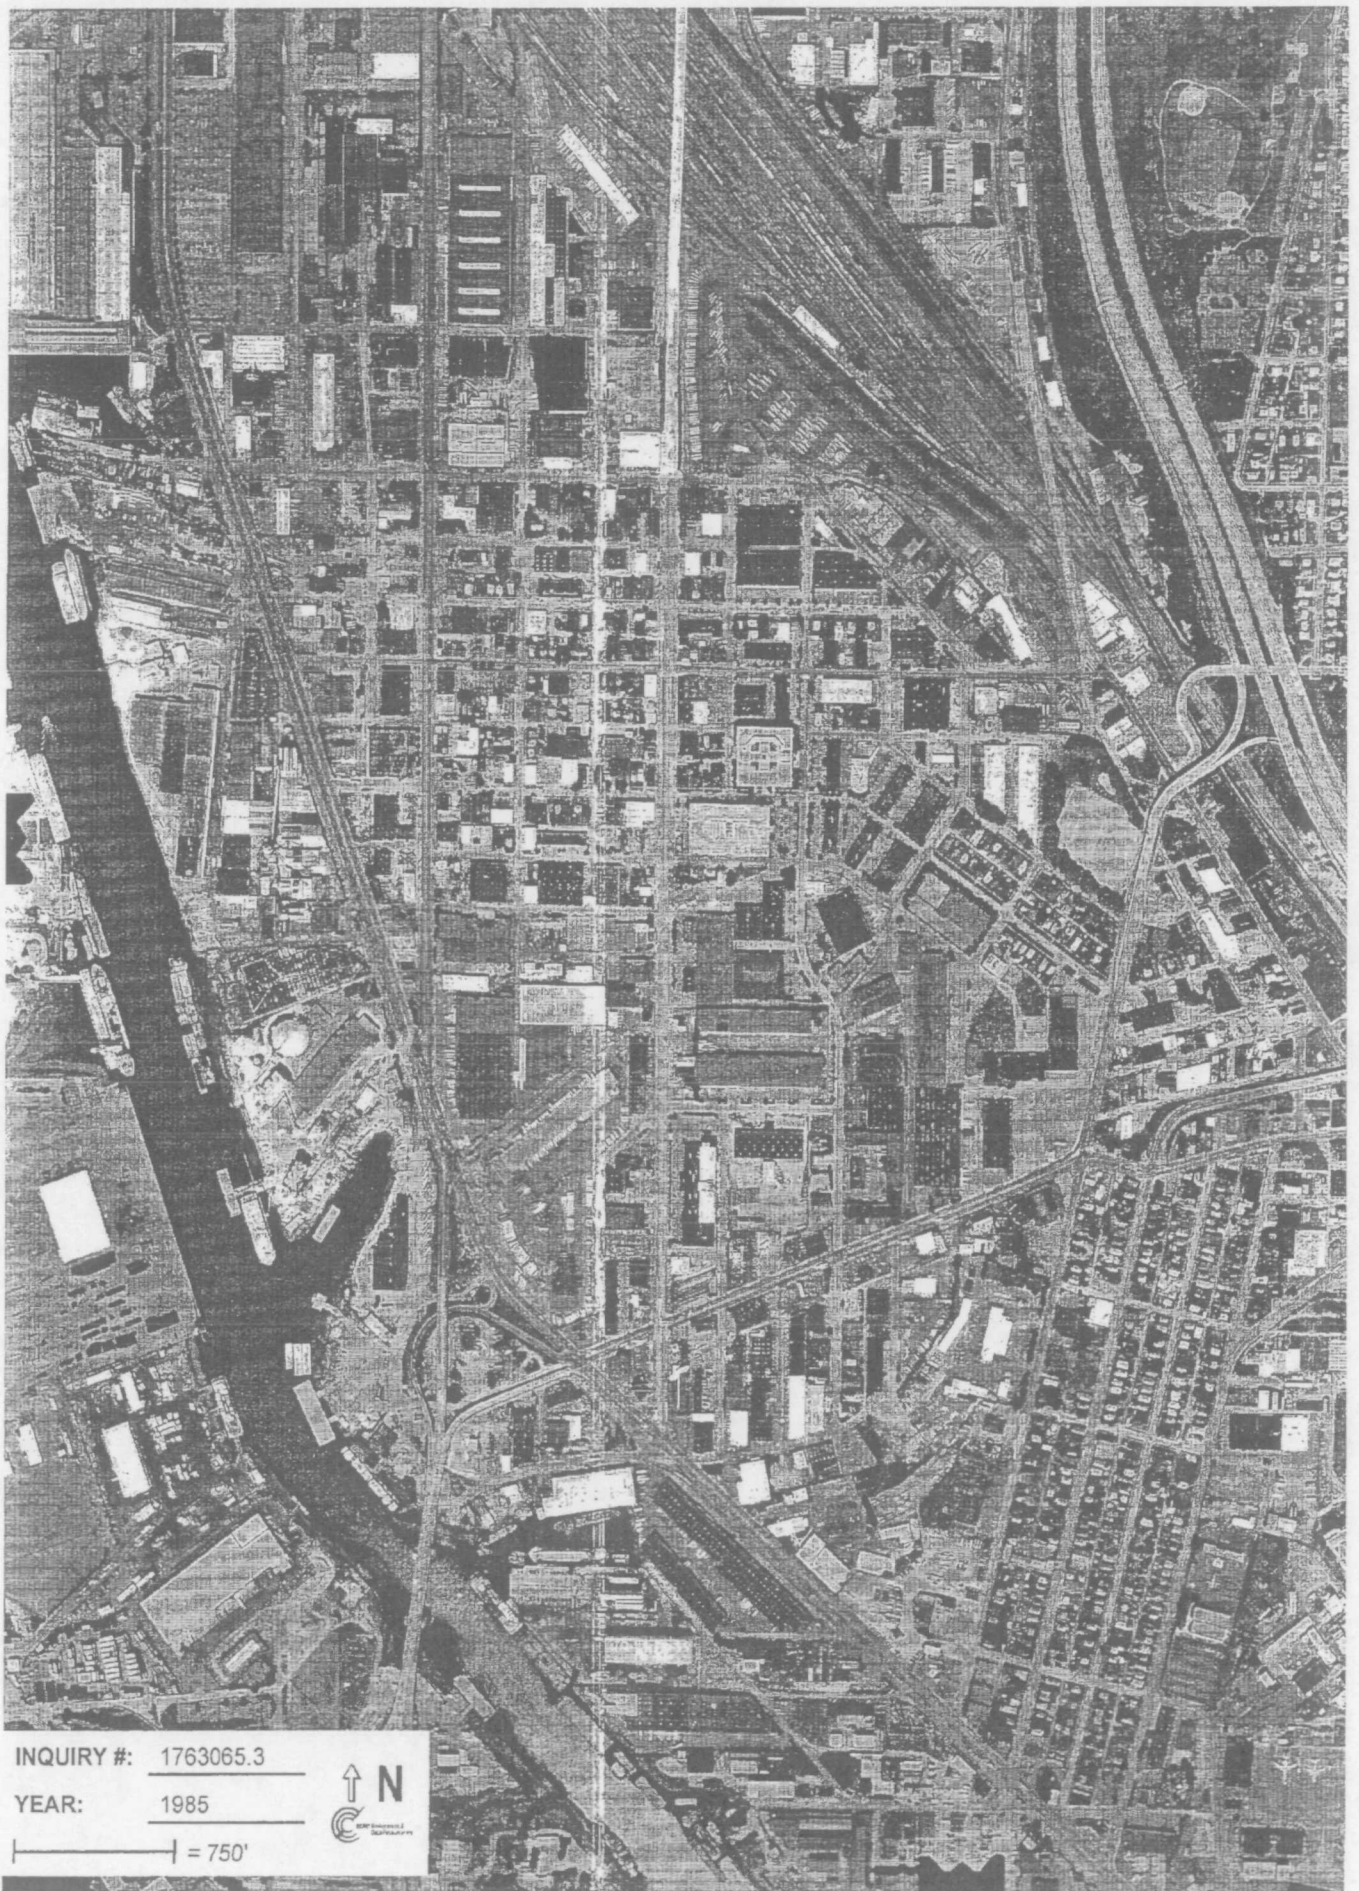

INQUIRY #: 1763065.3

YEAR: 1985

— = 750'



LFC000318



EDR® Environmental
Data Resources Inc

The EDR-City Directory
Abstract

Longview Fibre Seattle
5901 E Marginal Way S
Seattle, WA 98108

Inquiry Number: 1763065.2

Tuesday, September 26, 2006

**The Standard in
Environmental Risk
Management Information**

440 Wheelers Farms Road
Milford, Connecticut 06461

Nationwide Customer Service

Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com

EDR City Directory Abstract

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening report designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

Thank you for your business.

Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

SUMMARY

■ *City Directories:*

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1920 through 2005. (These years are not necessarily inclusive.) A summary of the information obtained is provided in the text of this report.

This report compiles information by geocoding the subject properties (that is, plotting the latitude and longitude for such subject properties and obtaining data concerning properties within 1/8th of a mile of the subject properties). There is no warranty or guarantee that geocoding will report or list all properties within the specified radius of the subject properties and any such warranty or guarantee is expressly disclaimed. Accordingly, some properties within the aforementioned radius and the information concerning those properties may not be referenced in this report.

Target Property:

5901 E Marginal Way S
Seattle, WA 98108

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1920	Address Not Listed in Research Source	R.L. Polk Co publishers
1925	Address Not Listed in Research Source	R.L. Polk Co publishers
1930	Address Not Listed in Research Source	R.L. Polk Co publishers
1935	Address Not Listed in Research Source	R.L. Polk Co publishers
1940	Address Not Listed in Research Source	R.L. Polk Co publishers
1944	Address Not Listed in Research Source	Pacific Telephone Telegraph Co
1951	Address Not Listed in Research Source	R.L. Polk Co publishers
1955	Address Not Listed in Research Source	R.L. Polk Co publishers
1960	Address Not Listed in Research Source	R.L. Polk Co publishers
1966	Address Not Listed in Research Source	R.L. Polk Co publishers
1969	Address Not Listed in Research Source	R.L. Polk Co. Publishers
1970	<u>**E MARGINAL WAY S**</u> LONGVIEW FIBRE CO BOX MFRS R (5901)	R.L. Polk Co Publishers
1971	Address Not Listed in Research Source	Pacific Northwest Bell Telephone Company
1975	Address Not Listed in Research Source	R.L. Polk Co. Publishers
1977	Address Not Listed in Research Source	R.L. Polk Co. Publishers
1980	Address Not Listed in Research Source	R.L. Polk Co. Publishers

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1981	Address Not Listed in Research Source	R. L. Polk Co. Publisher
1985	Address Not Listed in Research Source	R. L. Polk Co. Publisher
1986	Address Not Listed in Research Source	R.L. Polk Co. Publishers
1990	Address Not Listed in Research Source	R.L. Polk Co. Publishers
1991	Address Not Listed in Research Source	R.L Polk Co Publishers
1996	Address Not Listed in Research Source	R.L. Polk Co. Publishers
2005	Address Not Listed in Research Source	Cole Information Services

Adjoining Properties

SURROUNDING

Multiple Addresses
Seattle, WA 98108

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1920	<u>**S 1ST AVE**</u> GASPARI JAS LAB R (5805) DOMINI GIUSEPPI GROCER (5809)	R.L. Polk Co publishers
	<u>**S MEAD ST**</u> SMITH J A MACHT R (134)	R.L. Polk Co publishers
1925	<u>**S 1ST AVE**</u> HAMPTON EDW L CARP R (5802) HAMPTON GORDON LAB R (5802) BURKE ELOF CHARLOTTE L GRO (5806) PINEO WARREN K MECH R (5806) BIANCHI FRED MACH R (5807) DUMINI JOS GRO (5807)	R.L. Polk Co publishers
	<u>**E MARGINAL WAY**</u> &MNFRS (5919) NELSON & BRYAN R J NELSON A E BRYAN BAR (5919) GREENDALE NOVELTY MFG CO A L SMITH (5971) HUTTON TANLEY E MARGT USN (5971) PARAGON SOAP CO W A HUTTON PRES P A MC DONALD SEC (5971) H (5971)	R.L. Polk Co publishers

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1930	<p><u>**S 1ST AVE**</u></p> <p>MC CLYDE HAZEL PKR PAC COAST CEMENT CO (5802) H (5802) BURKE OSCAR E CHARLOTTE GRO (5806) BIANCHI FRED C MACH WIW R (5809) DOMINI JOS LAB R (5809) JOS KATHRYNE DETECTIVE SPD H 2342 (5809)</p> <p><u>**Y 1ST AVE S**</u></p> <p>BIANCHI PALMENA WID ANGELO H (5809)</p> <p><u>**E MARGINAL WAY**</u></p> <p>BERRY BUILDING BLOCKS INC SIMON BERRY PRES MGR (5915) SMITH GRACE MRS BKPR WOOD HYDRAULIC HOIST & BODY CO H (5915) SMITH GRACE CLK G N DOCKS R WALDORF H (5915) BROWNIE MFG CO O F OPPERMAN FURN MFRS (5919) BROWNING ARTEMISSIE WID CHAS H 173 (5919) MART PRODUCTS CORP WILLIS R LEBO PRES MGR FERTILIZER MFRS (5975)</p>	<p>R.L. Polk Co publishers</p> <p>R.L. Polk Co publishers</p> <p>R.L. Polk Co publishers</p>
1935	<p><u>**E MARGINAL WAY**</u></p> <p>NORTHWESTERN GLASS CO EDW S CAMPBELL PRES RALPH J MARSH SEC (5801) PACIFIC LABELING CO FRANK H LENNOX PRES MGR COMI LABELERS (5815) ALASKA REDUCTION CO WILLIS R LEBO IR PRES FISH OIL AND MEAL (5919) MARINE BY PRODUCTS CO CHAS MI THOMSEN PRES WILLIS R LEBO V P (5919) PAVLOSKY NICKOLAS TREAS ALASKA REDUCTION CO R (5919) STANDARD STATIONS INC C B ROGERS DIV MGR GAS AND OIL (5942) SON (5942)</p>	<p>R.L. Polk Co publishers</p>
1940	<p><u>**S 1ST AVE**</u></p> <p>BURKE ELOF O BEER PARLOR (5800) MC PHILLIPS MARTHA MRS (5805) BEER PARLOR (5805) WINTERHALTER NAOMI MRS (5806) NELSON ANDREW (5807) DOMNINI GUISEPPI GRO (5809) FIDAIGO E MARGINAL WAY AND (5809) GREEN AXEL (5809) HYATT HOMER (5809) BLEWER FRED (6001)</p> <p><u>**E MARGINAL WAY**</u></p> <p>NORTHWESTERN GLASS CO (5801)</p>	<p>R.L. Polk Co publishers</p> <p>R.L. Polk Co publishers</p>

Year Uses

Source

1940 (continued)

VACANT (5815)
SILER BOX CO (5911)
SMITH JOHN W (5933)
VACANT (5935)
STANDARD STATIONS INC GAS (5942)
BERN A MOORAGE (5985)

1944 **1ST AVE S**

Pacific Telephone Telegraph Co

BUTRKE OSCAR E BEER PARLOR (5800)
RAINBOW INN BEER PARLOR (5805)
MERRITT THOS D (5807)
NELSON ANDREW (5807)
FIDALGO E MARGINAL WAY AND (5809)
GRAVES JOHLN R GRO (5809)
GRAVES JOLIN MI GRO (5809)
MERRITT THOS D (5809)
R TAYLOR DONALD E (5809)
W MICHIGAN INTERSECT (6001)

E MARGINAL WAY

Pacific Telephone Telegraph Co

NORTHLWESTERN GLASS CO (5801)
SILER BOX MAANUFACTURING (5911)
MODERN EXCAVATION CO (5939)
CONTRA (5939)
STANDARD STATIONS INC GAS (5940)
NEWELL W C CO CEMENT (5941)
CONTRS (5941)
MIOORE JOHN B (5985)
SOOS H L (5985)
WECLKWORTH WM M JR (5985)
MOORAGE (5985)

1951 **1ST AVE S**

R.L. Polk Co publishers

WILL IES TAVERN HA (5800)
3AXTER CHAS (5806)
BURKE O H HA (5806)
RAINBOW INN HA (5806)
SHORT ED F ARM & GARDEN (5821)
STORE LA (5821)
PREC ISON ENGINEERING INC (5915)
MACHE HA (5915)

MARGINAL WAY E

R.L. Polk Co publishers

CORP LA (5800)
NORTHWEST TRACTOR & EQUIP (5800)
NORTHWESTERN GLASS CO (5801)

1763065-2

Year Uses

Source

1966 (continued)

E MARGINAL WAY S (5930)

HYSTER CO TRUCK MFRS P (5930)

INTERSECTS (5930)

****S FIDALGO ST****

R.L. Polk Co publishers

VACANT (106)

LA FONTAINE DELORES MRS (114)

TOBIN FRED H O P (118)

HARRINGTON EQW (124)

****S MEAD ST****

R.L. Polk Co publishers

GARCIA TONY P (104)

TURNER GILBERT L REAR JOHNSON ROBT W P (108)

EDWARDS WM H (111)

CRUZEN W E CO WHOL AUTO SUPS P (112)

SKILLMAN PAULINE A MRS (117)

DAWSON TOOL & ABRASIVE INC HDW WHOL P (122)

CHASE HAZEL C MRS (123)

BOTTON IRENE MRS (125)

CONE FREDK J P (128)

SERAFINE MARIA MRS (132)

LESHER LYLE W P (134)

LAMBERT DANL R E (137)

VACANT (139)

****EAST MARGINAL WAY S****

R.L. Polk Co publishers

RIGGING WHOL & RET P (5800)

WEST COAST WIRE ROPE (5800)

NORTHWESTERN GLASS CO MFRS GLASSWARE R (5801)

LONGVIEW FIBRE CO BOX MFRS R (5901)

KAISER GYPSUM CO INC BLDG MATLS R (5931)

KAISER GYPSUM CO INC CREDIT DEPT R (5931)

STANDARD STATIONS INC P (5940)

CHEMICAL SALES INC R (5975)

CORP CEMENT MFRS (5975)

GLACIER SAND & GRAVEL CO P (5975)

KAISER ALUMINUM (5975)

KAISER CEMENT & GYPSUM (5975)

PAS L O (5975)

1969 Address Not Listed in Research Source

R.L. Polk Co. Publishers

1970 ****S 1ST AVE****

R.L. Polk Co Publishers

WILLIE S TAVERN (5800)

FRAY EQUIPMENT CO INC CONTRS EQUIP R (5821)

UNIROYAL INC DISTR R (5900)

Year Uses

Source

1970 (continued)

ADVANCE OUTBOARD INC BOATS R (5909)
POWER TRANSMISSION SUPPLY R (5920)
TRANSCO NORTHWEST INC (5920)
CAL ORE MACHINERY CO HEAVY EQUIP DISTR R (5930)
E MARGINAL WAY S (5940)
I NTERSECTS (5940)
SEARS ROEBUCK & CO WHSE (5940)

****S FIDALGO ST****

R.L. Polk Co Publishers

VACANT (114)
TOBIN HENRIETTA A MRS (118)
TROPPE ALLEN W O WE (124)
VACANT (124)

****S MEAD ST****

R.L. Polk Co Publishers

VACANT (104)
VACANT (108)
MINTZ EARL (111)
CRUZEN W E CO WHOL AUTO SUPS R (112)
SKILLMAN PAULINE A MRS R (117)
DAMSON TOOL & ABRASIVE INC RP (122)
MC DOUGAL STANLEY R (123)
COTTON IRENE MRS O R (125)
CONE FREOK J E R (128)
SERAFINI MARIA MRS (132)
LESHER LYLE W R (134)
LAMBERT DANL O R (137)
VACANT (139)

****E MARGINAL WAY S****

R.L. Polk Co Publishers

RIGGING WHOL & RET R (5800)
WEST COAST WIRE ROPE S (5800)
INDIANHEAD CO MFRS GLASSWARE R (5801)
NORTHWESTERN GLASS CO AM (5801)
KAISER GYPSUM CO INC BLDG MATLS R (5931)
KAISER GYPSUM CO INC SLS DEPT R (5931)
STANDARD STATIONS INC GAS STA R (5940)
GLACIER SAND S GRAVEL CO DISTR & RET R (5975)
KAISER ALUMINUM & CHEMICAL SALES INC R (5975)
KAISER CEMENT & GYPSUM CORP CEMENT MFRS (5975)

1971 Address Not Listed in Research Source

Pacific Northwest Bell Telephone Company

1975 ****S 1ST AVE****

R.L. Polk Co. Publishers

WILIES TAVERN (5800)
FRAY EQUIPMENT CO INC CONTRA EQUIP (5821)

Year Uses

Source

1975 (continued)

UNIROYAL INC DIATR (5900)
ADVANCE BOAT & MOTOR A (5909)
BAY LINER MARINE CORP BOATS ALA & SERV (5909)
TRANACO NORTHWEST INC POWER TRANSMISSION (5920)
SUPPLY (5920)
CAL ORE MACHINERY CO HEAVY EQUIP DISTR (5930)
SEARS ROEBUCK & CO WHAE (5940)
CEDAR VALLEY FOOD CO RATH PKG CO FROZEN FOODS
(6045)
RATH PACKING CO PLANT WHOL MEATS (6045)
WSTERN CARTAGE SHIP & REC (6051)

****S FIDALGO ST****

R.L. Polk Co. Publishers

LUSTER MACHINERY USED MACH RET (114)
LUSTER MACHY STGE (118)
HARRINGTON EDW (124)

****EAST MARGINAL WAY S****

R.L. Polk Co. Publishers

VACANT (5800)
NORTHWESTERN GLASE UNFIS GLASS CONTAINER (5801)
LONGVLEW IBRE CO BOX TXFRS (5901)
KAISER GYPSUM CO INC SIS DEPT (5931)
KAISER GYPSUM CO INC BLDG MATIS (5931)
STANDARD STATIONS INC (5940)
GLACIER SAND & GRAVEL CO DLSTR & RET (5975)
KAISER ALUMINUM & CHEMICAL SALES INC (5975)
KAISER CEMENT & GYPSUN CORP CEMENT MFRS (5975)

****MEAD ST S****

R.L. Polk Co. Publishers

DAVIA JANES E (104)
GARRISON RICH D L (108)
PETRONE JOHN (111)
CRUSEN W E CO WHOL AUTO SUPS (112)
SKILLINS A PAULINE A MRS (117)
RUDOLPH WILLIAM & CO SERV ETA EQUIP (122)
CHASE HAZEL (123)
BOTTON IRENE MRS IS (125)
CONE FREDK J (128)
SERAFLNI MARIA MRS (132)
LESHER LYLE W (134)
LAMBERT DANI (137)
VACANT (139)

1977 Address Not Listed in Research Source

R.L. Polk Co. Publishers

1980 ****S 1ST AVE****

R.L. Polk Co. Publishers

Year Uses

Source

1980 (continued)

WILLIES TAVERN (5800)
FRAY EQUIPMENT CO INC CONTRS EQUIP (5821)
FREIGHT COST RECOVERY FRT AUD (5900)
VACANT UNIROYAL INC DISTR (5900)
OLYMPIC BOAT CENTER (5909)
U S C O PUBLIC WHSE (5920)
CUMMINS NORTHWEST INDUSTRIES INC DIESEL ENG DISTR
(5930)
E MARGINAL WAY S (5940)
SEARS ROEBUCK & CO WHSE (5940)

****S FIDALGO ST****

R.L. Polk Co. Publishers

VACANT (114)

****S MEAD ST****

R.L. Polk Co. Publishers

TII AV S INTERSECTS (5)
CRUZEN W E CO AHOL AUTO SOPS (112)
INDEPENDENT DEALER ACESSORIES INC (118)
RUDOLPH WILLIAM & INC SER ATA IQUIP (122)
VACANT (128)
SMITH BRYAN R (132)
LESLHR LVK W H (134)

****EAST MARGINAL WAY S****

R.L. Polk Co. Publishers

FRAY EQUIPMENT CO REAR ENTRANCE (5800)
NORTHWESTERN GLASS MFRS (5801)
LONGVIEW FIBRE CO BOX MFRS (5901)
NORWEST GYPSUM INC (5931)
CHEVRON U S A INC GAS ST (5940)
GLACIER SAND & GRAVEL CO DISTR & RET (5975)
KAISER CEMENT CORP (5975)
KAISER CEMENT SIS DIV (5975)

1981 Address Not Listed in Research Source

R. L. Polk Co. Publisher

1985 Address Not Listed in Research Source

R. L. Polk Co. Publisher

1986 ****S 1ST AVE****

R.L. Polk Co. Publishers

FRAY EQUIPMENT CO INC CONTRO EQUIP (5821)
PENETONE CORP WHOL CHEM SLS OFC (5900)
U S C O PUBLIC WAREHOUSING WHSE DISTR (5900)
UNITED PARCEL SERVICE DEL INFO OFO (5900)
VACANT (5909)
U S C O PUBLIC WHSE ADDL SP (5920)
BECKWITH & KUFFEL INDUSTRIES INE AIR COMPRESSORS
(5930)

Year Uses

Source

1986 (continued)

E MARGINAL WAY S (5940)
SEARS ROEBUCK & CO WHSE (5940)

****S MEAD ST****

R.L. Polk Co. Publishers

CRUZEN DISTRIBUTING INC WHOL AUTO SUPS (112)
VACANT (118)
NORTHWEST HYDRA LINE INC FITTINGS SUP (122)
G N P INC WHOL GIFT MFG (128)
HOWE DAVID E (132)
2D AV S INTERSECTS (134)
NO RETURN (134)

****EAST MARGINAL WAY S****

R.L. Polk Co. Publishers

EAST MARGINAL WAY S CONTD (5800)
FRAY EQUIPMENT CO REAR ENTRANCE (5800)
INCON PACKAGING MFRS (5801)
NORTHWEST EMPLOYEES FEDERAL CREDIT UNION (5801)
LONGVIEW FIBRE CO BOX MFRS (5901)
NORWEST GYPSUM (5931)
CHEVRON U S A INC GAS ST (5940)
PIONEER CONSTRUCTION MATERIAL CO (5975)
WESTERN PACIFIC PILEDRIVING DIV OF RIEDEL INTL (5975)

1990

****S 1ST AVE****

R.L. Polk Co. Publishers

FRAY EQUIPMENT CO INC CONTRS EQUIP (5821)
ANDRADA INDUSTRIES CONSTN (5900)
COMMUNICATIONS TECHNICAL SERVICE (5900)
PLUMBING CONCEPTS PLUMBERS (5900)
U S C O PUBLIC WAREHOUSING WHSE DISTR (5900)
B E I INC SAS & EQUIP MTL (5903)
U S C O PUBLIC WHSE ADDL SP (5920)
BECKWITH & KUFFEL INC AIR COMPRESSORS (5930)
GOULDS PUMPS SAS (5930)
VACANT (5940)
ENERGY FOODS INC FOOD MFG (5960)

****S MEAD ST****

R.L. Polk Co. Publishers

VACANT (112)
NORTHWEST HYDRA LINE INC FITTINGS SUP (122)
VACANT (128)
SHIER MARLIN J (134)

****EAST MARGINAL WAY S****

R.L. Polk Co. Publishers

FRAY EQUIPMENT CO REAR ENTRANCE (5800)
BALL IN CON GLASS MFRS (5801)
NORTHWEST EMPLOYEES FEDERAL CREDIT UNION (5801)
LONGVIEW FIBRE CO BOX MFRS (5901)

Year Uses

Source

1990 (continued)

HARDIE JAMES GYPSUM BLDG MATLS (5931)
CHEVRON U S A INC GAS ST (5940)
LONE STAR NORTHWEST BLDG MTLs (5976)

1991 Address Not Listed in Research Source

R.L Polk Co Publishers

1996 ****S 1ST AVE****

R.L. Polk Co. Publishers

FRAY EQUIPMENT CO (5821)
FRAY ROAD MACHINERY (5821)
OLYMPIC MEDICAL CORP (5900)
GOULDS PUMPS INC (5930)
BAKERY (5980)
GAIS NORTHWEST (5980)
GAIS SEATTLE BAKING (5980)
BANK & OFFICE (5990)
INTERIORS (5990)
PROINSTALL (5990)

****S MEAD ST****

R.L. Polk Co. Publishers

CITY ULGHTS ELECTRIC (118)
SUPPLY (118)
FABRICATION (122)
MARTIN SIGNS (122)
VONSP ZOOK MARK W (132)
WHITE GREG D (134)

2005 ****S MEAD ST****

Cole Information Services

STONECRAFT (112)
STONECRAFT (112)
CLTY LIGHTS ELECTRIC SUPPLY INC (118)
NO OCCUPANT (128)
DON G CARVER (132)
C WHITAKER (134)

****1ST AVE S****

Cole Information Services

PRAY QULPMNT CO (5821)
PLUMBING CONCEPTS INC (5900)
ACME FOOD SALES INC (5940)
BAKEMARK INC (5958)
ENER G FOODS INC (5960)
SEE CT FISH (5980)

****E MARGINAL WAY****

Cole Information Services

AIR PRODUCTS & CHEMICALS (5801)
NW EMPLOYEES FDRD CRDT UNION (5801)
SAINT GOBAIN CONTAINERS (5801)
BPB GYPSUM INC (5931)

1763065-2

12

LFC000332

Year Uses

Source

2005 (continued)

CHEVRON STATIONS (5940)

EAST MARGINAL WAY CHEVRON F (5940)

ONODA NORTHWEST INC (5975)



"Linking Technology with Tradition"®

Sanborn® Map Report

Ship To: Don Clabaugh
ENSR Consulting &
9521 Willows Road NE
Redmond, WA 98052

Order Date: 9/26/2006 **Completion Date:** 9/28/2006

Inquiry #: 1763065.1s

P.O. #: na

Site Name: Longview Fibre Seattle

Address: 5901 E Marginal Way S

City/State: Seattle, WA 98108

Cross Streets:

Customer Project: na
1231011BRU 425-881-7700

Based on client-supplied information, fire insurance maps for the following years were identified

1929 - 1 Map
1949 - 1 Map
1967 - 1 Map

Limited Permission to Photocopy

Total Maps: 3

ENSR Consulting & Engineering (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy, a copy of which is available upon request.

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission. EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

LFC000334

USER'S GUIDE

This User's Guide provides guidelines for accessing Sanborn Map® images and for transferring them to your Word Processor.

Reading Sanborn Maps


- Sanborn Maps document historical property use by displaying property information through words, abbreviations, and map symbols. The Sanborn Map Key provides information to help interpret the symbols and abbreviations used on Sanborn Maps. The Key is available from EDR's Web Site at: <http://www.edrnet.com/reports/samples/key.pdf>

Organization of Electronic Sanborn Image File

- Sanborn Map Report, listing years of coverage
- User's Guide
- Oldest Sanborn Map Image
- Most recent Sanborn Map Image

Navigating the Electronic Sanborn Image File

1. Open file on screen.
2. Identify TP (Target Property) on the most recent map.
3. Find TP on older printed images.
4. Using Acrobat® Reader®, zoom to 250% in order to view more clearly. (200-250% is the approximate equivalent scale of hardcopy Sanborn Maps.)
 - A. On the menu bar, click "View" and then "Zoom to..."
 - B. Or, use the magnifying tool and drag a box around the TP

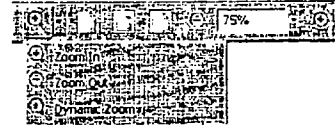

Printing a Sanborn Map From the Electronic File

- EDR recommends printing images at 300 dpi (300 dpi prints faster than 600 dpi)
- To print only the TP area, cut and paste from Acrobat to your word processor application.


Acrobat Versions 6 and 7

1. Go to the menu bar
2. Click the "Select Tool"
3. Draw a box around the area selected
4. "Right click" on your mouse
5. Select "Copy Image to Clipboard"
6. Go to Word Processor such as Microsoft Word, paste and print.



Acrobat Version 5

1. Go to the menu bar
2. Click the "Graphics Select Tool"
3. Draw a box around the area selected
4. Go to "Menu"
5. Highlight "Edit"
6. Highlight "Copy"
7. Go to Word Processor such as Microsoft Word, paste and print.



Important Information about Email Delivery of Electronic Sanborn Map Images

- Images are grouped into one file, up to 2MB.
- In cases where in excess of 6-7 map years are available, the file size typically exceeds 2MB. In these cases, you will receive multiple files, labeled as "1 of 3", "2 of 3", etc. including all available map years.
- Due to file size limitations, certain ISPs, including AOL, may occasionally delay or decline to deliver files. Please contact your ISP to identify their specific file size limitations.

ERROR: limitcheck
OFFENDING COMMAND: image

Appendix D

Qualifications of the Environmental Professional(s)

Don Clabaugh, PE

Senior Program Manager

Mr. Clabaugh has 22 years of diverse experience conducting soil and groundwater contamination investigations, remedial design and cleanup. He manages completion of as many as 250 Phase I environmental site assessments (ESAs) per year. Responsible for client relations, technical review, scheduling as well as performing many site assessments. Mr. Clabaugh also performs and oversees many Phase II and Phase III ESA investigations involving USTs, soil and groundwater contamination, asbestos, radon, and other chemicals of concern. He also has extensive experience managing remedial investigations and feasibility studies (RI/FS), and cleanup actions for the chemical refining, wood treatment and mining industries, and for the Department of Defense and other public concerns.

Education

- BS (Engineering Geology) University of Kansas
- MS (Engineering Geology) University of Akron

Professional Registrations and Affiliations

- PE, Washington, Oregon, Idaho, Alaska and Kansas

Representative Project Experience

USACE Northwest Division, Phase I and II of the Codiga Farms Site, Seattle, Washington (2001). A hazardous materials survey was conducted for a former dairy farm. Testing included surface and subsurface soil for petroleum compounds near former storage tanks, and paint and potential asbestos containing materials at site buildings. Results were used to plan for the safe removal of on-site structures and development of the site.

Confidential Client, Nationwide Program (2001-2003)

Mr. Clabaugh served as the key client contact for Phase I projects performed for a major industrial real estate trust at more than 200 sites in 22 states. Directly performed Phase I ESAs as well as providing resource coordination and quality assurance roles.

Confidential Client, Cemetery and Funeral Home Due Diligence (2004)

Mr. Clabaugh managed two teams completing due diligence evaluations at over 40 funeral homes and cemeteries in Washington, Oregon and Alaska over a three month period. Phase I evaluations were followed up with subsurface evaluations at 15 sites, underground storage tank decommissioning and assessments at seven sites and remediation at three sites.

Basin Oil Company, Used Oil Recycler Regulatory Compliance and Facility Closure, Seattle, Washington (2001-2006). Mr. Clabaugh works directly with the facility owner, the City of Seattle and Washington State Department of Ecology on closure activities for a facility with 22 aboveground storage tanks (ASTs) with over 150,000 gallon capacity, and over 600 55-gallon barrels of waste..

Aaron B. Gesin

Manager, Environmental Site Assessments

Years Experience: 18

Technical Specialties

- Environmental Due Diligence Studies for Business and Real Estate Transactions
- Soil and Groundwater Contaminant Characterization
- Environmental Compliance Auditing
- Asbestos Inspection and Abatement Project Management

Professional History

- ENSR Consulting and Engineering
- Hunter Environmental Sciences, Inc.

Education

- BS (Biology) University of Massachusetts, Lowell

Professional Registrations and Affiliations

- Certified Asbestos Abatement Project Monitor, Massachusetts
- Certified Asbestos Inspector, Massachusetts

Representative Project Experience

A. Environmental Due Diligence Studies

Mr. Gesin manages the environmental site assessment practice in ENSR's Westford office. He has prepared more than two thousand environmental due diligence studies in support of mergers and acquisitions, leveraged buyouts, and refinancings involving commercial and industrial facilities located in North America, South America, Asia, and Europe. These studies focused on investigating the potential presence of a major on-site contamination problem; for larger, more complex transactions, the analysis also included an assessment of off-site contingent liabilities (Superfund involvement) as well as an evaluation of the environmental permit and regulatory compliance status of the facility. The compliance evaluations covered the full range of environmental issues, ranging from air quality, water quality, and hazardous wastes to sewage disposal, land use controls, and wetlands. Representative due diligence studies performed are summarized below.

Fleet Capital, Environmental Due Diligence, Eastern United States. Project manager for environmental due diligence evaluation of six (6) RCRA transport, storage and disposal facilities located in the eastern U.S. The evaluation included a review of potential liabilities related to site contamination and environmental compliance. Evaluation included a comprehensive review of the status of RCRA corrective action/closure programs. Also developed liability cost estimates and evaluated these estimates against reserves previously prepared by the company.

Use or disclosure of data contained on this sheet is subject to the restriction on the title page of this proposal.

AES Horizons, Environmental Due Diligence Review and EIA for Proposed Power Project, Galabovo, Bulgaria. Performed an environmental due diligence evaluation of the site of a proposed 670 MW coal-fired power project in Galabovo, Bulgaria. The purpose of the review was to identify environmental liabilities and to meet the requirements of two potential lenders, OPIC and EBRD. The investigation of the study site, which was the location of a former coal-fired power plant, included site inspection, interviews, historical research, soil and groundwater sampling, and various geophysical surveys. Also assisted in the preparation of an EIA for the proposed project.

Confidential U.S. Multinational Client, Environmental Due Diligence Evaluation for Divestiture, Various. Project manager for environmental liability evaluation of 16 medical equipment manufacturing plants, distribution facilities, and services centers located in the U.S., Europe, Japan, Australia, and Singapore. ENSR implemented a questionnaire to evaluate certain of the lower-risk, foreign operations and their potential liabilities. Also developed liability cost estimates covering domestic and foreign sites and evaluated these estimates against environmental reserve estimates previously prepared by the company.

U.S. Oil Company, Environmental Review and Liability Cost Assessment for Refinancing of 250 Gas Stations, Puerto Rico. Project manager for liability evaluation of 250 gas stations in Puerto Rico. Evaluated corporate and island agency files against existing environmental reserves. Developed several financial and cost models as part of the work program. These models were capable of evaluating alternative scenarios and assumptions regarding not only the direct capital costs of remediation, but also the long-term operations and maintenance expenses.

The Stanley Works, Predivestiture Environmental Assessments, United States. Managed a due diligence evaluation of 68 equipment rental facilities located throughout the United States. Following the initial phase of the assessment, which included an evaluation of all potential environmental liabilities and a review of regulatory compliance programs, multiphase site characterization and remediation were performed at over twenty sites.

MeadWestvaco Corporation, Environmental Site Assessment of Five Integrated Pulp and Paper Mill Facilities, United States. Project manager for an environmental site assessment of five (5) integrated mills located in the United States. The evaluation included a review of potential liabilities related to site contaminations, environmental compliance, and off-site disposal of waste.

International Paper, Environmental Due Diligence Investigation, United States Forestlands. Project manager for environmental liability evaluation of more than six (6) million acres of forestlands. Evaluations included potential compliance issues related to the forests, land management, and operations within the forest lands.

Confidential Client, Environmental Due Diligence Investigation, Two Integrated Paper Mills, Millinocket, Maine. Project manager for an environmental liability evaluation of two pulp and paper mills and three off-site landfills located in Millinocket, Maine. The evaluation included a review of potential liabilities related to site contamination, environmental compliance, and off-site disposal of waste. Project also included a review of potential operational and financial impacts from future regulatory initiatives.

Use or disclosure of data contained on this sheet is subject to the restriction on the title page of this proposal.

AES Silk Road Holdings, B.V., Environmental Evaluation of Electrical Distribution System, City of Tbilisi, Georgia. Conducted an environmental evaluation of the electrical distribution system for the city of Tbilisi, Georgia. The assessment was conducted pursuant to the terms of an Agreement with the State of Georgia. The purpose of the assessment was to determine whether any liabilities exist at the distribution system assets, and whether the distribution company operations were in compliance with applicable environmental laws and regulations. Assets reviewed for the investigation included 37 major substations, 1,400 minor substations, distribution lines/cables, vehicle repair garages, transformer repair and maintenance shops, and offices.

Proskauer Rose LLP, Environmental Due Diligence Evaluation of 18 Refractories Manufacturing Plants and Associated Mines, U.S. and Canada. Project Manager for the evaluation of eighteen manufacturing plants and several mines located throughout the U.S. and Canada. The evaluation included a review of potential liabilities related to site contamination, environmental and health and safety compliance, and offsite disposal of waste. Also developed liability cost estimates and evaluated these estimates against environmental reserve estimates previously prepared by the company.

AES Electric Limited, Environmental Due Diligence Evaluation of Two Coal-Fired Generating Stations, Turkey. Conducted an environmental site assessment of two 450 megawatt coal-fired generating stations and an associated ash landfill located in Turkey. These studies were part of our client's due diligence activities conducted prior to offering their bid for the assets. Conducted an evaluation of potential liabilities related to soil and groundwater contamination. Also evaluated the facilities' compliance with World Bank standards and best management practices (BMP).

Bingham Dana LLP, Due Diligence Investigation of Nine Printing Plants, United States. Project manager for the evaluation of nine (9) printing plants located in United States. The investigation was conducted over a three-week period and involved consideration of the full range of potential environmental issues, including onsite contamination, regulatory compliance, and offsite contingent liabilities. Liability cost estimates were also prepared as part of the assignment.

Johnson & Johnson, Environmental Due Diligence Investigation, Ethicon Endo-Surgery, Southington, CT. Conducted a Phase I environmental, health and safety due diligence investigation of this medical equipment manufacturing facility. The evaluation included a review of potential liabilities related to site contamination, environmental and health and safety compliance, and off-site disposal of waste.

Edison Mission Energy, Environmental Due Diligence Evaluation of Fossil Fuel Generating Stations, NE United States. Conducted an environmental site assessment of three fossil fuel generating stations located in the Northeast. These studies were part of the client's due diligence activities conducted prior to offering their bid for the assets. Conducted an evaluation of potential liabilities related to contamination, environmental and health and safety compliance, and offsite disposal of waste. Also developed liability cost estimates and evaluated these estimates against environmental reserve estimates previously prepared by the company.

Confidential Client, Environmental Due Diligence Evaluation of Tool Manufacturing Facilities, China and Taiwan. In support of the establishment of a

potential joint venture involving a U.S. multinational, conducted an environmental due diligence evaluation of three tool manufacturing facilities located in China and Taiwan. Conducted an evaluation of potential liabilities related to soil and groundwater contamination. Also, assessed the facilities' compliance with country and local regulations as they relate to air quality, water quality, regulated waste, storage tanks, and chemical substance control. Used a probability/risk-based model to evaluate liability costs.

Confidential Client, Environmental Due Diligence Investigation of Eighteen Commercial Laundry Facilities, United States. Project manager for the investigation of eighteen (18) commercial laundry facilities located in the U.S. The due diligence study was completed within three weeks. An evaluation of facility compliance with state and federal environmental regulations was completed, along with an assessment of contingent off-site liability.

Atmos Energy Corporation, Environmental Due Diligence Evaluation of Natural Gas Pipeline Assets, United States. Project manager of an environmental due diligence evaluation of various natural gas pipeline assets, including: four distribution pipelines, several district offices and construction yards, vehicle maintenance shops, a compressor station, a meter repair shop, and several regulator stations. The assessment included a review of liabilities associated with soil and groundwater contamination, regulatory compliance, and off-site disposal of waste.

Confidential Petroleum Industry Client, Environmental Due Diligence Evaluation of Various Assets. Project manager for the evaluation of various petroleum refining and distribution assets for the purpose of restructuring company operations. Evaluated a refinery, three bulk terminals, several fleet truck fueling depots and maintenance facilities, a crude oil gathering system, and a refined products pipeline. A review of environmental liabilities was conducted, including an assessment of compliance relative to state and federal environmental regulations. Estimated refinery closure costs and tank/pipeline upgrade and maintenance costs. Also, completed an analysis of the company's financial reserves for those activities.

International Specialty Products, Inc., Environmental Due Diligence Investigation, Freetown, Massachusetts. Conducted an environmental due diligence investigation at a 175-acre chemical manufacturing facility located in Freetown, MA. The purpose of this investigation was to evaluate environmental liabilities associated with this 40-year-old chemical manufacturing facility. As part of the investigation, twenty-five areas of potential environmental concern were identified and/or investigated. The investigation consisted of extensive soil and rock borings, groundwater sampling, sediment sampling, and geophysical and soil gas surveys. Using the field data, developed detailed cost estimate associated with addressing issues of environmental concern. Provided assistance in developing negotiating strategy for this acquisition.

B. Environmental Compliance Auditing

Mr. Gesin has been involved in managing several environmental audits of operating manufacturing facilities, assisting senior management in identifying areas of potential future liability associated with on-going operations. He was also involved in developing audit protocols for companies desiring to implement audit programs in China and Taiwan. Representative project experience is described below.

General Star Management Company, Environmental Risk Evaluation Program.

Manager of an environmental risk evaluation program for an environmental insurance provider. Developed and implemented various environmental assessment programs to evaluate risk associated with environmental contractors and consultants, in support of the company's professional and pollution liability insurance business. Completed over 600 audits since 1994.

Confidential Client, Facility Compliance Audits. Conducted environmental compliance audits at two manufacturing facilities in Asia. Evaluated facilities' compliance with local and country regulations. Prepared an audit report with a prioritized action plan and associated cost estimates for implementation of corrective measures.

AES Aurora, Environmental Audit of Three Electrical Distribution Systems, El Salvador. Conducted an environmental, health and safety audit of the CAESS, EEO and DEUSEM distribution facilities in El Salvador. The focus of the audit, which was conducted under Terms of Reference provided by the IFC, was the potential for contamination as well as worker health and safety and compliance with local and World Bank guidelines. Assets reviewed for the investigation included substations, distribution lines/cables, vehicle repair garages, transformer repair and maintenance shops, and offices. An Environmental Action Plan that outlined steps needed to address issues raised in the audit was prepared that included estimated schedule and cost.

ICI Pharmaceutical, Facility Compliance Audit. Task Manager for site assessment and environmental compliance audit of a pharmaceutical manufacturer. Work consisted of a complete facility compliance audit and site inspection including installation of groundwater monitoring wells. Final report served as a technical document which identified ongoing requirements for compliance with Puerto Rico and federal regulations.

Dexter Pultrusions, Facility Compliance Audit, Ohio. Task manager for site assessment and environmental compliance audit of a subsidiary of Dexter Corporation. Work included a complete facility compliance audit, site inspection and the installation of groundwater monitoring wells. The final report served as a technical document to support transfer of ownership of the facility and identified applicable Ohio and federal regulations regarding RCRA, SARA, and CERCLA.

Various Clients, Environmental Compliance Audits. Conducted environmental compliance audits at dozens of commercial and industrial facilities. Evaluated plants for compliance with federal and state regulations governing solid, hazardous and medical waste management, air emissions, emergency planning and right-to-know, USTs, wastewater discharge, drinking water, and PCBs.

C. Other Project Experience

Fitchburg Gas & Electric, Asbestos Abatement/Stabilization, Fitchburg, Massachusetts. Managed a state-ordered asbestos abatement/stabilization of a partially demolished power plant. Oversaw the removal of more than 1,300 cubic yards of contaminated rubble. Responsibilities also included oversight of asbestos abatement of boiler unit, piping, rooftop deaerator tanks, and boiler and building stabilization procedures.

Hess Oil Virgin Islands Corp., Asbestos Abatement/Cleanup, Virgin Islands.

Monitored asbestos abatement, developed a perimeter monitoring program, conducted personnel sampling, designed the abatement/cleanup method, and conducted bulk sampling of hurricane-damaged refinery towers.